



Machine Id
8325
Component
Hydraulic System
Fluid
PETRO CANADA HYDREX MV 32 (--- GAL)

RECOMMENDATION

Nous vous recommandons de vérifier tous les endroits par lesquels des contaminants peuvent pénétrer dans le système. Nous vous recommandons de remplacer le filtre et d'utiliser un système de filtrage hors-ligne afin d'améliorer la propreté du fluide. Le reniflard d'air doit être réparé. S'il n'est pas classé, nous vous recommandons de le remplacer par un reniflard à air adapté au micron et / ou au dessicant. Si évalué, nous vous recommandons de réparer / remplacer le reniflard. Échantillonner de nouveau dans 30 à 45 jours afin de contrôler la situation.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		GFL0107612	GFL0061839	GFL0061825
Sample Date		Client Info		16 Feb 2024	24 Nov 2022	09 Nov 2022
Machine Age	kms	Client Info		328724	14765	15465
Oil Age	kms	Client Info		0	0	0
Filter Age	kms	Client Info		0	0	0
Oil Changed		Client Info		Not Changd	Not Changd	N/A
Filter Changed		Client Info		Changed	Not Changd	Changed
Sample Status				SEVERE	ABNORMAL	ATTENTION

WEAR

Les taux d'usure de tous les composants sont normaux.

Iron	ppm	ASTM D5185(m)	>40	4	9	3
Chromium	ppm	ASTM D5185(m)	>5	<1	<1	0
Nickel	ppm	ASTM D5185(m)	>2	<1	0	<1
Titanium	ppm	ASTM D5185(m)	>2	0	0	0
Silver	ppm	ASTM D5185(m)		0	0	0
Aluminum	ppm	ASTM D5185(m)	>8	<1	<1	<1
Lead	ppm	ASTM D5185(m)	>5	<1	0	0
Copper	ppm	ASTM D5185(m)	>20	<1	<1	<1
Tin	ppm	ASTM D5185(m)	>2	0	0	0
Vanadium	ppm	ASTM D5185(m)		0	0	0
White Metal	scalar	Visual*	NONE	NONE	NONE	NONE
Yellow Metal	scalar	Visual*	NONE	NONE	NONE	NONE

CONTAMINATION








Il y a une quantité élevée de matières particulaires (2 à 100 µm de taille) présente dans l'huile.

Silicon	ppm	ASTM D5185(m)	>20	<1	<1	<1
Potassium	ppm	ASTM D5185(m)	>20	2	2	<1
Water		WC Method	>0.1	NEG	NEG	NEG
Particles >4µm		ASTM D7647	>5000	▲ 20937	▲ 10145	4321
Particles >6µm		ASTM D7647	>1300	▲ 7476	● 2290	● 1540
Particles >14µm		ASTM D7647	>160	▲ 1227	151	159
Particles >21µm		ASTM D7647	>40	▲ 380	37	42
Particles >38µm		ASTM D7647	>10	▲ 24	1	2
Particles >71µm		ASTM D7647	>3	2	0	0
Oil Cleanliness		ISO 4406 (c)	>19/17/14	▲ 22/20/17	▲ 21/18/14	● 19/18/14
Silt	scalar	Visual*	NONE	NONE	NONE	NONE
Debris	scalar	Visual*	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	Visual*	NONE	NONE	NONE	NONE
Appearance	scalar	Visual*	NORML	NORML	NORML	NORML
Odor	scalar	Visual*	NORML	NORML	NORML	NORML
Emulsified Water	scalar	Visual*	>0.1	NEG	NEG	NEG

FLUID CONDITION

L'huile peut encore servir si la contamination peut être réduite à un niveau acceptable.

Sodium	ppm	ASTM D5185(m)		1	2	<1
Boron	ppm	ASTM D5185(m)	0	0	<1	<1
Barium	ppm	ASTM D5185(m)	0	0	0	0
Molybdenum	ppm	ASTM D5185(m)	0	0	<1	0
Manganese	ppm	ASTM D5185(m)	1	0	<1	0
Magnesium	ppm	ASTM D5185(m)	0	4	15	2
Calcium	ppm	ASTM D5185(m)	50	67	69	55
Phosphorus	ppm	ASTM D5185(m)	330	354	365	348
Zinc	ppm	ASTM D5185(m)	430	444	418	408
Sulfur	ppm	ASTM D5185(m)	760	843	797	781
Visc @ 40°C	cSt	ASTM D7279(m)	31.9	32.1	32.0	31.8

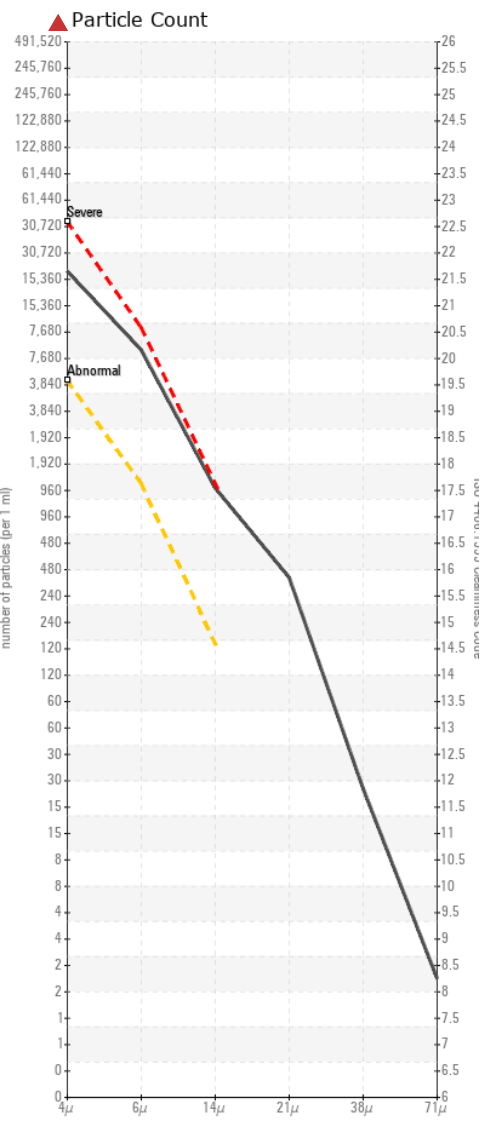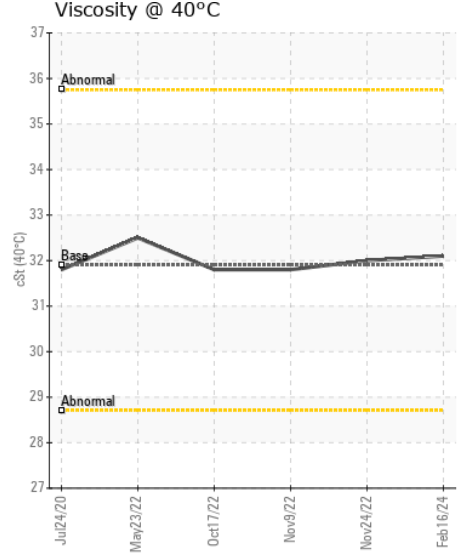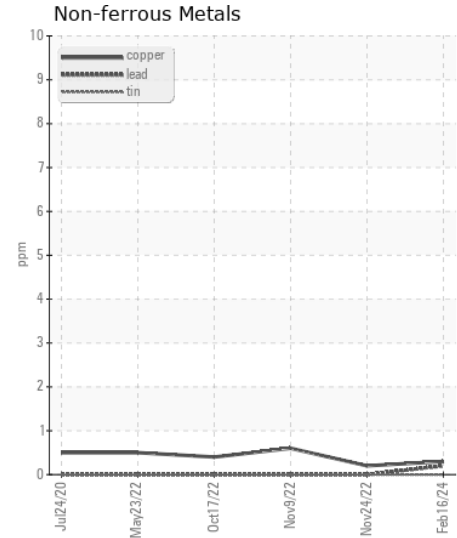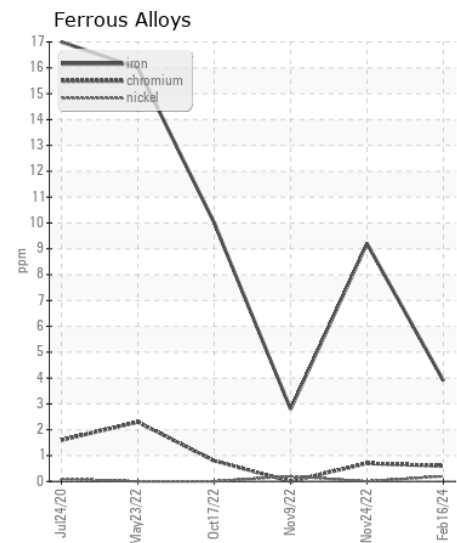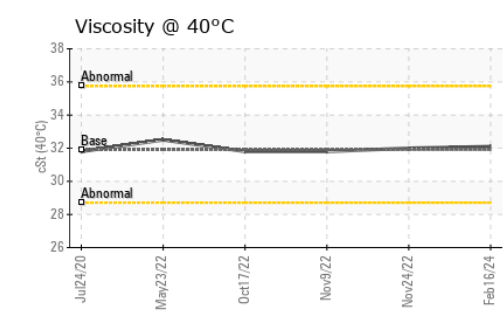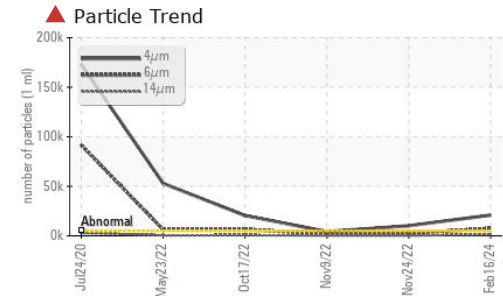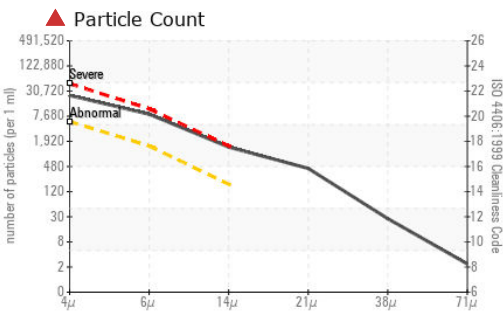

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : GFL0107612 **Received** : 04 Mar 2024
Lab Number : 02619725 **Tested** : 05 Mar 2024
Unique Number : 5736835 **Diagnosed** : 05 Mar 2024 - Wes Davis
Test Package : MOB 1 (Additional Tests: PrtCount)

GFL Environmental - 747 - GMA - Solid Waste
 4 Chemin du Tremblay,
 Boucherville, QC
 CA J4B 6Z5
 Contact: Steve Voyer
 svoyer@matrec.ca

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.