

# **MORA HE**

# Customer: PTRHTF40043

MORA PRODUCTIE BV FREGATWEG 53 MAASTRICHT 6222NZ MAASTRICHT, 6222NZ Netherlands

Attn: WILBERT SNIJERS

Tel:

E-Mail: w.snijers@klt.nl

# System Information

System Volume: 800 ltr

Bulk Operating Temp: 300F / 149C

**Heating Source:** 

Blanket:

Fluid: PETRO CANADA PURITY FG HEAT TRANSFER FLUID

Make:


#### Sample Information


Lab No: 02269987 Analyst: Philip Riley Sample Date: 02/21/19 Received Date: 02/26/19 Completed: 02/28/19


Recommendation: This follows the critical sample recently which I am aware was addressed. The flash point is very low, the GC shows evidence of light ends and cracking. If the fluid cannot be recovered safely I would recommend a change, including a clean and flush with appropriate products.

Comments: Iron ppm levels are abnormal. (GCD) 10% Distillation Point is severely low. COC Flash Point is severely low. (GCD) % < 335°C is abnormally high.



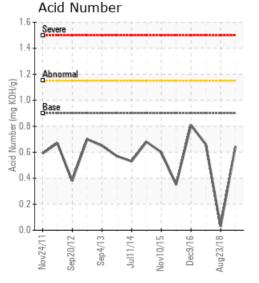


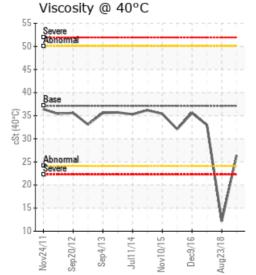


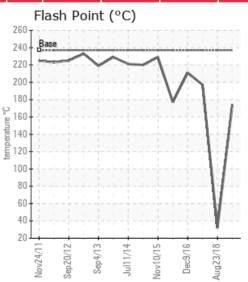




11/10/15

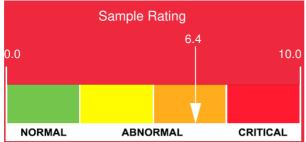


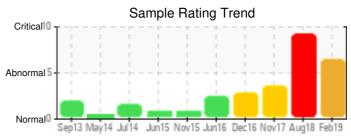

Sample Date	lron	Chromium	Nickel	Aluminum	Copper	Lead	Tin	Cadmium	Silver	Vanadium	Silicon	Sodium	Potassium	Titanium	Molybdenum	Antimony	Manganese	Lithium	Boron	Magnesium	Calcium	Barium	Phosphorus	Zinc
02/21/19	222	0	0	0	0	0	0	0	0	0	2	0	0	0	0	0	2	0	0	0	0	0	170	12
08/23/18	90	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	55	6
11/24/17	271	0	0	0	0	0	0	0	0	0	2	1	0	0	0	0	2	0	0	0	0	0	137	13
12/09/16	139	0	0	0	0	0	0	0	0	0	0	2	0	0	0	0	0	0	0	0	0	0	90	9
06/21/16	11	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	36	4
11/10/15	131	0	0	0	0	0	0	0	0	0	0	0	1	0	0	0	0	0	0	0	0	0	86	8
Baseline Data			0	0						0			0	0					0				230	

Elemental analysis results (above) in parts per million (ppm). [10,000 ppm = 1.0%]

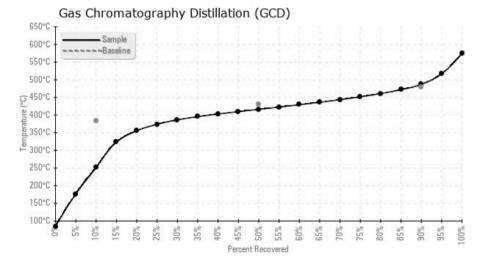

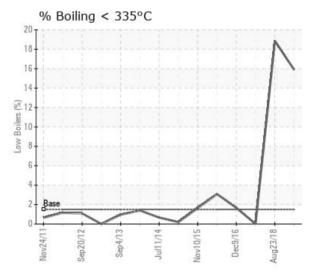

#### **Historical Comments**

\*\*\* NOTE: This sample represents a severe fire hazard. Please notify the customer urgently! \*\*\*Product must be changed immediately. Although we believe the system is

not in use currently, the oil must be changed ahead of re-start. The flash point is dangerously low and as such presents a serious hazard. (GCD) % < 335°C is severely high. (GCD) 10% Distillation Point is severely low. COC Flash Point is severely low. Visc @ 40°C is severely low. (GCD) 90% Distillation Point is abnormally low.

Flash point slightly low and build up of iron particles showing high wear. Within condemnation limits on both parts but the fluid has significantly deteriorated since last sample. Similar degradation will require oil change in 12 months time unless filtration is used to try and reduce particles and wear, it may extend fluid life beyond the next 12 monthsPQ levels are abnormal. Iron ppm levels are abnormal. COC Flash Point is marginally low.

Higher than expected levels of Iron reported. Try to detect where the Iron is originating from as this will cause the oil to deteriorate. Oil appears to be acceptable for further use at this time. Suggest sample at next scheduled maintenance interval. Iron ppm levels are abnormal. (GCD) 90% Distillation Point is severely high.

COC Flash Point tested twice: 177°C and 178°C. There are some low boilers present - remove low boilers if possible. Oil is fit for further service. Suggest sample at next scheduled maintenance interval. (GCD) 90% Distillation Point is marginally low.

Oil appears to be in good condition and fit for further service.Sample at next scheduled maintenance interval. (GCD) 90% Distillation Point is marginally low.

Petro-Canada makes no representation or warranty of any kind, either express or implied, as to the accuracy or completeness of the analysis and assumes no responsibility and shall have no liability whatsoever

with respect to such analysis, or a party's use of it. Petro-Canada is a division of HollyFrontier Corporation.