


LINE 3 HOT OIL SYSTEM

System Information	Sample Information
tem Volume: 9450 gal	Lab No: 02420348
COperating Temp: 474F / 246C	Analyst: Neil Buchanan
ting Source:	Sample Date: 04/29/21
nket:	Received Date: 05/11/21
d: PETRO CANADA CALFLO AF	Completed: 05/13/21
ke:	Neil Buchanan
	neil.buchanan@hollyfrontier.com
	Operating Temp: 474F / 246C ting Source: ket: d: PETRO CANADA CALFLO AF

Recommendation: Sample results look good but flash point is marginally low. Resample next interval to monitor.


Comments: COC Flash Point is marginally low.

Sample Date	Received Date	Fluid Age	Sample Location	Flash Point (COC)	Water (KF)	Viscosity (40°C)	Acid Number	Solids	GCD 10%	GCD 50%	GCD 90%	GCD % < 335°C
	mm/dd/yy			°F/°C	ppm	cSt	mg/KOH/ g	%wt	°F/°C	°F/°C	°F/°C	%
04/29/21	05/11/21	15.0y		363 / 184	14.1	24.6	0.08	0.047	668 / 353	775 / 413	889 / 476	6.19
06/18/20	06/29/20	0.0y	main system	334 / 168	16.1	28.4	0.06	0.094	672 / 356	782 / 417	886 / 475	5.70
09/24/19	10/21/19	0.0y	MAIN SYSTEM FLOW	354 / 179	16.7	22.3	0.065	0.128	681 / 360	788 / 420	896 / 480	4.55
09/30/18	10/10/18	0.0y		347 / 175	10.0	22.8	0.050	0.031	671 / 355	766 / 408	862 / 461	4.41
09/02/17	09/12/17	4.0y	MAIN SYSTEM FLOW	383 / 195	12.1	<mark>20.3</mark>	0.085	0.029	682 / 361	773 / 412	870 / 466	2.62

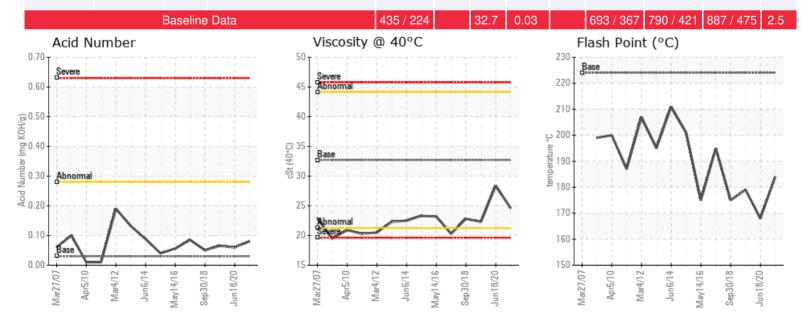

Report ID: [02420348] (Generated: 05/17/2021 10:45:59) - Page 1 - Copyright 2021 Wearcheck Inc. All Rights Reserved.



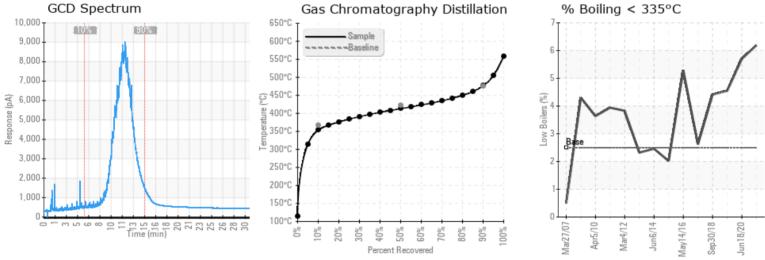

Historical Comments

06/18/20	Sample remains dry, free of contamination with a stable Acid Number. The trend of decreasing COC Flash Point and lower Initial Boiling Point and examination of the GCD graph suggests the continued formation of low boilers from thermal degradation. Continue venting to remove and resample next interval. COC Flash Point is abnormally low.
09/24/19	The oil is holding steady, although some properties like viscosity and flash point are flagged. This is likely due to the presence of Therminol 55 in this system when the computer compares to Calflo AF. Contamination by asphalt, water or other elements is insignificant or non-detectable. No actions needed at this time. Re-sample at next scheduled interval COC Flash Point is abnormally low.
09/30/18	This system has a history of having lower viscosity and what doesn't help is the flaws in the ASTM open cup flash point test is results jump up and down. So the viscosity is higher than on the last sample, yet the flash point is flagged for being lower. Overall you have managed this system well, just make sure the viscosity remains at least 23 cSt, but ideally we would like it to be a little higher. Since it seems to be more prone to thermal cracking, a slightly more frequent venting and replenishing might be needed on this system. COC Flash Point is abnormally low.
09/02/17	The viscosity remains low although the flash point and boiling properties remain normal. We suggest to maintain a certain venting schedule to prevent further reduction in viscosity and decrease in flash point. Remember to replace light ends vented off by adding fresh oil. Best practices suggest that the oil level in the expansion tank should be 75% full when in operation. Visc @ 40°C is abnormally low.

Petro-Canada makes no representation or warranty of any kind, either express or implied, as to the accuracy or completeness of the analysis and assumes no responsibility and shall have no liability whatsoever with respect to such analysis, or a party's use of it. Petro-Canada is a division of HollyFrontier Corporation.