CONSTRUCTION EQUIPMENT

[[575873]] LIEBHERR HS8100 184908 - 1 Winch

Sample No: LH0277706

Oil Type: PETRO CANADA TRAXON 75W90 SYNTHETIC

Sample In					
Sample Number	LH0277706	LH0251529	LH0230698		
Sample Date	12 Oct 2023	23 Jan 2023	22 Jul 2022		
Machine Hours	12289	10946	10063		
Oil Hours	0	0	0		
Oil Changed	N/A	Changed	N/A		
Sample Status	ABNORMAL	ABNORMAL	SEVERE		
Oil Condition					



Tillsonburg Ready-Mix Inc. 10 Elm Street

Tillsonburg, ON **CA N4G 0A7**

Contact: Service Manager

T: F:

Visc @ 40°C	cSt	85.3	93.3	0 102
-4				

Contamination

Water	%	NEG	NEG	NEG	
Silicon	ppm	7	O <1	3	
Sodium	ppm	1	O <1	O 1	
Potassium	ppm	0	0	0	

Wear Metals

Zir Ph Ва Boron

PQ		31		0	
Iron	ppm	971	19	315	
Copper	ppm	25	3	15	
Lead	ppm	1	O <1	1	
Tin	ppm	0	0	0	
Aluminum	ppm	0 <1	O 0	 <1	
Chromium	ppm	<u> </u>	O 0	3	
Molybdenum	ppm	0	O <1	O <1	
Nickel	ppm	3	O 0	1	
Titanium	ppm	0	0	0	
Silver	ppm	<1	0	0	
Manganese	ppm	8	O <1	3	
Vanadium	ppm	0	0	<1	

Diagnosis

We recommend that you drain the oil from the component if this has not already been done. Confirm the source of the lubricant being utilized for top-up/fill. We recommend an early resample to monitor this condition.Chromium and iron ppm levels are abnormal. The diagnosis reflects updated information on this component. There is no indication of any contamination in the oil. Additive levels indicate the addition of a different brand, or type of oil. The oil is no longer serviceable as a result of the abnormal and/or severe wear.

Add	ditives				
Calcium	ppm	9	○ 36	O 10	
Magnesium	ppm	2	O 2	3	
Zinc	ppm	47	○ 81	87	
Phosphorus	ppm	802	O 1316	1209	
Barium	ppm	0 0	0	0	

Depot: TIL10TIL Unique No: 5658780 Signed: Kevin Marson **Report Date:** 18 Oct 2023

ppm

LIEBHERR

CONSTRUCTION EQUIPMENT





Graphs

