


PROBLEM SUMMARY

Gas Compression [450312985]


Compressor (MP)- Lubrication System (S/N Sample Tag XX-23002-S1)


Lube System

PETRO CANADA TURBOFLO XL32 (10350 LTR)

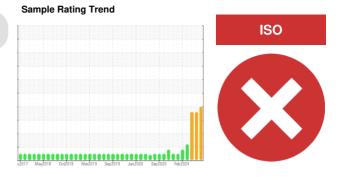

COMPONENT CONDITION SUMMARY

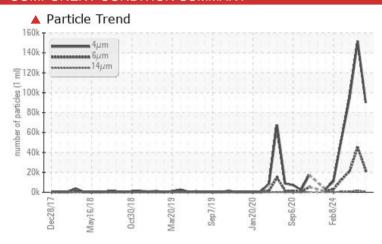

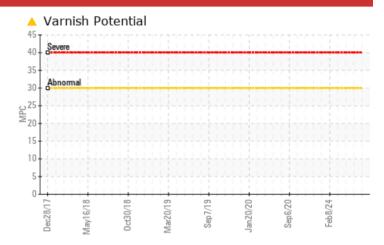

RECOMMENDATION

Check seals and/or filters for points of contaminant entry. The air breather requires service. If unrated, we recommend that you replace with a suitable micron rated and/or desiccant air breather. If rated, we recommend that you service/replace the breather. We recommend you service the filters on this component. Resample in 30-45 days to monitor this situation. No other corrective action is recommended at this time. Please contact your representative for information regarding the proper sampling kits for your service. NOTE: We recommend using MAR 3 test kits, this testkit includes Analytical Ferrography which provides a detailed morphological analysis of wear particles present in the fluid.

PROBLEMATIC TEST RESULTS

Sample Status				SEVERE	SEVERE	SEVERE
Particles >6µm		ASTM D7647	>2500	22034	4 5209	▲ 20907
Particles >14µm		ASTM D7647	>320	708	<u>▲</u> 1575	△ 695
Oil Cleanliness		ISO 4406 (c)	>/18/15	4 24/22/17	2 4/23/18	2 4/22/17
MPC Varnish Potential	Scale	ASTM D7843(m)*	>15	<u> </u>		

Customer Id: TERHAM Sample No.: PC Lab Number: 02634604 Test Package: MAR 2



To manage this report scan the QR code

To discuss the diagnosis or test data: Kevin Marson +1 (289)291-4644 x4644 Kevin.Marson@wearcheck.com

To change component or sample information: Gloria Gonzalez +1 (289)291-4643 x4643 gloria.gonzalez@wearcheck.com

RECOMMENDED ACTIONS							
Action	Status	Date	Done By	Description			
Change Filter	MISSED	May 23 2024	?	We recommend you service the filters on this component.			
Resample	MISSED	May 23 2024	?	Resample in 30-45 days to monitor this situation.			
Contact Required			?	Please contact your representative for information regarding the proper sampling kits for your service.			
Alert	MISSED	May 23 2024	?	NOTE: We recommend using MAR 3 test kits,			
Check Breathers	MISSED	May 23 2024	?	The air breather requires service. If unrated, we recommend that you replace with a suitable micron rated and/or desiccant air breather. If rated, we recommend that you service/replace the breather.			
Check Seals	MISSED	May 23 2024	?	Check seals and/or filters for points of contaminant entry.			

HISTORICAL DIAGNOSIS

02 Apr 2024 Diag: Kevin Marson

X

Check seals and/or filters for points of contaminant entry. The air breather requires service. If unrated, we recommend that you replace with a suitable micron rated and/or desiccant air breather. If rated, we recommend that you service/replace the breather. We recommend you service the filters on this component. Resample in 30-45 days to monitor this situation. Please contact your representative for information regarding the proper sampling kits for your service. NOTE: We recommend using MAR 3 test kits, this testkit includes Analytical Ferrography which provides a detailed morphological analysis of wear particles present in the fluid.Component wear rates appear to be normal (unconfirmed). There is a high amount of silt (particulates < 14 microns in size) present in the oil. The system cleanliness code is much higher than the acceptable limit for the target ISO 4406 cleanliness code. The AN level is acceptable for this fluid. The oil is still serviceable provided that the contaminant(s) can be reduced to acceptable levels.



29 Mar 2024 Diag: Kevin Marson



Check seals and/or filters for points of contaminant entry. The air breather requires service. If unrated, we recommend that you replace with a suitable micron rated and/or desiccant air breather. If rated, we recommend that you service/replace the breather. We recommend you service the filters on this component. Resample in 30-45 days to monitor this situation. Please contact your representative for information regarding the proper sampling kits for your service. NOTE: We recommend using MAR 3 test kits, this testkit includes Analytical Ferrography which provides a detailed morphological analysis of wear particles present in the fluid.Component wear rates appear to be normal (unconfirmed). There is a high amount of silt (particulates < 14 microns in size) present in the oil. The system cleanliness code is much higher than the acceptable limit for the target ISO 4406 cleanliness code. The AN level is acceptable for this fluid. The oil is still serviceable provided that the contaminant(s) can be reduced to acceptable levels.



01 Mar 2024 Diag: Kevin Marson



We recommend you service the filters on this component. We recommend an early resample to monitor this condition. Please contact your representative for information regarding the proper sampling kits for your service. NOTE: We recommend using MAR 3 test kits, this testkit includes Analytical Ferrography which provides a detailed morphological analysis of wear particles present in the fluid.Component wear rates appear to be normal (unconfirmed). There is a moderate amount of silt (particulates < 14 microns in size) present in the oil. The system cleanliness is above the acceptable limit for the target ISO 4406 cleanliness code. The AN level is acceptable for this fluid. The oil is still serviceable provided that the contaminant(s) can be reduced to acceptable levels.






OIL ANALYSIS REPORT

Gas Compression [450312985]

Compressor (MP)- Lubrication System (S/N Sample Tag XX-23002-S1)

Lube System

PETRO CANADA TURBOFLO XL32 (10350 LTR)

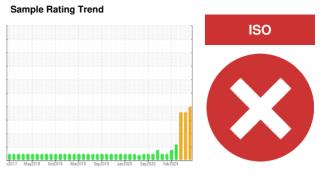

DIAGNOSIS

Recommendation

Check seals and/or filters for points of contaminant entry. The air breather requires service. If unrated, we recommend that you replace with a suitable micron rated and/or desiccant air breather. If rated, we recommend that you service/replace the breather. We recommend you service the filters on this component. Resample in 30-45 days to monitor this situation. No other corrective action is recommended at this time. Please contact your representative for information regarding the proper sampling kits for your service. NOTE: We recommend using MAR 3 test kits, this testkit includes Analytical Ferrography which provides a detailed morphological analysis of wear particles present in the fluid.

Wear

Component wear rates appear to be normal (unconfirmed).

Contamination

There is a high amount of silt (particulates < 14 microns in size) present in the oil. MPC (Membrane Patch Colorimetry) test indicates a light concentration of varnish present. The system cleanliness code is much higher than the acceptable limit for the target ISO 4406 cleanliness code.


Fluid Condition

The AN level is acceptable for this fluid. The oil is still serviceable provided that the contaminant(s) can be reduced to acceptable levels.

SAMPLE INFOR	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		PC	PC0078294	PC0081650
Sample Date		Client Info		19 Apr 2024	02 Apr 2024	29 Mar 2024
Machine Age	hrs	Client Info		0	0	0
Oil Age	hrs	Client Info		0	0	0
Oil Changed	0	Client Info		N/A	N/A	N/A
Sample Status				SEVERE	SEVERE	SEVERE
CONTAMINAT	ION	method	limit/base	current	history1	history2
Water		WC Method	>0.05	NEG	NEG	NEG
WEAR METAL	.S	method	limit/base	current	history1	history2
PQ		ASTM D8184*		0	0	0
Iron	ppm	ASTM D5185(m)	>20	<1	1	<1
Chromium	ppm	ASTM D5185(m)	>10	0	0	0
Nickel	ppm	ASTM D5185(m)	>10	0	<1	0
Titanium	ppm	ASTM D5185(m)		0	0	0
Silver	ppm	ASTM D5185(m)		0	0	0
Aluminum	ppm	ASTM D5185(m)	>10	0	0	0
Lead	ppm	ASTM D5185(m)	>20	0	0	0
Copper	ppm	ASTM D5185(m)	>20	<1	<1	<1
Tin	ppm	ASTM D5185(m)	>10	0	0	0
Antimony	ppm	ASTM D5185(m)		0	0	0
Vanadium	ppm	ASTM D5185(m)		0	0	0
Beryllium	ppm	ASTM D5185(m)		0	0	0
Cadmium	ppm	ASTM D5185(m)		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)	0	0	0	<1
Barium	ppm	ASTM D5185(m)	0	0	0	0
Molybdenum	ppm	ASTM D5185(m)	0	0	0	0
Manganese	ppm	ASTM D5185(m)	0	0	0	0
Magnesium	ppm	ASTM D5185(m)	0	<1	<1	<1
Calcium	ppm	ASTM D5185(m)	0	<1	0	0
Phosphorus	ppm	ASTM D5185(m)	5	65	68	67
Zinc	ppm	ASTM D5185(m)	0	2	1	1
Sulfur	ppm	ASTM D5185(m)	750	484	473	493
Lithium	ppm	ASTM D5185(m)		<1	<1	<1
CONTAMINAN	ITS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>15	1	<1	<1
Sodium	ppm	ASTM D5185(m)		0	0	<1



OIL ANALYSIS REPORT

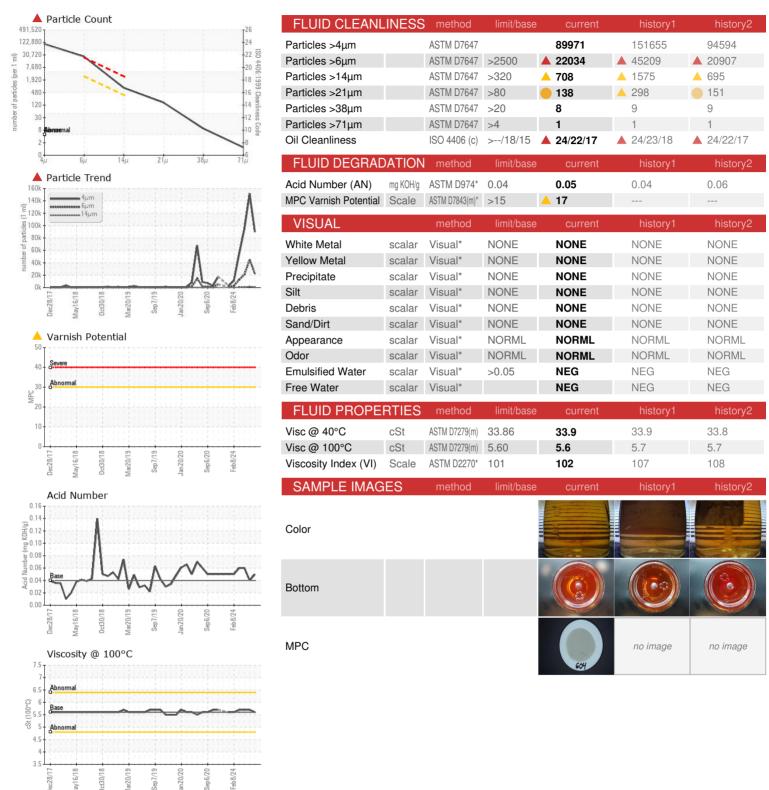



CALA ISO 17025:2017 Accredited

Laboratory

Laboratory Sample No.

Lab Number

: PC

: 02634604 Unique Number : 5775757

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 Received : 10 May 2024 **Tested** : 24 May 2024

Diagnosed : 24 May 2024 - Kevin Marson Test Package: MAR 2 (Additional Tests: KV100, MPC, PQ, TAN Man, VI)


To discuss this sample report, contact Customer Service at 1-800-268-2131. Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.


Suncor - Terra Nova Projects Scotia Centre, 235 Water Strret St. John's, NL

CA A1C 1B6 Contact: Josh Hynes joshynes@suncor.com T: (709)778-3575

F: (709)724-2835

Page 4 of 6

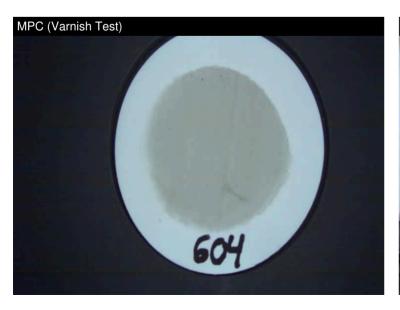

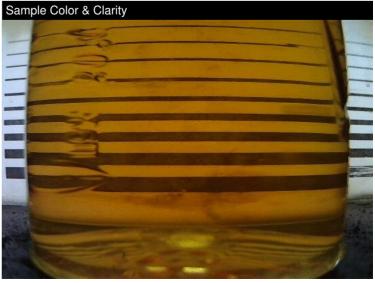

Report Id: TERHAM [WCAMIS] 02634604 (Generated: 05/31/2024 07:08:11) Rev: 2

This page left intentionally blank