

## **CONSTRUCTION EQUIPMENT**

593983 RYAN GOLF VOLVO A45G 342685 - DROP BOX



Sample No: VCP417651

Oil Type: VOLVO PREMIUM GEAR OIL 85W-140 GL-5

**Job No:** 593983 RYAN GOLF

INFORMATION				
-	VCP417651			
	11 Aug 2023			
	4733			
	4733			
	Changed			
	SEVERE			
DITION				
	<b>□</b> 275			
CSt				
INATION				
ppm	<b>△</b> 55			
ppm	<b>2</b>			
ppm	<b>■</b> 0			
ETALS				
ppm	<b>4579</b>			
ppm	<b>15</b>			
ppm	<b>■</b> 0			
ppm	<b></b>			
ppm	<u> </u>			
ppm	<b>5</b> 5			
ppm	<b>■32</b>			
ppm	<b>9</b>			
ppm	<1			
ppm	0			
ppm	<b>50</b>			
ppm	<1			
ES				
ppm	<b>155</b>			
ppm	<b>40</b>			
ppm	<b>115</b>			
	=060			
ppm	<b>962</b>			
ppm	<b>■</b> 962			
	ppm	VCP417651  11 Aug 2023  4733  4733  Changed  SEVERE  DITION  cSt	VCP417651  11 Aug 2023  4733  Changed  SEVERE  DITION  CSt	VCP417651



ALTA EQUIPMENT/FLAGLER CONSTRUCTION EQUIPMENT LLC
8418 PALM RIVER ROAD
TAMPA, FL
US 33619
Contact: JOHN FARDELLA
JFARDELLA@ALTAEQUIPFL.COM
T: (813)630-0077
F: (813)630-2233

## Diagnosis

We advise that you check all areas where dirt can enter the system. Oil and filter change at the time of sampling has been noted. We advise that you inspect for the source(s) of wear. We recommend an early resample to monitor this condition. The iron level is severe. Gear wear is indicated. Elemental levels of silicon (Si) and aluminum (Al) indicate alumina-silicate (coarse dirt) ingress. The oil is no longer serviceable as a result of the abnormal and/or severe wear.

Depot:VOLVO0093Unique No:10620308Signed:Sean FeltonReport Date:28 Aug 2023



## **CONSTRUCTION EQUIPMENT**





