

CONSTRUCTION EQUIPMENT
SWA390453 RENTAL KAWASAKI 115ZV-2 11C5-5220 - REAR

Sample No: VCP440594 Oil Type: SAE 50W

Job No: SWA390453 RENTAL

VOLVO	INFORMATIO	η		
	INFURMATIU	<u> </u>		
Sample Number		VCP440594	 	
Sample Date		18 Oct 2023	 	
Machine Hours		8138	 	
Oil Hours		0	 	
Oil Changed		Not Changd	 	
Sample Status		SEVERE	 	
OIL CON	NITION			
		- 472	 <u> </u>	
Visc @ 40°C	cSt	173	 	
VOLVO				
CONTAM	IINATION			
Silicon	ppm	<u> </u>	 	
Sodium	ppm	■0	 	
Potassium	ppm	4	 	
Otassiani	PPIII			
VOLVO				
WEAR M	ETALS			
Iron	ppm	● 3892	 	
Copper	ppm	■23	 	
Lead	ppm	■3	 	
Tin	ppm	■ 0	 	
Aluminum	ppm	7	 	
Chromium	ppm	<u> </u>	 	
Molybdenum	ppm	■ 3	 	
Nickel	ppm	■1	 	
Titanium	ppm	■<1	 	
Silver	ppm	0	 	
Manganese	ppm	47	 	
Vanadium	ppm	0	 	
ADDITIV	77			
	_			
Calcium	ppm	■ 5467	 	
Magnesium	ppm	25	 	
Zinc	ppm	2628	 	
Phosphorus	ppm	2037	 	
Barium	ppm	0	 	
Boron	ppm	128	 	



ALTA EQUIPMENT CO - ORLAND PARK 5000 INDUSTRIAL HWY GARY, IN US 46406 Contact: DAVE ENG DAVE.ENG@ALTG.COM T: (312)350-2560 F:

Diagnosis

We recommend that you drain the oil from the component if this has not already been done. We advise that you inspect for the source(s) of wear. We recommend an early resample to monitor this condition. Gear wear is indicated. Elemental level of silicon (Si) above normal indicating ingress of seal material. The oil is no longer serviceable as a result of the abnormal and/or severe wear.

Depot: **VOLVO8885 Unique No:** 10709614 Signed: Sean Felton Report Date: 25 Oct 2023



CONSTRUCTION EQUIPMENT





