


PROBLEM SUMMARY

AIRBUS C-GOIH GREEN (S/N 9198)

Hydraulic System Fluid SKYDROL LD-4 (--- GAL)

COMPONENT CONDITION SUMMARY

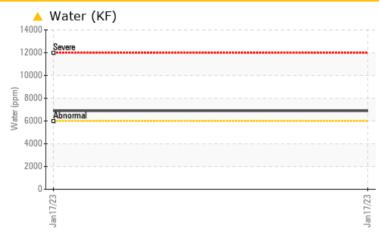

RECOMMENDATION

We advise that you check for the source of water entry. Check seals and/or filters for points of contaminant entry. The air breather requires service. If unrated, we recommend that you replace with a suitable micron rated and/or desiccant air breather. If rated, we recommend that you service/replace the breather. We advise that you use off-line filtration with water adsorbent filters to attempt to remove the water from this oil. We recommend an early resample to monitor this condition. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample.

PROBLEMATIC TEST RESULTS

Sample Status				ABNORMAL	
Water	%	ASTM D6304*	>0.6	A 0.688	
ppm Water	ppm	ASTM D6304*	>6000	6889.3	

Customer Id: KELMOU Sample No.: PP Lab Number: 02534170 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data: Bill Quesnel CLS,OMA II,MLA-III,LLA-I +1 (289)291-4641 x4641 Bill.Quesnel@wearcheck.com

To change component or sample information: Gloria Gonzalez +1 (289)291-4643 x4643 gloria.gonzalez@wearcheck.com



RECOMMENDED ACTIONS						
Action	Status	Date	Done By	Description		
Resample			?	We recommend an early resample to monitor this condition.		
Information Required			?	NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample.		
Check Breathers			?	The air breather requires service. If unrated, we recommend that you replace with a suitable micron rated and/or desiccant air breather. If rated, we recommend that you service/replace the breather.		
Check Water Access			?	We advise that you check for the source of water entry.		
Check Seals			?	Check seals and/or filters for points of contaminant entry.		
Filter Fluid			?	We advise that you use off-line filtration with water adsorbent filters to attempt to remove the water from this oil.		

HISTORICAL DIAGNOSIS



OIL ANALYSIS REPORT

Sample Rating Trend

WATER

AIRBUS C-GOIH GREEN (S/N 9198)

Component Hydraulic System Fluid SKYDROL LD-4 (--- GAL)

DIAGNOSIS

Recommendation

We advise that you check for the source of water entry. Check seals and/or filters for points of contaminant entry. The air breather requires service. If unrated, we recommend that you replace with a suitable micron rated and/or desiccant air breather. If rated, we recommend that you service/replace the breather. We advise that you use off-line filtration with water adsorbent filters to attempt to remove the water from this oil. We recommend an early resample to monitor this condition. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample.

Wear


All component wear rates are normal.

Contamination

There is a moderate concentration of water present in the oil. The system cleanliness is acceptable for your target SAE AS4059 (replaces NAS 1638) cleanliness code.

Fluid Condition

The AN level is acceptable for this fluid. The oil is still serviceable provided that the contaminant(s) can be reduced to acceptable levels.

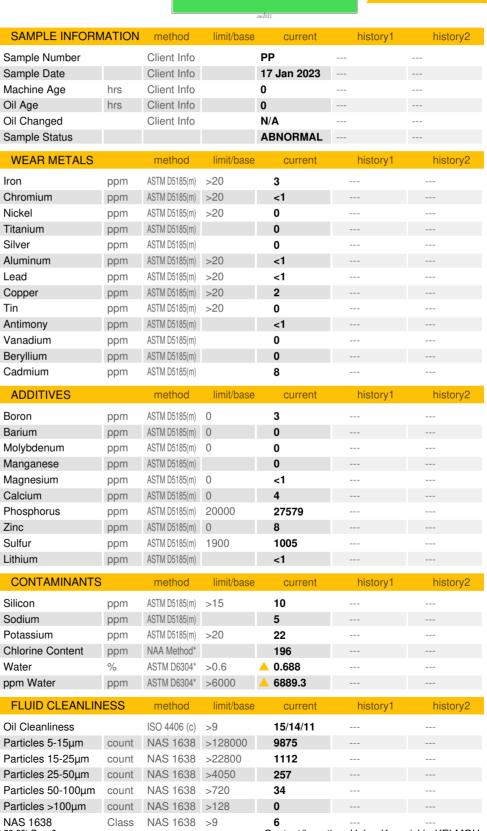




lin

(per 100 r

of narticles

OIL ANALYSIS REPORT

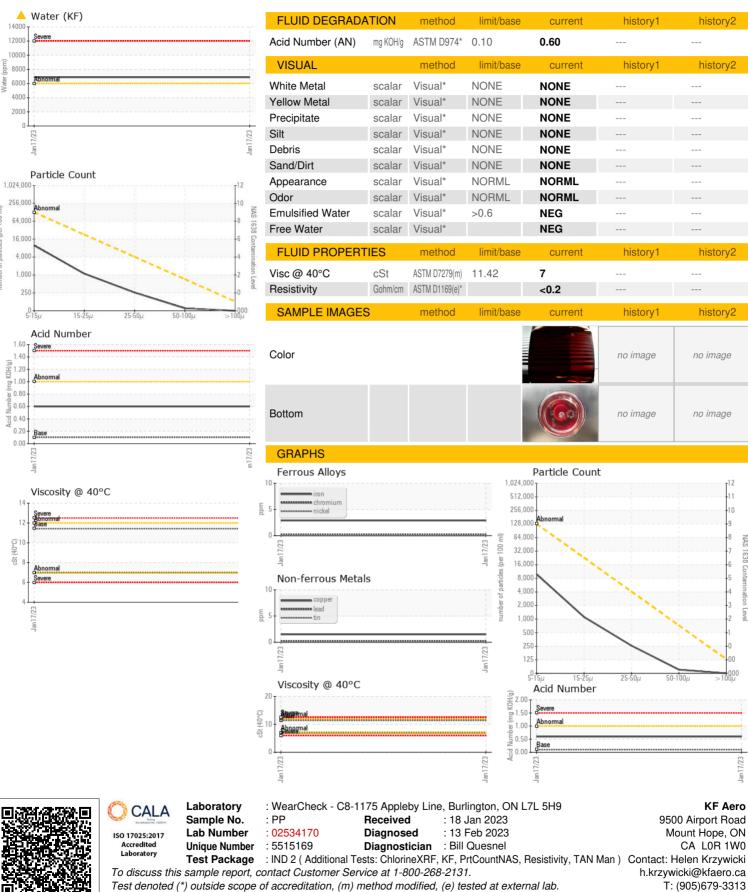

Validity of results and interpretation are based on the sample and information as supplied.

Contact/Location: Helen Krzywicki - KELMOU

history2

history2

history2

history2

no image

no image

NAS

1638

Jan1

KF Aero

CA LOR 1W0

F: (905)679-4921