

PROBLEM SUMMARY

6 Calender Line
Machine Id
39-0036 North Cooling Mixer


Component **Gearbox**

MOBIL GLYGOYLE 30 (70 LTR)

Sample Rating Trend



COMPONENT CONDITION SUMMARY

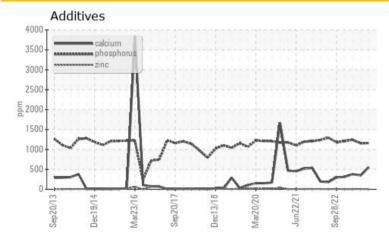

RECOMMENDATION

We recommend that you drain the oil from the component if this has not already been done. Confirm the source of the lubricant being utilized for top-up/fill. We recommend an early resample to monitor this condition.

PROBLEMATIC TEST RESULTS									
Sample Status				ABNORMAL	ABNORMAL	ABNORMAL			
Titanium	ppm	ASTM D5185(m)		<u> </u>	1	2			
Antimony	ppm	ASTM D5185(m)	>5	8	2	2			

Customer Id: CAN52CAM Sample No.: WC0808300 Lab Number: 02587824 Test Package: IND 1



To manage this report scan the QR code

To discuss the diagnosis or test data: Kevin Marson +1 (289)291-4644 x4644 Kevin.Marson@wearcheck.com

To change component or sample information: Gloria Gonzalez +1 (289)291-4643 x4643 gloria.gonzalez@wearcheck.com

RECOMMENDED ACTIONS

Action	Status	Date	Done By	Description
Change Fluid			?	We recommend that you drain the oil from the component if this has not already been done.
Resample			?	We recommend an early resample to monitor this condition.
Check Fluid Source			?	Confirm the source of the lubricant being utilized for top-up/fill.

HISTORICAL DIAGNOSIS

06 Jul 2023 Diag: Kevin Marson

WEAR



We recommend that you drain the oil from the component if this has not already been done. We recommend an early resample to monitor this condition. Chromium and tin ppm levels are abnormal. Bearing and/or bushing wear is indicated. There is no indication of any contamination in the oil. The oil is no longer serviceable as a result of the abnormal and/or severe wear.



31 Mar 2023 Diag: Kevin Marson

WEAR



We recommend that you drain the oil from the component if this has not already been done. We recommend an early resample to monitor this condition. Chromium ppm levels are abnormal. There is no indication of any contamination in the oil. The oil is no longer serviceable as a result of the abnormal and/or severe wear.

View report

24 Jan 2023 Diag: Wes Davis

NORMAL



Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the oil. The condition of the oil is acceptable for the time in service.






OIL ANALYSIS REPORT

6 Calender Line 39-0036 North Cooling Mixer

Gearbox

MOBIL GLYGOYLE 30 (70 LTR)

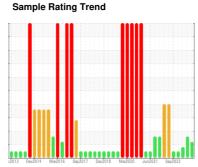



DIAGNOSIS

Recommendation

We recommend that you drain the oil from the component if this has not already been done. Confirm the source of the lubricant being utilized for top-up/fill. We recommend an early resample to monitor this condition.

Wear

Titanium and antimony ppm levels are abnormal.

Contamination

There is no indication of any contamination in the

Fluid Condition

Additive levels indicate the addition of a different brand, or type of oil. The oil is no longer serviceable as a result of the abnormal and/or severe wear.

		52013 Dec20	14 Mar2016 Sep2017	Dec2018 Mar2020 Jun2021	Sep 2022	
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0808300	WC0782354	WC0744121
Sample Date		Client Info		04 Oct 2023	06 Jul 2023	31 Mar 2023
Machine Age	hrs	Client Info		0	0	0
Oil Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		N/A	N/A	N/A
Sample Status				ABNORMAL	ABNORMAL	ABNORMAL
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>200	82	30	36
Chromium	ppm	ASTM D5185(m)	>15	1	<u></u> ▲ 18	<u> </u>
Nickel	ppm	ASTM D5185(m)	>15	0	<1	<1
Titanium	ppm	ASTM D5185(m)		<u>^</u> 5	1	2
Silver	ppm	ASTM D5185(m)		<1	0	0
Aluminum	ppm	ASTM D5185(m)	>25	2	<1	<1
Lead	ppm	ASTM D5185(m)	>100	<1	7	6
Copper	ppm	ASTM D5185(m)	>200	10	184	174
Tin	ppm	ASTM D5185(m)	>25	<1	<u>^</u> 27	24
Antimony	ppm	ASTM D5185(m)	>5	<u>^</u> 8	2	2
Vanadium	ppm	ASTM D5185(m)		0	0	0
Beryllium	ppm	ASTM D5185(m)		0	0	0
Cadmium	ppm	ASTM D5185(m)		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)		28	24	25
Barium	ppm	ASTM D5185(m)		<1	2	1
Molybdenum	ppm	ASTM D5185(m)		0	<1	0
Manganese	ppm	ASTM D5185(m)		<1	<1	<1
Magnesium	ppm	ASTM D5185(m)		<1	1	1
Calcium	ppm	ASTM D5185(m)		553	347	380
Phosphorus	ppm	ASTM D5185(m)		1161	1153	1243
Zinc	ppm	ASTM D5185(m)		2	7	5
Sulfur	ppm	ASTM D5185(m)		245	115	162
Lithium	ppm	ASTM D5185(m)		<1	<1	<1
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>50	8	14	15
Sodium	ppm	ASTM D5185(m)		2	3	3
Potassium	ppm	ASTM D5185(m)	>20	<1	4	4
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	NONE	NONE	VLITE
Yellow Metal	scalar	Visual*	NONE	NONE	NONE	NONE
Precipitate	scalar	Visual*	NONE	NONE	NONE	NONE
Silt	scalar	Visual*	NONE	NONE	NONE	NONE
Debris	scalar	Visual*	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	Visual*	NONE	NONE	NONE	NONE
Appearance	scalar	Visual*	NORML	NORML	NORML	NORML
Odor	scalar	Visual*	NORML	NORML	NORML	NORML
Emulsified Water	scalar	Visual*	>0.2	NEG	NEG	NEG

NEG


scalar Visual*

NEG


Contact/Location: Bob Abell - CAN52CAM




OIL ANALYSIS REPORT

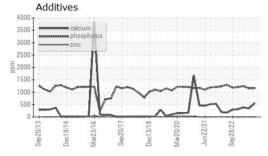





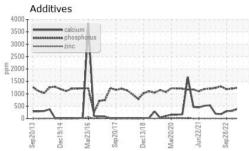

GRAPHS

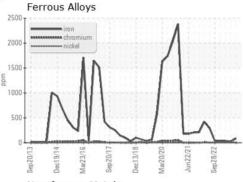

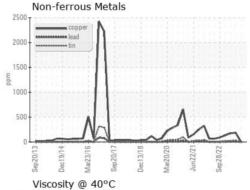

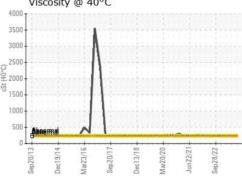



CALA ISO 17025:2017 Accredited Laboratory

Laboratory Sample No. Lab Number Unique Number : 5656890

: WC0808300 : 02587824

Received Diagnosed

: 06 Oct 2023 : 10 Oct 2023

Diagnostician : Kevin Marson

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 CANADIAN GENERAL TOWER LTD. 52 MIDDLETON STREET, P.O. BOX 160

CAMBRIDGE, ON CA N1S 2R4 Contact: Bob Abell

Test Package : IND 1 To discuss this sample report, contact Customer Service at 1-800-268-2131. Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

T: (519)623-1630 F: (519)623-7018

bob.abell@cgtower.com