

PROBLEM SUMMARY

Sample Rating Trend




Machine Id 10574168

Component **Hydraulic System**

Fluid

SHELL TELLUS 68 (--- GAL)

COMPONENT CONDITION SUMMARY

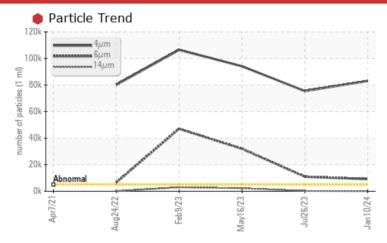

RECOMMENDATION

Check seals and/or filters for points of contaminant entry. The air breather requires service. If unrated, we recommend that you replace with a suitable micron rated and/or desiccant air breather. If rated, we recommend that you service/replace the breather. We recommend you service the filters on this component. Resample in 30-45 days to monitor this situation. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample.

PROBLEMATIC TEST RESULTS									
Sample Status			SEVERE	SEVERE	SEVERE				
Particles >4µm	ASTM D7647	>5000	83068	1 75446	94165				
Particles >6µm	ASTM D7647	>1300	9178	10947	32006				
Oil Cleanliness	ISO 4406 (c)	>19/17/14	2 4/20/14	23/21/15	2 4/22/18				

Customer Id: INCOCOLE Sample No.: WC0811799 Lab Number: 02609972 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data: Wes Davis +1 905-569-8600 x223 wesd@wearcheck.ca

To change component or sample information: Gloria Gonzalez +1 (289)291-4643 x4643 gloria.gonzalez@wearcheck.com

RECOMMENDED ACTIONS Action **Status** Date Done By Description Change Filter ? We recommend you service the filters on this component. Resample ? Resample in 30-45 days to monitor this situation. NOTE: Please provide information regarding reservoir capacity, filter type ? Information Required and micron rating with next sample. The air breather requires service. If unrated, we recommend that you replace with a **Check Breathers** ? suitable micron rated and/or desiccant air breather. If rated, we recommend that you service/replace the breather Check Seals Check seals and/or filters for points of contaminant entry.

HISTORICAL DIAGNOSIS

26 Jul 2023 Diag: Wes Davis

ISO



Check seals and/or filters for points of contaminant entry. The air breather requires service. If unrated, we recommend that you replace with a suitable micron rated and/or desiccant air breather. If rated, we recommend that you service/replace the breather. We recommend you service the filters on this component. Resample in 30-45 days to monitor this situation. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample. All component wear rates are normal. There is a high amount of silt (particulates < 14 microns in size) present in the oil. The water content is negligible. The AN level is acceptable for this fluid. The oil is still serviceable provided that the contaminant(s) can be reduced to acceptable levels.



ISO



16 May 2023 Diag: Kevin Marson

We advise that you check all areas where contaminants can enter the system. We advise that you check for visible metal particles in the oil. We advise that you perform a filter service, and use off-line filtration to improve the cleanliness of the system fluid. The air breather requires service. If unrated, we recommend that you replace with a suitable micron rated and/or desiccant air breather. If rated, we recommend that you service/replace the breather. Resample in 30-45 days to monitor this situation. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample. We suspect that the abnormal contaminant(s) is the result of incorrect sampling technique. DISCLAIMER: Interpretation of results is based on the sample as received from the customer. The condition of the sample and the method of sampling cannot be verified Light concentration of visible metal present. There is a high amount of particulates (2 to 100 microns in size) present in the oil. Light concentration of visible dirt/debris present in the oil. Viscosity of sample indicates oil is within ISO 46 range, advise investigate. The AN level is acceptable for this fluid. The oil is no longer serviceable as a result of the abnormal and/or severe wear.



ICO



09 Feb 2023 Diag: Kevin Marson


We advise that you check all areas where contaminants can enter the system. We advise that you perform a filter service, and use off-line filtration to improve the cleanliness of the system fluid. The air breather requires service. If unrated, we recommend that you replace with a suitable micron rated and/or desiccant air breather. If rated, we recommend that you service/replace the breather. Confirm the source of the lubricant being utilized for top-up/fill. Resample in 30-45 days to monitor this situation. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample.All component wear rates are normal. Particles >14µm are severely high. Particles >21µm are severely high. Particles >6µm are severely high. Oil Cleanliness are severely high. Particles >4µm are severely high. Additive levels indicate the addition of a different brand, or type of oil. The AN level is acceptable for this fluid. The oil is still serviceable provided that the contaminant(s) can be reduced to acceptable levels.





OIL ANALYSIS REPORT

Sample Rating Trend

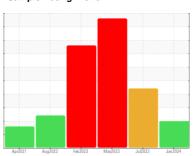



10574168

Component

Hydraulic System

SHELL TELLUS 68 (--- GAL)

DIAGNOSIS

Recommendation

Check seals and/or filters for points of contaminant entry. The air breather requires service. If unrated, we recommend that you replace with a suitable micron rated and/or desiccant air breather. If rated, we recommend that you service/replace the breather. We recommend you service the filters on this component. Resample in 30-45 days to monitor this situation. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample.

Wear

All component wear rates are normal.

Contamination

There is a high amount of silt (particulates < 14 microns in size) present in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The oil is still serviceable provided that the contaminant(s) can be reduced to acceptable levels.

SAMPLE INFORM	MATION	method	Aug ² 022 Feb2023	May ² 023 Jul ² 023 Current	Jan ² 024 history 1	history2
	MATION		IIIIIIVDase		•	
Sample Number		Client Info		WC0811799	WC0754995	WC0698316
Sample Date	tle -	Client Info		10 Jan 2024	26 Jul 2023	16 May 2023
Machine Age	mths	Client Info		0	0	0
Oil Changed	mths	Client Info		-	Not Changd	N/A
Oil Changed Sample Status		Client inio		Not Changd SEVERE	SEVERE	SEVERE
	\1	method	limit/base			
CONTAMINATION Water	N	WC Method		current	history1 NEG	history2 NEG
				NEG		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>20	13	19	19
Chromium	ppm	ASTM D5185(m)		4	4	<1
Nickel	ppm	ASTM D5185(m)	>20	<1	<1	3
Titanium	ppm	ASTM D5185(m)		0	0	<1
Silver	ppm	ASTM D5185(m)		0	<1	<1
Aluminum	ppm	ASTM D5185(m)		<1	1	2
Lead	ppm	ASTM D5185(m)	>20	<1	0	0
Copper	ppm	ASTM D5185(m)		3	2	3
Tin	ppm	ASTM D5185(m)	>20	0	0	0
Antimony	ppm	ASTM D5185(m)		0	0	0
Vanadium	ppm	ASTM D5185(m)		0	0	0
Beryllium	ppm	ASTM D5185(m)		0	0	0
Cadmium	ppm	ASTM D5185(m)		0	0	1
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)		<1	<1	0
Barium	ppm	ASTM D5185(m)		0	0	0
Molybdenum	ppm	ASTM D5185(m)		0	0	0
Manganese	ppm	ASTM D5185(m)		0	<1	<1
Magnesium	ppm	ASTM D5185(m)	11	62	52	11
Calcium	ppm	ASTM D5185(m)	39	13	17	42
Phosphorus	ppm	ASTM D5185(m)	260	290	299	271
Zinc	ppm	ASTM D5185(m)	279	340	337	293
Sulfur	ppm	ASTM D5185(m)	2109	707	724	2700
Lithium	ppm	ASTM D5185(m)		<1	<1	<1
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>15	<1	1	6
Sodium	ppm	ASTM D5185(m)		0	<1	<1
Potassium	ppm	ASTM D5185(m)	>20	<1	<1	<1
FLUID CLEANLIN	IESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647	>5000	83068	75446	94165
Particles >6µm		ASTM D7647	>1300	<u> </u>	• 10947	32006
Particles >14µm		ASTM D7647	>160	104	270	2300
Particles >21µm		ASTM D7647	>40	21	△ 59	5 44
Particles >38µm		ASTM D7647	>10	1	1	9
Particles >71μm		ASTM D7647	>3	0	0	1
				<u> </u>		<u> </u>


ISO 4406 (c) >19/17/14 **24/20/14**

Oil Cleanliness

23/21/15



OIL ANALYSIS REPORT

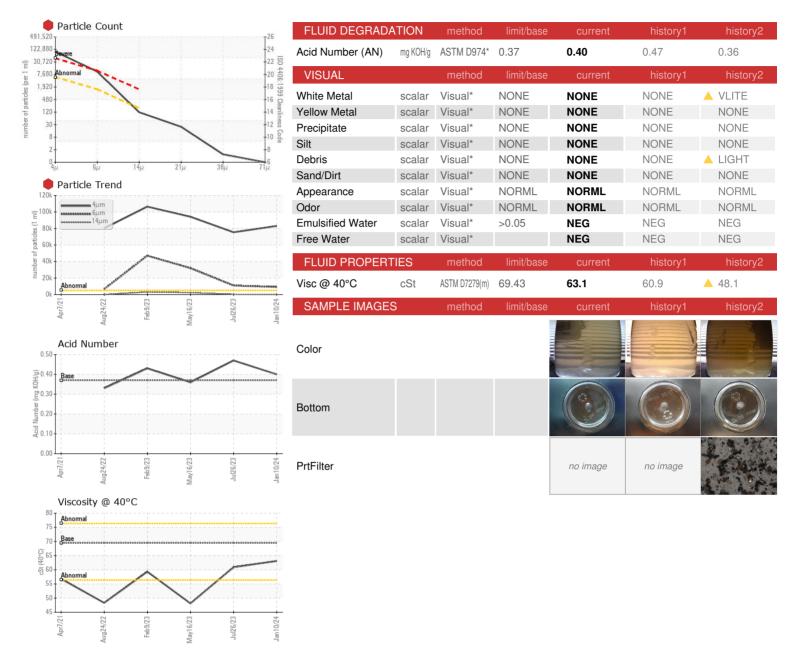



CALA ISO 17025:2017 Accredited Laboratory

Laboratory Sample No. Lab Number Unique Number

Test Package : IND 2

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 : WC0811799 : 02609972 : 5711058

: 19 Jan 2024 Recieved Diagnosed : 22 Jan 2024 : Wes Davis Diagnostician

Vale - Coleman Mine COLEMAN MINE (PLANT 10), 117 Mine Road LEVACK, ON

CA P0M 2C0 Contact: Ryan Davies ryan.davies@vale.com T: (705)682-8952

F: (705)966-4114

Page 4 of 4

To discuss this sample report, contact Customer Service at 1-800-268-2131. Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.