



Recommendation: If venting was carried out, the flash point has not been restored. Site was visited 14th June and oil change recommended including a clean and flush of the system. Continue to vent the expansion tank until an oil change is carried out. Resample to monitor in 3 months time.

Comments: COC Flash Point is severely low. (GCD) 90% Distillation Point is marginally high.

Sample Date	Received Date	Fluid Age	Sample Location	Flash Point (COC)	Water (KF)	Viscosity (40°C)	Acid Number	Solids	GCD 10%	GCD 50%	GCD 90%	GCD % < 335°C
	mm/dd/yy			°F/°C	ppm	cSt	mg/KOH/ g	%wt	°F/°C	°F/°C	°F/°C	%
08/04/22	08/22/22	24.0m	FIRER NO8 SUPPLY RTN	342 / 172	12.7	30.4	0.65	0.042	703 / 373	813 / 434	917 / 491	3.58
06/06/22	06/28/22	22.0m	Firer No. 8	327 / 164	16.8	31.3	0.31	0.049	693 / 367	813 / 434	914 / 490	5.45
03/22/22	04/05/22	19.0m	Firer No. 8	374 / 190	272.0	28.6	0.40	0.058	693 / 367	813 / 434	912 / 489	5.51
08/01/21	10/06/21	12.0m	FIRER No 8	414 / 212	48.3	30.4	0.64	0.096	712 / 378	816 / 436	911 / 489	3.71

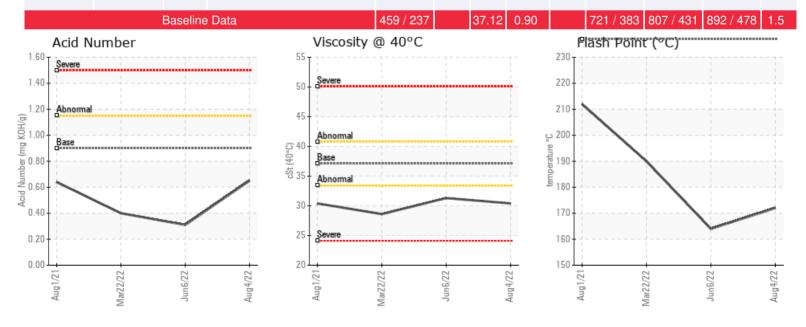

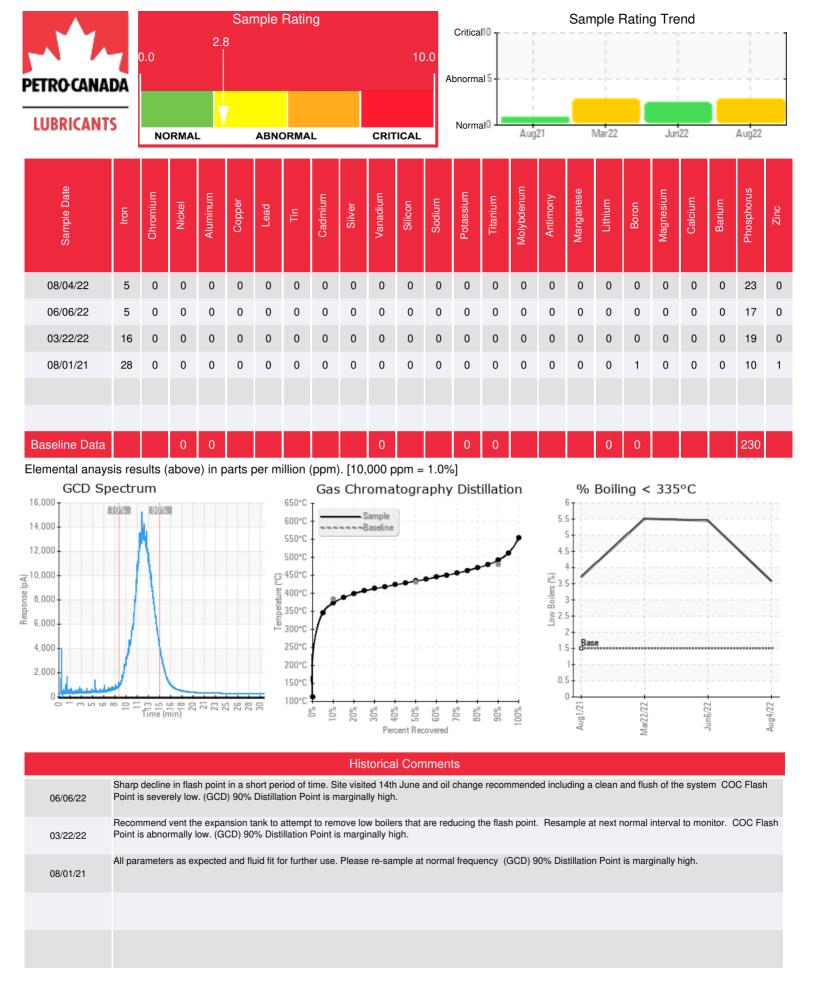

Petro-Canada makes no representation or warranty of any kind, either express or implied, as to the accuracy or completeness of the analysis and assumes no responsibility and shall have no liability whatsoever with respect to such analysis, or a party's use of it. Petro-Canada is a division of HollyFrontier Corporation.