

## LIEBHERR LH22M 137772-1525 - Splitter Box

42.3

Sample No: LH0232638

**Oil Type:** {unknown}

## Information sur l'échantillon

Numéro d'échant.	LH0232638	 	
Date d'échant.	28 May 2024	 	
Heures de la Machine	2312	 	
Heures de l'huile	0	 	
Huile changée	Changed	 	
Statut de l'echant	SEVERE	 	

État d'huile

Visc 40°C

# cSt

Conte	amination	I		
Eau	%	NEG	 	
Silicium	ppm	<b>2</b>	 	
Sodium	ppm	38	 	
Potassium	ppm	0 5	 	

### $\odot$ Métaux d'usure Fer ppm 0 53 Cuivre 82 ppm Plomb 02 ppm Étain ppm 02 Aluminium ppm 05 Chrome ppm ○ <1 Molybdène 0 ppm Nickel ppm ○ <1 Titane ppm 0 Argent 0 ppm Manganèse 24 ppm Vanadium ppm n

0 **Additifs** 3294 Calcium ppm 7 Magnésium ppm Zinc 1113 ppm 1059 Phosphore ppm Baryum 2 ppm Bore ppm 6





**Excavation Dolbeau Inc.** 493 - 2ieme Avenue Dolbeau-Mistassini, QC CA G8L 1V3

Contact: Service Manager т: F:

### Diagnostic

The oil change at the time of sampling has been noted. We recommend an early resample to monitor this condition. Please specify the brand, type, and viscosity of the oil on your next sample.Copper ppm levels are severe. Bearing and/or bushing wear is indicated. There is no indication of any contamination in the oil. The oil is no longer serviceable as a result of the abnormal and/or severe wear.

Depot: Unique No: Signed: **Report Date:** 


EXCDOL 5788619 Kevin Marson 03 Jun 2024 Submitted By: ?





٢

Graphs

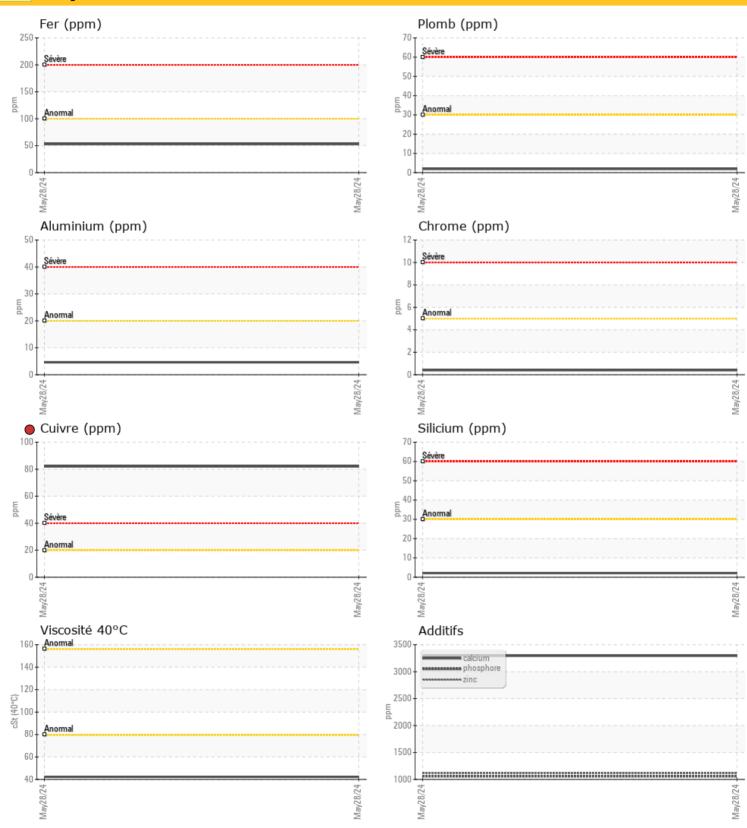

ID du rapport: EXCDOL [WCAMIS] 02639457 (Generated: 06/06/2024 07:15:11) Rev: 1