

Machine Id
9263
Component
Hydraulic System
Fluid
PETRO CANADA HYDREX MV 32 (--- GAL)

RECOMMENDATION

Vérifier les scelles et/ou les filtres pour des points d'entrée des contaminants. Le reniflard d'air doit être réparé. S'il n'est pas classé, nous vous recommandons de le remplacer par un reniflard à air adapté au micron et / ou au dessicant. Si évalué, nous vous recommandons de réparer / remplacer le reniflard. Nous avons pris note que le filtre a été remplacé au moment de l'échantillonnage. Échantillonner de nouveau dans 30 à 45 jours afin de contrôler la situation.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		GFL0089050	GFL0023029	---
Sample Date		Client Info		14 Sep 2023	29 Apr 2022	---
Machine Age	hrs	Client Info		19209	17299	---
Oil Age	hrs	Client Info		0	0	---
Filter Age	hrs	Client Info		0	0	---
Oil Changed		Client Info		Not Changd	Not Changd	---
Filter Changed		Client Info		Changed	N/A	---
Sample Status				SEVERE	SEVERE	---

WEAR

Les taux d'usure de tous les composants sont normaux.

Iron	ppm	ASTM D5185(m)	>20	7	17	---
Chromium	ppm	ASTM D5185(m)	>10	2	2	---
Nickel	ppm	ASTM D5185(m)	>10	<1	<1	---
Titanium	ppm	ASTM D5185(m)		0	0	---
Silver	ppm	ASTM D5185(m)		<1	0	---
Aluminum	ppm	ASTM D5185(m)	>10	<1	2	---
Lead	ppm	ASTM D5185(m)	>10	<1	<1	---
Copper	ppm	ASTM D5185(m)	>75	<1	<1	---
Tin	ppm	ASTM D5185(m)	>10	0	<1	---
Vanadium	ppm	ASTM D5185(m)		0	0	---
White Metal	scalar	Visual*	NONE	NONE	▲ VLITE	---
Yellow Metal	scalar	Visual*	NONE	NONE	NONE	---

CONTAMINATION








Il y a une grande quantité de limon (particules de 4 à 14 microns) dans l'huile.

Silicon	ppm	ASTM D5185(m)	>20	2	4	---
Potassium	ppm	ASTM D5185(m)	>20	<1	2	---
Water		WC Method	>0.1	NEG	NEG	---
Particles >4µm		ASTM D7647	>5000	158995	145728	---
Particles >6µm		ASTM D7647	>1300	9343	41120	---
Particles >14µm		ASTM D7647	>160	65	946	---
Particles >21µm		ASTM D7647	>40	21	167	---
Particles >38µm		ASTM D7647	>10	2	5	---
Particles >71µm		ASTM D7647	>3	0	1	---
Oil Cleanliness		ISO 4406 (c)	>19/17/14	24/20/13	24/23/17	---
Silt	scalar	Visual*	NONE	NONE	NONE	---
Debris	scalar	Visual*	NONE	NONE	▲ VLITE	---
Sand/Dirt	scalar	Visual*	NONE	NONE	NONE	---
Appearance	scalar	Visual*	NORML	NORML	NORML	---
Odor	scalar	Visual*	NORML	NORML	NORML	---
Emulsified Water	scalar	Visual*	>0.1	NEG	NEG	---

FLUID CONDITION

L'huile peut encore servir si la contamination peut être réduite à un niveau acceptable.

Sodium	ppm	ASTM D5185(m)		3	23	---
Boron	ppm	ASTM D5185(m)	0	<1	<1	---
Barium	ppm	ASTM D5185(m)	0	<1	0	---
Molybdenum	ppm	ASTM D5185(m)	0	0	<1	---
Manganese	ppm	ASTM D5185(m)	1	0	<1	---
Magnesium	ppm	ASTM D5185(m)	0	<1	2	---
Calcium	ppm	ASTM D5185(m)	50	44	36	---
Phosphorus	ppm	ASTM D5185(m)	330	332	368	---
Zinc	ppm	ASTM D5185(m)	430	422	458	---
Sulfur	ppm	ASTM D5185(m)	760	764	814	---
Visc @ 40°C	cSt	ASTM D7279(m)	31.9	31.2	31.5	---

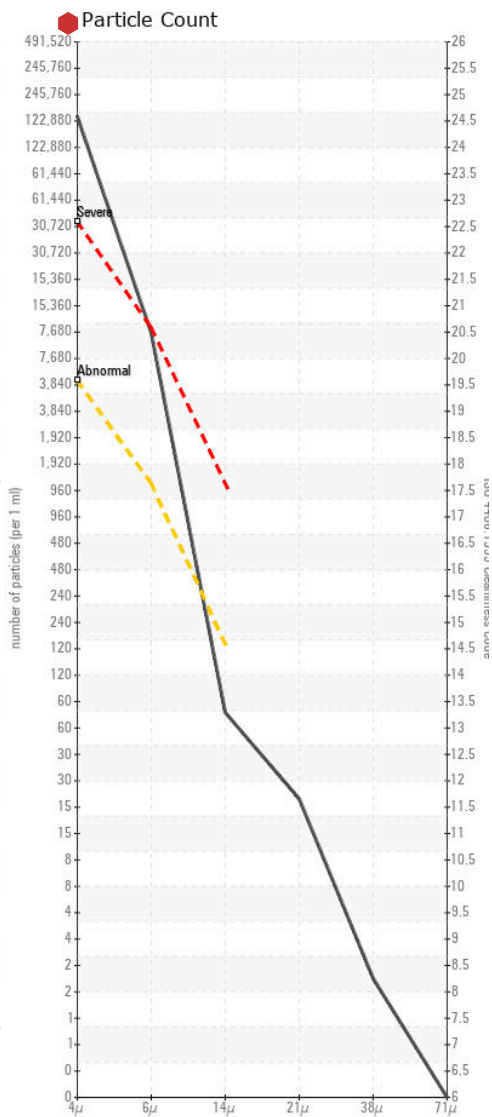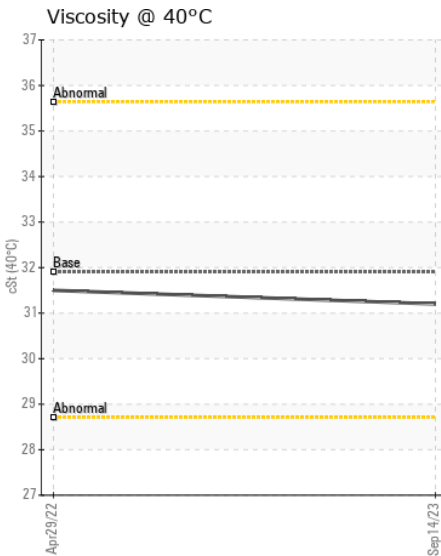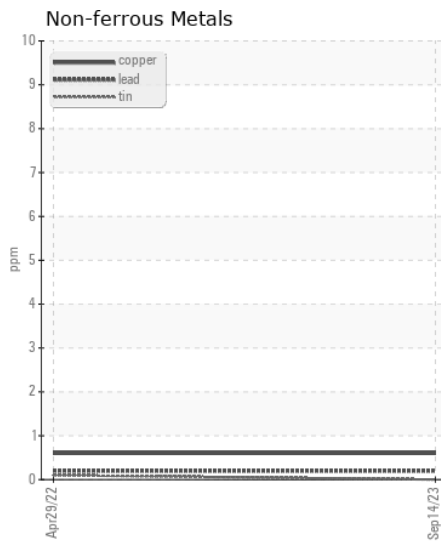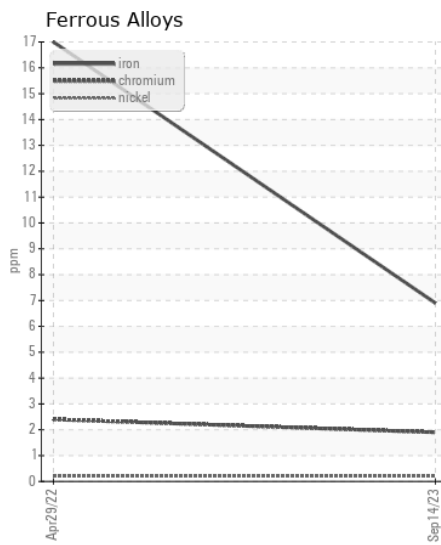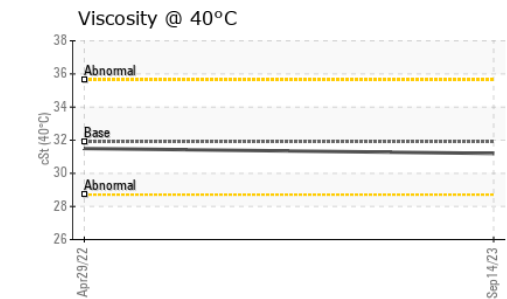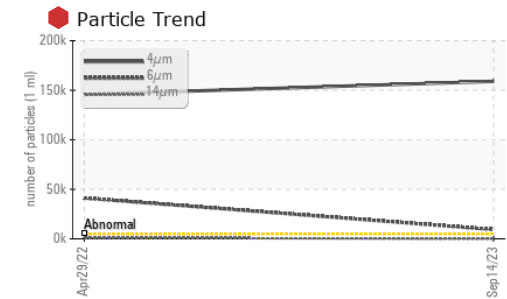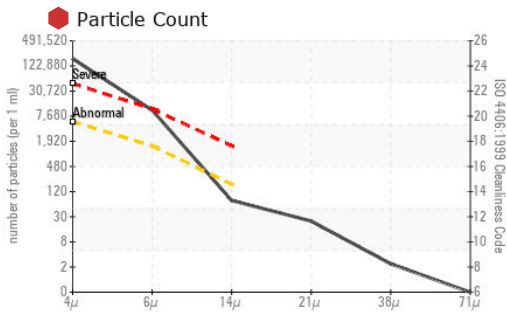

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : GFL0089050
Lab Number : 02588927
Unique Number : 5657993
Test Package : MOB 1 (Additional Tests: PrtCount)

GFL Environmental - 731STOK - Stoke Hauling
 286 Chemin Cote
 Stoke, QC
 CA J0B 3G0
 Contact: Robert Sayers
 rsayers@matrec.ca

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.

T:
F: