CONSTRUCTION EQUIPMENT

NOT GIVEN

[(375852)] LIEBHERR R920 054849-1705 - Left Final Drive

Sample No: LH0270469

Oil Type:

- 1

-						
U INFORMATION SUR L'ÉCHANTILLON						
Numéro d'échant.	LH0270469					
Date d'échant.	15 Aug 2023					
Heures de la Machine	515					
Heures de l'huile	0					
Huile changée	N/A					
Statut de l'echant.	NORMAL					

🌔 ÉTATI	🔴 ÉTAT D'HUILE					
Visc 40°C	cSt	194				

	CONTAMINATIO	ON		
Silicium	ppm	2	 	
Sodium	ppm	07	 	
Potassium	mqq n	• 4	 	

	14 14 · · · ·	•				
Ö						
Métaux d'Usure						
Fer	ppm	0 80				
Cuivre	ppm	○ <1				
Plomb	ppm	○ <1				
Étain	ppm	0 🔘				
Aluminium	ppm	○ <1				
Chrome	ppm	02				
Molybdène	ppm	0				
Nickel	ppm	○ <1				
Titane	ppm	<1				
Argent	ppm	0				
Manganèse	ppm	1				
Vanadium	ppm	0				

0 **ADDITIFS** Calcium 24 ppm Magnésium ppm 1 Zinc 16 ppm Phosphore 1274 ppm Baryum 12 ppm Bore ppm 4

Diagnostic

Resample at the next service interval to monitor. The fluid was not specified, however, a fluid match indicates that this fluid is SAE 80W90 Gear Oil. Please confirm the oil type and grade, and specify the brand of the oil on your next sample.All component wear rates are normal. There is no indication of any contamination in the oil. The condition of the oil is acceptable for the time in service.



ROBKAW 5629278 Kevin Marson 17 Aug 2023

Submitted By: ? Page 1 sur 2



ROBERT FRASER DBA FRASER LANDSCAPING

498 NORTHLINE ROAD FENELON FALLS, ON CA K0M 1N0

Contact: Service Manager








GRAPHS

 \odot

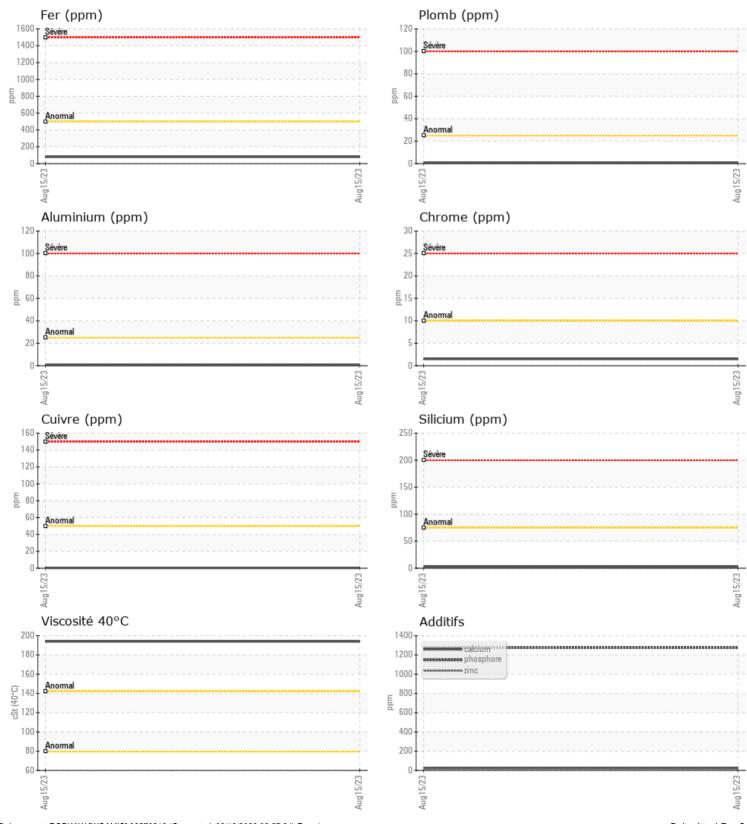

ID du rapport: ROBKAW [WCAMIS] 02576218 (Generated: 08/18/2023 08:27:34) Rev: 1