

## **PROBLEM SUMMARY**

# Sample Rating Trend







Machine Id
714058
Component
Diesel Engine
Fluid

PETRO CANADA DURON SHP 15W40 (--- GAL)

### **COMPONENT CONDITION SUMMARY**

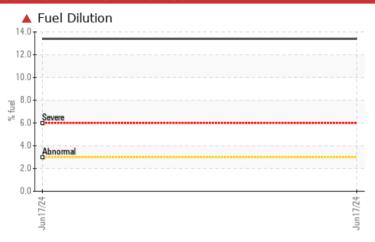

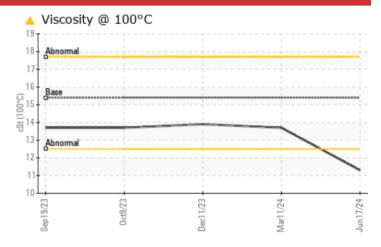

### RECOMMENDATION

We advise that you check the fuel injection system. The oil change at the time of sampling has been noted. We recommend an early resample to monitor this condition.

PROBLEMATIC TEST RESULTS										
Sample Status				SEVERE	NORMAL	NORMAL				
Fuel	%	ASTM D3524	>3.0	<b>13.4</b>	<1.0	<1.0				
Visc @ 100°C	cSt	ASTM D445	15.4	<b>11.3</b>	13.7	13.9				

Customer Id: GFL465 Sample No.: GFL0107041 Lab Number: 06213268 Test Package: FLEET



To manage this report scan the QR code

To discuss the diagnosis or test data: Wes Davis +1 905-569-8600 x223 wesd@wearcheck.ca

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDE	IENDED ACTIONS				
Action	Status	Date	Done By	Description	
Resample			?	We recommend an early resample to monitor this condition.	
Check Fuel/injector System			?	We advise that you check the fuel injection system.	

### HISTORICAL DIAGNOSIS

### 11 Mar 2024 Diag: Wes Davis

NORMAL



Resample at the next service interval to monitor. Metal levels are typical for a new component breaking in. There is no indication of any contamination in the oil. The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.





11 Dec 2023 Diag: Wes Davis Resample at the next service interval to monitor. Metal levels are typical for a new component breaking in. There is no indication of any contamination in the oil. The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.





09 Oct 2023 Diag: Don Baldridge

Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the oil. The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.






# **OIL ANALYSIS REPORT**



Machine Id 714058 Component Diesel Engine

PETRO CANADA DURON SHP 15W40 (--- GAL)

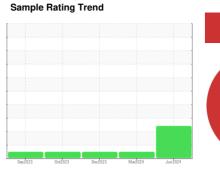



### **DIAGNOSIS**

### Recommendation

We advise that you check the fuel injection system. The oil change at the time of sampling has been noted. We recommend an early resample to monitor this condition.

Metal levels are typical for a new component breaking in.

### ▲ Contamination

There is a high amount of fuel present in the oil. Tests confirm the presence of fuel in the oil.

### Fluid Condition

The BN result indicates that there is suitable alkalinity remaining in the oil. Fuel is present in the oil and is lowering the viscosity. The oil is no longer serviceable due to the presence of contaminants.

N SHP 15W4U (-	GAL)	Sep.2023	0et2023			
SAMPLE INFOR	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		GFL0107041	GFL0107810	GFL0107027
Sample Date		Client Info		17 Jun 2024	11 Mar 2024	11 Dec 2023
Machine Age	hrs	Client Info		2586	1510	1158
Oil Age	hrs	Client Info		600	600	600
Oil Changed		Client Info		Changed	Changed	N/A
Sample Status				SEVERE	NORMAL	NORMAL
CONTAMINAT	ION	method	limit/base	current	history1	history2
Water		WC Method	>0.2	NEG	NEG	NEG
Glycol		WC Method		NEG	NEG	NEG
WEAR METAL	.S	method	limit/base	current	history1	history2
ron	ppm	ASTM D5185m	>90	66	12	2
Chromium	ppm	ASTM D5185m	>20	2	<1	0
lickel	ppm	ASTM D5185m	>2	<1	4	<1
Titanium	ppm	ASTM D5185m	>2	<1	0	0
Silver	ppm	ASTM D5185m	>2	0	0	0
Aluminum	ppm	ASTM D5185m	>20	8	1	1
ead	ppm	ASTM D5185m	>40	0	<1	<1
Copper	ppm	ASTM D5185m	>330	6	1	0
in	ppm	ASTM D5185m	>15	<1	<1	0
anadium	ppm	ASTM D5185m		0	0	0
Cadmium	ppm	ASTM D5185m		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	0	4	3	<1
Barium	ppm	ASTM D5185m	0	0	0	0
Molybdenum	ppm	ASTM D5185m	60	49	59	55
Manganese	ppm	ASTM D5185m	0	1	<1	0
//agnesium	ppm	ASTM D5185m	1010	798	967	1023
Calcium	ppm	ASTM D5185m	1070	879	1087	1186
Phosphorus	ppm	ASTM D5185m	1150	902	1045	1099
Zinc	ppm	ASTM D5185m	1270	1047	1275	1247
Sulfur	ppm	ASTM D5185m	2060	2686	3326	3146
CONTAMINAN	ITS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	9	4	4
Sodium	ppm	ASTM D5185m		38	2	1
Potassium	ppm	ASTM D5185m	>20	5	<1	<1
uel	%	ASTM D3524	>3.0	<b>13.4</b>	<1.0	<1.0
INFRA-RED		method	limit/base	current	history1	history2
Soot %	%	*ASTM D7844	>6	1.9	0.5	0.3
JUUL /6			00		8.5	6.1
	Abs/cm	*ASTM D7624	>20	13.3	0.0	0.1
Nitration	Abs/cm Abs/.1mm	*ASTM D7624 *ASTM D7415	>30	25.4	19.4	18.4
Vitration	Abs/.1mm	*ASTM D7415				
Nitration Sulfation FLUID DEGRA	Abs/.1mm	*ASTM D7415	>30	25.4	19.4	18.4
Nitration Sulfation	Abs/.1mm	*ASTM D7415 method	>30 limit/base	25.4 current	19.4 history1	18.4 history2



## **OIL ANALYSIS REPORT**







Certificate 12367

Laboratory Sample No.

: GFL0107041 Lab Number : 06213268 Unique Number : 11086132

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received Tested

: 18 Jun 2024 : 20 Jun 2024 Diagnosed **Test Package**: FLEET (Additional Tests: FuelDilution, PercentFuel)

: 20 Jun 2024 - Wes Davis

Pontiac, MI US 48340 Contact: Ricky Matthews rickymathews@gflenv.com T: (586)825-9514

GFL Environmental - 465 - Pontiac

To discuss this sample report, contact Customer Service at 1-800-237-1369.  $^st$  - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Report Id: GFL465 [WUSCAR] 06213268 (Generated: 06/21/2024 19:57:16) Rev: 1

888 Baldwin