

PROBLEM SUMMARY

Sample Rating Trend

VIS DEBRIS

Machine Id
MLU-1
Component
Outboard Lube System
Fluid
ROYAL PURPLE SYNFILM GT 32 (--- GAL)

COMPONENT CONDITION SUMMARY

No relevant graphs to display

RECOMMENDATION

We suspect abnormal contamination may be due to sampling method. No corrective action is recommended at this time. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS									
Sample Status				ABNORMAL					
Debris	scalar	*Visual	NONE	▲ MODER					

Customer Id: ENEKAR Sample No.: RP0027416 Lab Number: 05831292 Test Package: IND 2

To manage this report scan the QR code

To discuss the diagnosis or test data: Jonathan Hester +1 919-379-4092 x4092 jhester@wearcheckusa.com

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com


RECOMMENDED ACTIONS

There are no recommended actions for this sample.

HISTORICAL DIAGNOSIS



OIL ANALYSIS REPORT

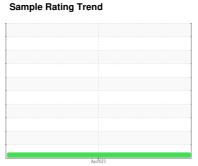





Machine Id MLU-1 Component

Outboard Lube System

ROYAL PURPLE SYNFILM GT 32 (--- GAL)

DIAGNOSIS

Recommendation

We suspect abnormal contamination may be due to sampling method. No corrective action is recommended at this time. Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

Moderate concentration of visible dirt/debris present in the oil.


Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

)				Apr2023		
SAMPLE INFORM	IATION	method	limit/base	current	history1	history2
Sample Number		Client Info		RP0027416		
Sample Date		Client Info		21 Apr 2023		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Oil Changed	0	Client Info		N/A		
Sample Status				ABNORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>20	0		
Chromium	ppm	ASTM D5185m	>20	0		
Nickel	ppm	ASTM D5185m	>20	0		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>20	<1		
Lead	ppm	ASTM D5185m	>20	0		
Copper	ppm	ASTM D5185m	>20	13		
Tin	ppm	ASTM D5185m	>20	0		
Vanadium	ppm	ASTM D5185m		<1		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m		0		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		<1		
Magnesium	ppm	ASTM D5185m		19		
Calcium	ppm	ASTM D5185m		0		
Phosphorus	ppm	ASTM D5185m		5		
Zinc	ppm	ASTM D5185m		9		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	n 10 100			<1		motoryz
	ppm	ASTM D5185m	>15			
Sodium	ppm	ASTM D5185m	. 00	0		
Potassium	ppm	ASTM D5185m	>20	0		
Water	%	ASTM D6304		0.009		
ppm Water	ppm	ASTM D6304	>500	94.0		
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		0.33		
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Precipitate	scalar	*Visual	NONE	NONE		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	▲ MODER		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual	>0.05	NEG		
05 Free Water	scalar	*Visual		NEG	on: Service Ma	nagerENEKAR



OIL ANALYSIS REPORT

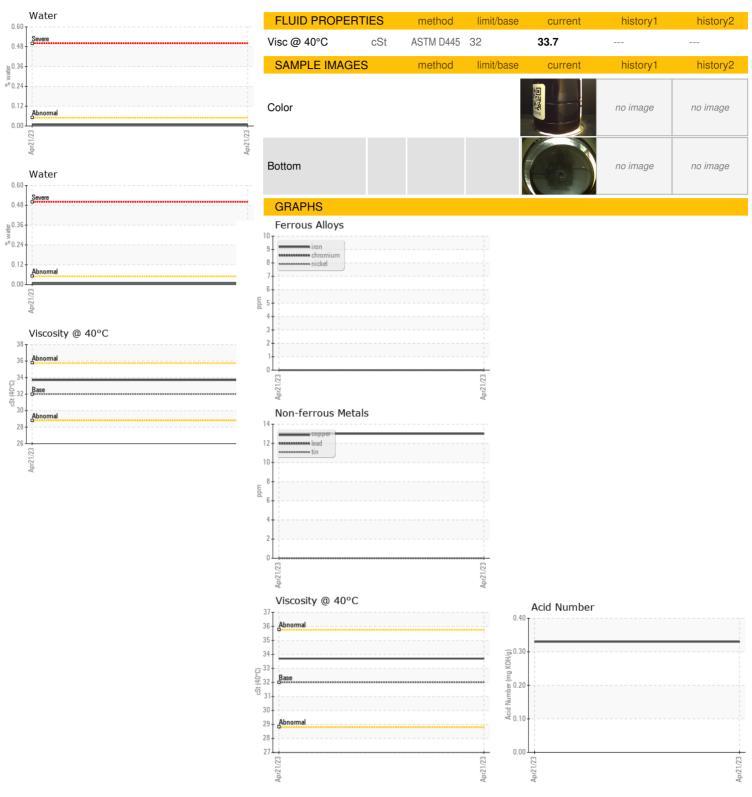



Laboratory Sample No. Lab Number Unique Number : 10444785

: 05831292

: RP0027416

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received Diagnosed

: 27 Apr 2023 : 01 May 2023

Diagnostician : Jonathan Hester Test Package : IND 2 (Additional Tests: PrtCount)

11398 SH-43 KARNACK, TX US 75661

Contact: Service Manager

ENERGY TRANSFER - KARNACK

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Contact/Location: Service Manager - ENEKAR

T:

F: