

PROBLEM SUMMARY


Sample Rating Trend



HYBON SYNTHETIC 150 QUINCY SUMMIT

Component Compressor

COMPONENT CONDITION SUMMARY

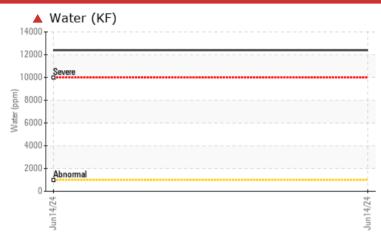

RECOMMENDATION

We advise that you follow the water drain-off procedure for this component. We recommend an early resample to monitor this condition.

PROBLEMATIC TEST RESULTS									
Sample Status				SEVERE					
Water	%	ASTM D6304	>0.1	1.24					
ppm Water	ppm	ASTM D6304	>1000	12400					
Emulsified Water	scalar	*Visual	>0.1	0.2%					

Customer Id: UCCIMEVA Sample No.: UCH06219875 Lab Number: 06219875 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data: Angela Borella +1 800-237-1369 angela.borella@wearcheckusa.com

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS						
Action	Status	Date	Done By	Description		
Water Drain-off			?	We advise that you follow the water drain-off procedure for this component.		
Resample			?	We recommend an early resample to monitor this condition.		


HISTORICAL DIAGNOSIS



OIL ANALYSIS REPORT

HYBON SYNTHETIC 150 QUINCY SUMMIT

Component Compressor

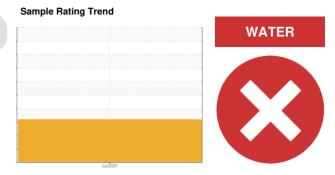

DIAGNOSIS

Recommendation

We advise that you follow the water drain-off procedure for this component. We recommend an early resample to monitor this condition.

All component wear rates are normal.

Contamination

There is a high concentration of water present in the oil.

Fluid Condition

The AN level is acceptable for this fluid.

SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		UCH06219875		
Sample Date		Client Info		14 Jun 2024		
Machine Age	hrs	Client Info		150		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				SEVERE		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0		
Chromium	ppm	ASTM D5185m	>10	0		
Nickel	ppm	ASTM D5185m		1		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>25	1		
Lead	ppm	ASTM D5185m	>25	0		
Copper	ppm	ASTM D5185m	>50	<1		
Tin	ppm	ASTM D5185m	>15	0		
Vanadium	ppm	ASTM D5185m		<1		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		2		
Barium	ppm	ASTM D5185m		0		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		<1		
Magnesium	ppm	ASTM D5185m		<1		
Calcium	ppm	ASTM D5185m		0		
Phosphorus	ppm	ASTM D5185m		636		
Zinc	ppm	ASTM D5185m		0		
Sulfur	ppm	ASTM D5185m		4		
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	3		
Sodium	ppm	ASTM D5185m		2		
Potassium	ppm	ASTM D5185m	>20	3		
Water	%	ASTM D6304	>0.1	1.24		
ppm Water	ppm	ASTM D6304	>1000	12400		
FLUID DEGRADA	ATION	method	limit/base	current	history1	history2


Acid Number (AN)

mg KOH/g ASTM D8045

0.26



OIL ANALYSIS REPORT

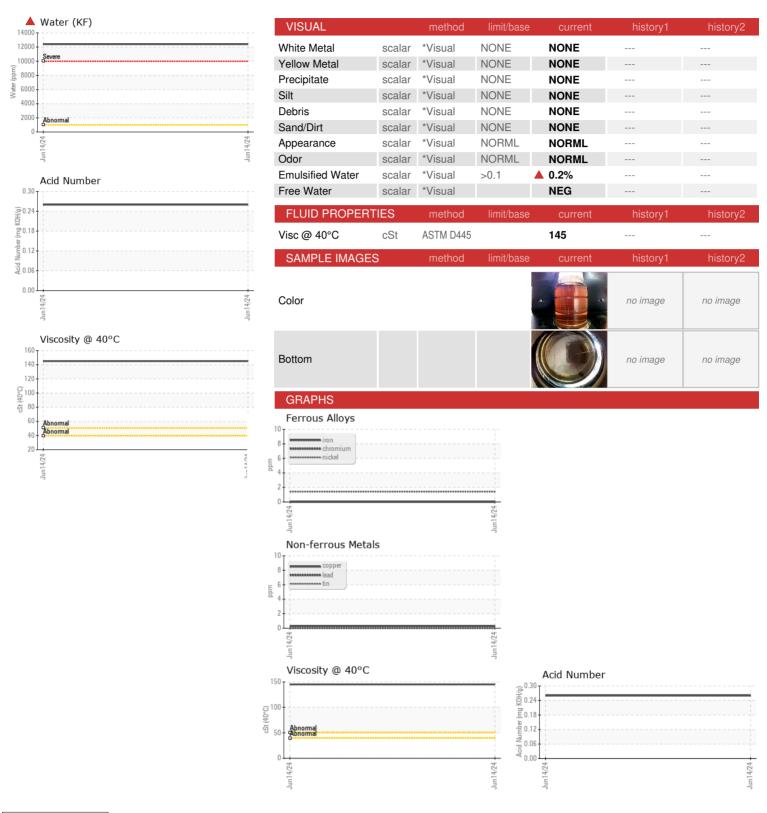





Certificate 12367

Laboratory Sample No.

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Lab Number : 06219875

: UCH06219875

 $\textbf{Unique Number} \quad : 11098072$

Diagnosed Test Package : IND 2 (Additional Tests: KF)

To discuss this sample report, contact Customer Service at 1-800-237-1369.

Received

Tested

: 25 Jun 2024

: 26 Jun 2024

: 27 Jun 2024 - Angela Borella

 st - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

CIMARRON FIELD SERVICES

1400 42ND ST EVANS, CO US 80620

Contact: COLLEEN GRIFFITH CGRIFFITH@CIMARRON.COM

T:

F: Contact/Location: COLLEEN GRIFFITH - UCCIMEVA