# OIL ANALYSIS REPORT

| | |
|---|---|
| WEAR | NORMAL |
| CONTAMINATION | NORMAL |
| FLUID CONDITION | NORMAL |

Machine Id
## KIOTI CK3510SEHC VHH300077
Component
## Diesel Engine
Fluid
## DIESEL ENGINE OIL SAE 40 (--- GAL)

## RECOMMENDATION

Resample at the next service interval to monitor.

## WEAR

All component wear rates are normal.

## CONTAMINATION

There is no indication of any contamination in the oil.

## FLUID CONDITION

The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

| Test | UOM | Method | Limit/Abn | Current | History1 | History2 |
|---|---|---|---|---|---|---|
| Sample Number | | Client Info | | KT0000739 | --- | --- |
| Sample Date | | Client Info | | 05 Apr 2024 | --- | --- |
| Machine Age | hrs | Client Info | | 685 | --- | --- |
| Oil Age | hrs | Client Info | | 0 | --- | --- |
| Filter Age | hrs | Client Info | | 0 | --- | --- |
| Oil Changed | | Client Info | | N/A | --- | --- |
| Filter Changed | | Client Info | | N/A | --- | --- |
| Sample Status | | | | NORMAL | --- | --- |
| Iron | ppm | ASTM D5185m | >100 | 140 | --- | --- |
| Chromium | ppm | ASTM D5185m | >20 | 1 | --- | --- |
| Nickel | ppm | ASTM D5185m | >4 | 0 | --- | --- |
| Titanium | ppm | ASTM D5185m | | 0 | --- | --- |
| Silver | ppm | ASTM D5185m | >3 | 0 | --- | --- |
| Aluminum | ppm | ASTM D5185m | >20 | 33 | --- | --- |
| Lead | ppm | ASTM D5185m | >40 | 2 | --- | --- |
| Copper | ppm | ASTM D5185m | >330 | 7 | --- | --- |
| Tin | ppm | ASTM D5185m | >15 | 6 | --- | --- |
| Vanadium | ppm | ASTM D5185m | | 0 | --- | --- |
| White Metal | scalar | *Visual | NONE | MODER | --- | --- |
| Yellow Metal | scalar | *Visual | NONE | NONE | --- | --- |
| Silicon | ppm | ASTM D5185m | >25 | 18 | --- | --- |
| Potassium | ppm | ASTM D5185m | >20 | 2 | --- | --- |
| Fuel | | WC Method | >5 | <1.0 | --- | --- |
| Water | | WC Method | >0.2 | NEG | --- | --- |
| Glycol | | WC Method | | NEG | --- | --- |
| Soot % | % | *ASTM D7844 | >3 | 0.1 | --- | --- |
| Nitration | Abs/cm | *ASTM D7624 | >20 | 5.8 | --- | --- |
| Sulfation | Abs/.1mm | *ASTM D7415 | >30 | 18.8 | --- | --- |
| Silt | scalar | *Visual | NONE | NONE | --- | --- |
| Debris | scalar | *Visual | NONE | NONE | --- | --- |
| Sand/Dirt | scalar | *Visual | NONE | NONE | --- | --- |
| Appearance | scalar | *Visual | NORML | NORML | --- | --- |
| Odor | scalar | *Visual | NORML | NORML | --- | --- |
| Emulsified Water | scalar | *Visual | >0.2 | NEG | --- | --- |
| Sodium | ppm | ASTM D5185m | >216 | 3 | --- | --- |
| Boron | ppm | ASTM D5185m | 250 | 49 | --- | --- |
| Barium | ppm | ASTM D5185m | 10 | 0 | --- | --- |
| Molybdenum | ppm | ASTM D5185m | 100 | 35 | --- | --- |
| Manganese | ppm | ASTM D5185m | | 3 | --- | --- |
| Magnesium | ppm | ASTM D5185m | 450 | 595 | --- | --- |
| Calcium | ppm | ASTM D5185m | 3000 | 1498 | --- | --- |
| Phosphorus | ppm | ASTM D5185m | 1150 | 820 | --- | --- |
| Zinc | ppm | ASTM D5185m | 1350 | 942 | --- | --- |
| Sulfur | ppm | ASTM D5185m | 4250 | 2785 | --- | --- |
| Oxidation | Abs/.1mm | *ASTM D7414 | >25 | 14.4 | --- | --- |
| Base Number (BN) | mg KOH/g | ASTM D2896 | 8.5 | 8.4 | --- | --- |
| Visc @ 100°C | cSt | ASTM D445 | 14.4 | 13.1 | --- | --- |

FT-IR (Direct Trend)




Base Number




Viscosity @ 100°C

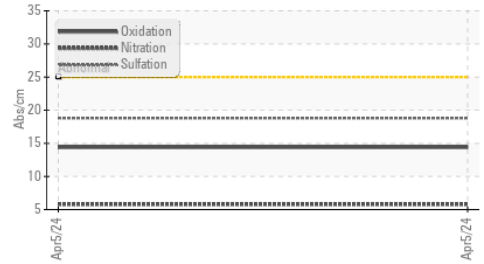


Ferrous Alloys

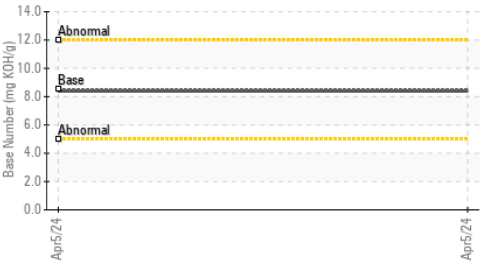


Non-ferrous Metals

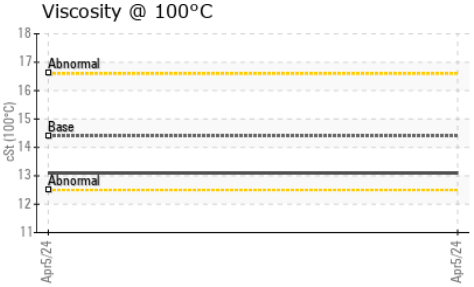


Viscosity @ 100°C

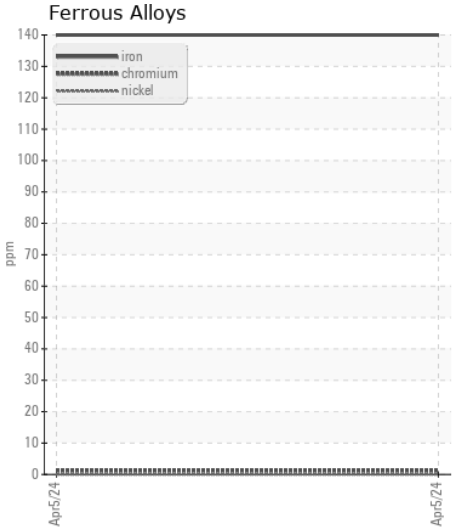


Base Number

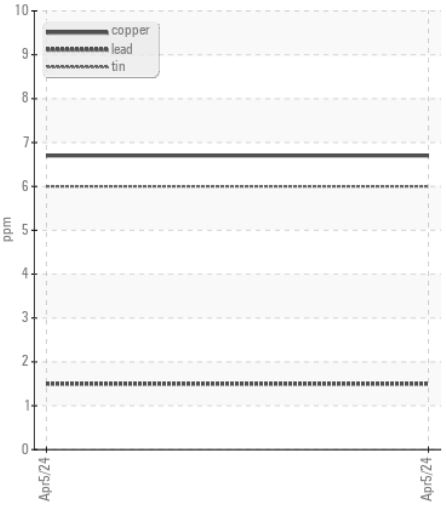


Certificate L2367

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513
**Sample No.** : KT0000739 **Received** : 18 Apr 2024
**Lab Number** : 06153718 **Tested** : 19 Apr 2024
**Unique Number** : 10983796 **Diagnosed** : 23 Apr 2024 - Jonathan Hester
**Test Package** : CONST ( Additional Tests: TBN )

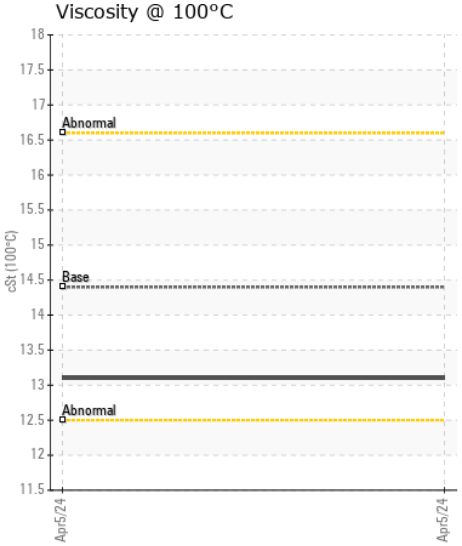*To discuss this sample report, contact Customer Service at 1-800-237-1369.*
** - Denotes test methods that are outside of the ISO 17025 scope of accreditation.*
*Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)*

**RIVERAS MACHINERY**
800 W EXP 83
DONNA, TX
US 78537
Contact: Service Manager

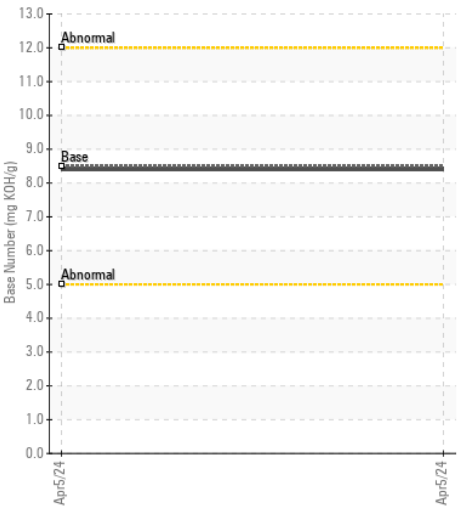T: (956)464-7867
F: