OIL ANALYSIS REPORT

Machine Id
925005
Component
Diesel Engine
Fluid
PETRO CANADA DURON SHP 15W40 (--- GAL)

Sample Rating Trend

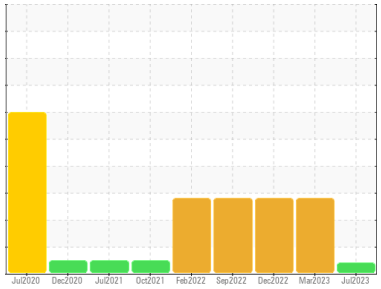

VISCOSITY

DIAGNOSIS

Recommendation

No corrective action is recommended at this time. Confirm the source of the lubricant being utilized for top-up/fill. Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

Light fuel dilution occurring. No other contaminants were detected in the oil.

Fluid Condition

Viscosity of sample indicates oil is within SAE 30 range, advise investigate. This plus the additive levels indicates that this is not the same brand, or type of oil as reported. The condition of the oil is acceptable for the time in service.

SAMPLE INFORMATION		method	limit/base	current	history1	history2
Sample Number		Client Info		**GFL0078497**	GFL0071302	GFL0063903
Sample Date		Client Info		**18 Jul 2023**	14 Mar 2023	21 Dec 2022
Machine Age	kms	Client Info		**0**	21099	21096
Oil Age	kms	Client Info		**22169**	0	515
Oil Changed		Client Info		**N/A**	Changed	Changed
Sample Status				**ABNORMAL**	SEVERE	SEVERE

CONTAMINATION		method	limit/base	current	history1	history2
Glycol		WC Method		**NEG**	NEG	NEG

WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>120	**3**	5	6
Chromium	ppm	ASTM D5185(m)	>20	**0**	0	0
Nickel	ppm	ASTM D5185(m)	>5	**0**	<1	<1
Titanium	ppm	ASTM D5185(m)	>2	**0**	<1	<1
Silver	ppm	ASTM D5185(m)	>2	**0**	0	0
Aluminum	ppm	ASTM D5185(m)	>20	**1**	2	2
Lead	ppm	ASTM D5185(m)	>40	**<1**	<1	<1
Copper	ppm	ASTM D5185(m)	>330	**<1**	1	<1
Tin	ppm	ASTM D5185(m)	>15	**0**	0	<1
Antimony	ppm	ASTM D5185(m)		**0**	<1	<1
Vanadium	ppm	ASTM D5185(m)		**0**	0	0
Beryllium	ppm	ASTM D5185(m)		**0**	0	0
Cadmium	ppm	ASTM D5185(m)		**0**	0	0

ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)	0	**45**	3	2
Barium	ppm	ASTM D5185(m)	0	**0**	0	0
Molybdenum	ppm	ASTM D5185(m)	60	**38**	45	46
Manganese	ppm	ASTM D5185(m)	0	**<1**	<1	<1
Magnesium	ppm	ASTM D5185(m)	1010	**484**	737	738
Calcium	ppm	ASTM D5185(m)	1070	**1629**	853	875
Phosphorus	ppm	ASTM D5185(m)	1150	**751**	847	827
Zinc	ppm	ASTM D5185(m)	1270	**825**	907	932
Sulfur	ppm	ASTM D5185(m)	2060	**2037**	2060	2003
Lithium	ppm	ASTM D5185(m)		**<1**	<1	<1

CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>25	**4**	3	2
Sodium	ppm	ASTM D5185(m)		**2**	3	4
Potassium	ppm	ASTM D5185(m)	>20	**<1**	1	<1
Fuel	%	ASTM D7593*	>3.0	**1.1**	14.2	13.6

INFRA-RED		method	limit/base	current	history1	history2
Soot %	%	ASTM D7844*	>4	**0**	0.1	0.2
Nitration	Abs/cm	ASTM D7624*	>20	**5.8**	8.2	8.5
Sulfation	Abs/.1mm	ASTM D7415*	>30	**22.1**	20.6	20.4

FLUID DEGRADATION		method	limit/base	current	history1	history2
Oxidation	Abs/.1mm	ASTM D7414*	>25	**19.5**	13.9	15.3

OIL ANALYSIS REPORT

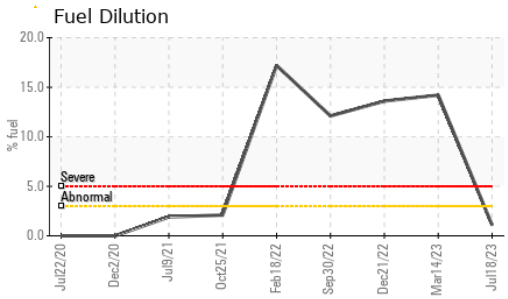

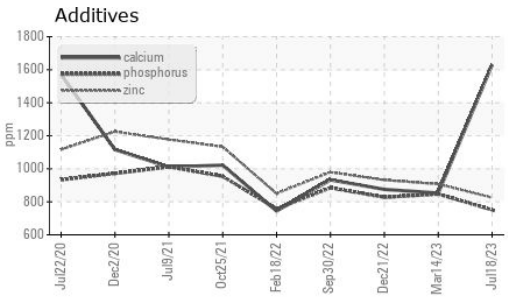

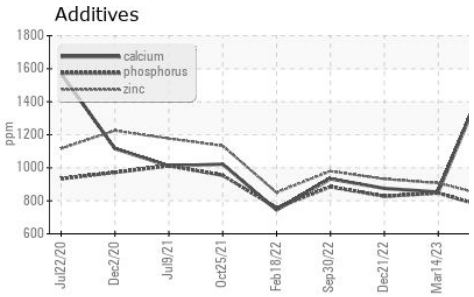

VISUAL		method	limit/base	current	history1	history2
Emulsified Water	scalar	Visual*	>0.2	**NEG**	NEG	NEG
Free Water	scalar	Visual*		**NEG**	NEG	NEG

FLUID PROPERTIES		method	limit/base	current	history1	history2
Visc @ 100°C	cSt	ASTM D7279(m)	15.4	▲ **11.0**	⬢ 9	⬢ 9

GRAPHS

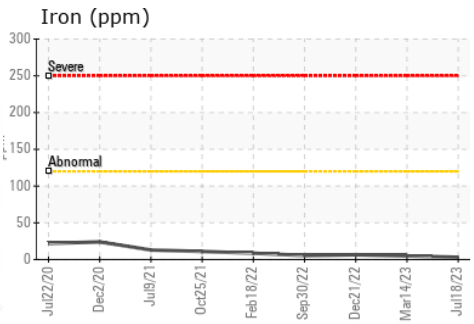

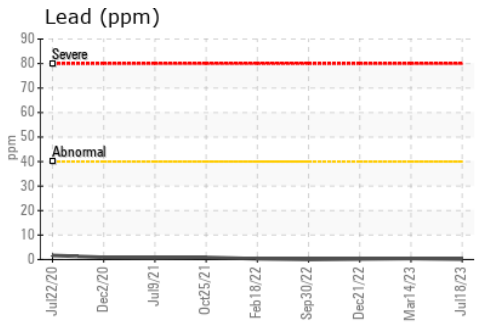

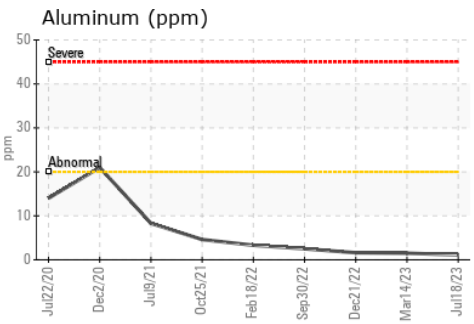

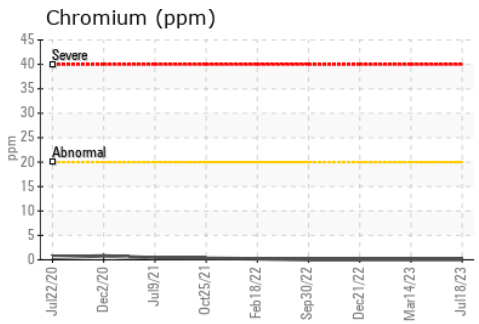

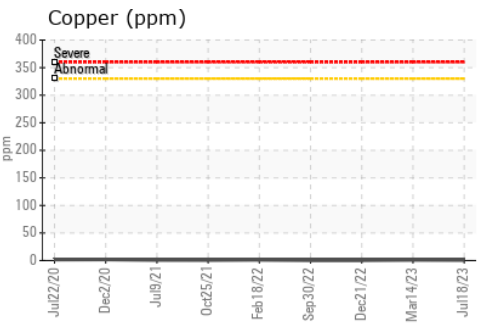

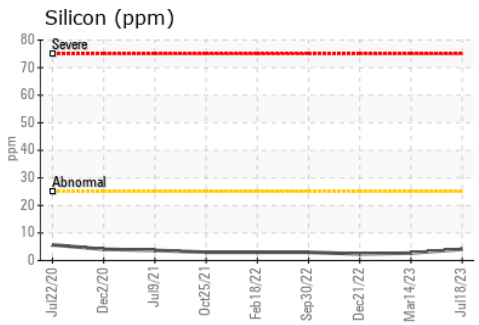

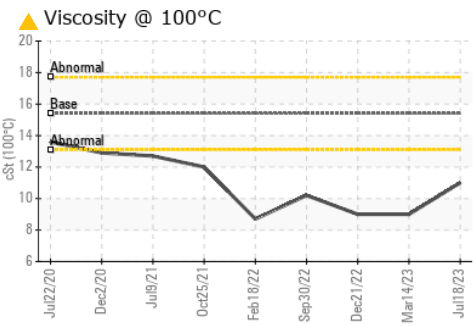

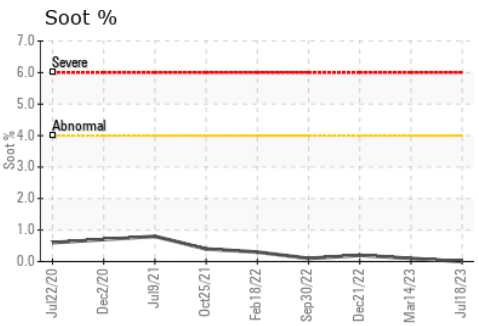

ISO 17025:2017 Accredited Laboratory

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 **GFL Environmental - 246 - Windsor**
Sample No. : GFL0078497 **Received** : 19 Jul 2023 2700 Deziel Dr
Lab Number : 02570831 **Diagnosed** : 20 Jul 2023 Windsor, ON
Unique Number : 5615882 **Diagnostician** : Kevin Marson CA N8W 5H8
Test Package : MOB 1 (Additional Tests: PercentFuel) Contact: Dave Varga
To discuss this sample report, contact Customer Service at 1-800-268-2131. dvarga@gflenv.com
Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. T: (519)944-8009
Validity of results and interpretation are based on the sample and information as supplied. F: