OIL ANALYSIS REPORT

Machine Id
7981
Component
Diesel Engine
Fluid
PETRO CANADA DURON SHP 15W40 (20 LTR)

Sample Rating Trend

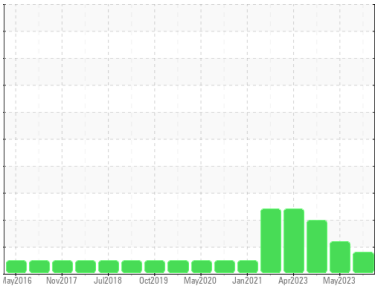

FUEL

DIAGNOSIS

Recommendation
No corrective action is recommended at this time. Resample at the next service interval to monitor.

Wear
All component wear rates are normal.

Contamination
Elevated aluminum (Al) and/or lead (Pb) and potassium (K) levels in your metals analysis are likely a result of solder flux release into the lubricant and is common on new equipment/components. Light fuel dilution occurring. No other contaminants were detected in the oil.

Fluid Condition
The condition of the oil is acceptable for the time in service.

SAMPLE INFORMATION		method	limit/base	current	history1	history2
Sample Number		Client Info		**GFL**	GFL0081968	GFL0081998
Sample Date		Client Info		**05 Sep 2023**	29 May 2023	16 May 2023
Machine Age	kms	Client Info		**0**	21098	14387
Oil Age	kms	Client Info		**0**	0	0
Oil Changed		Client Info		**N/A**	Changed	Changed
Sample Status				**MARGINAL**	ABNORMAL	ATTENTION

CONTAMINATION	method	limit/base	current	history1	history2
Glycol	WC Method		**NEG**	NEG	NEG

WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>80	**25**	3	4
Chromium	ppm	ASTM D5185(m)	>5	**1**	0	0
Nickel	ppm	ASTM D5185(m)	>2	**0**	<1	<1
Titanium	ppm	ASTM D5185(m)		**<1**	<1	<1
Silver	ppm	ASTM D5185(m)	>3	**<1**	0	0
Aluminum	ppm	ASTM D5185(m)	>30	**12**	1	2
Lead	ppm	ASTM D5185(m)	>30	**<1**	0	0
Copper	ppm	ASTM D5185(m)	>150	**2**	<1	<1
Tin	ppm	ASTM D5185(m)	>5	**0**	0	0
Antimony	ppm	ASTM D5185(m)		**0**	<1	0
Vanadium	ppm	ASTM D5185(m)		**0**	0	0
Beryllium	ppm	ASTM D5185(m)		**0**	0	0
Cadmium	ppm	ASTM D5185(m)		**0**	0	0

ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)	0	**7**	14	▲ 26
Barium	ppm	ASTM D5185(m)	0	**0**	0	0
Molybdenum	ppm	ASTM D5185(m)	60	**56**	55	44
Manganese	ppm	ASTM D5185(m)	0	**<1**	<1	<1
Magnesium	ppm	ASTM D5185(m)	1010	**800**	808	▲ 178
Calcium	ppm	ASTM D5185(m)	1070	**1178**	1222	▲ 2097
Phosphorus	ppm	ASTM D5185(m)	1150	**961**	1079	1034
Zinc	ppm	ASTM D5185(m)	1270	**1140**	1136	1080
Sulfur	ppm	ASTM D5185(m)	2060	**2457**	2705	3120
Lithium	ppm	ASTM D5185(m)		**<1**	<1	<1

CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>20	**7**	3	3
Sodium	ppm	ASTM D5185(m)		**8**	2	1
Potassium	ppm	ASTM D5185(m)	>20	**27**	0	<1
Fuel	%	ASTM D7593*	>5	▲ **3.7**	▲ 5.2	▲ 3.5

INFRA-RED		method	limit/base	current	history1	history2
Soot %	%	ASTM D7844*	>3	**0.4**	0	0
Nitration	Abs/cm	ASTM D7624*	>20	**12.1**	6.2	7.2
Sulfation	Abs/.1mm	ASTM D7415*	>30	**25.1**	17.9	17.0

FLUID DEGRADATION		method	limit/base	current	history1	history2
Oxidation	Abs/.1mm	ASTM D7414*	>25	**21.6**	13.5	12.2

OIL ANALYSIS REPORT

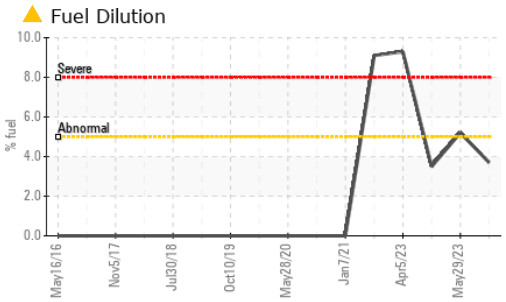

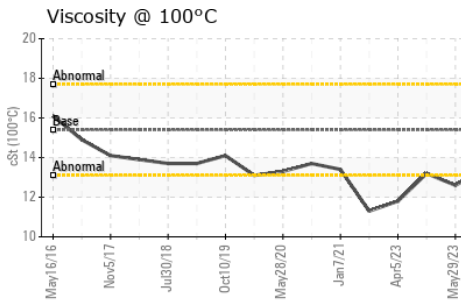

VISUAL		method	limit/base	current	history1	history2
Emulsified Water	scalar	Visual*	>0.2	**NEG**	NEG	NEG
Free Water	scalar	Visual*		**NEG**	NEG	NEG

FLUID PROPERTIES		method	limit/base	current	history1	history2
Visc @ 100°C	cSt	ASTM D7279(m)	15.4	**13.4**	▲ 12.6	13.2

GRAPHS

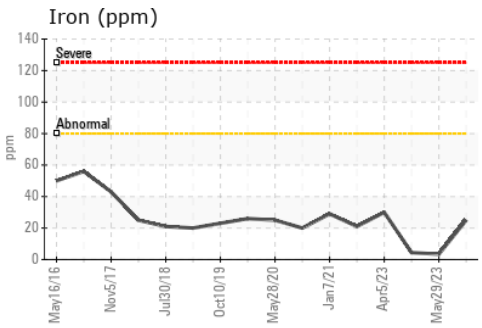

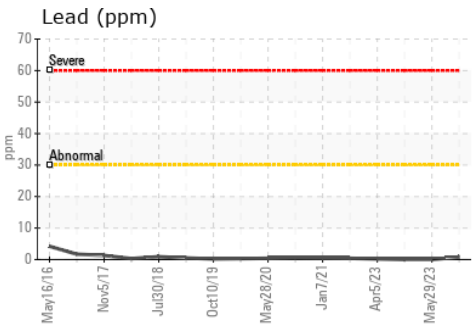

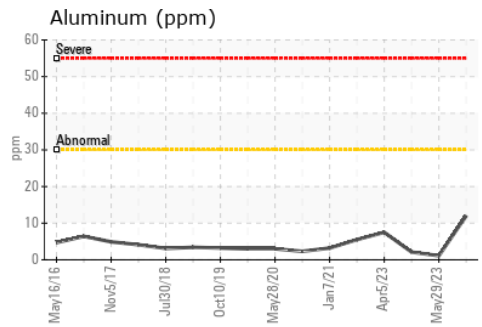

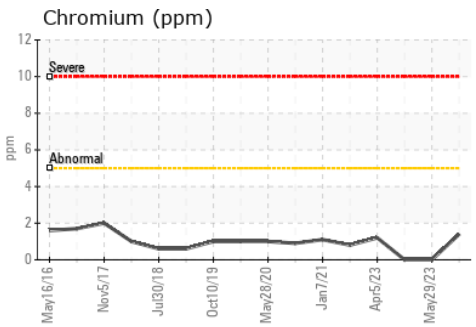

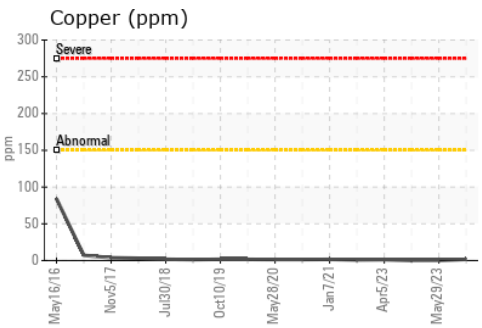

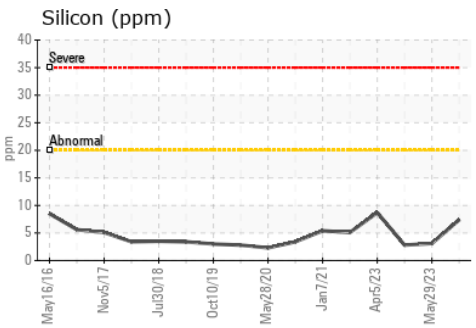

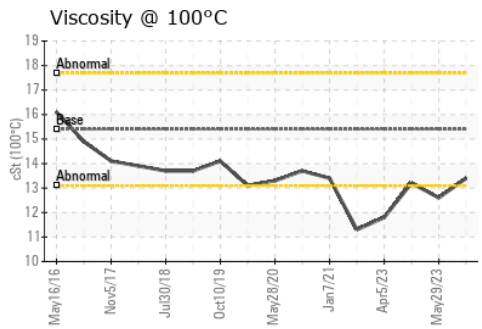

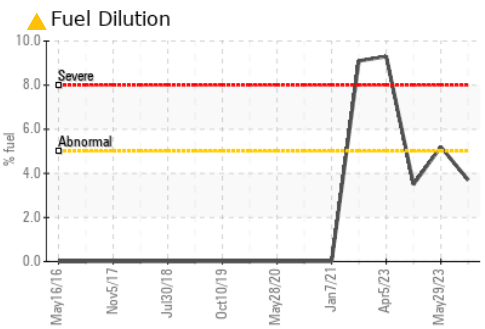

ISO 17025:2017 Accredited Laboratory

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : GFL
Lab Number : 02580566
Unique Number : 5633626
Test Package : MOB 1 (Additional Tests: PercentFuel)

Received : 06 Sep 2023
Diagnosed : 07 Sep 2023
Diagnostician : Wes Davis

To discuss this sample report, contact Customer Service at 1-800-268-2131.
Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
Validity of results and interpretation are based on the sample and information as supplied.

GFL Environmental - 217 - Aurora
14131 BAYVIEW AVE, AURORA YARD
AURORA, ON
CA L4G 0K6
Contact: Mike Havens
MHavens@gflenv.com
T:
F: (905)713-2445

Report Id: GFL217 [WCAMIS] 02580566 (Generated: 09/07/2023 09:37:11) Rev: 1

Submitted By: Scott Ewan