OIL ANALYSIS REPORT

Sample Rating Trend

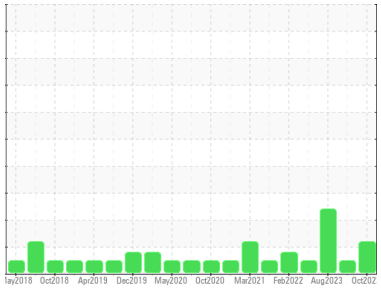

FUEL

Machine Id
801026
Component
Diesel Engine
Fluid
PETRO CANADA DURON SHP 15W40 (22 LTR)

DIAGNOSIS

Recommendation

The oil change at the time of sampling has been noted. We recommend an early resample to monitor this condition.

Wear

All component wear rates are normal.

Contamination

Elevated aluminum (Al) and/or lead (Pb) and potassium (K) levels in your metals analysis are likely a result of solder flux release into the lubricant and is common on new equipment/components. There is a moderate amount of fuel present in the oil. Tests confirm the presence of fuel in the oil.

Fluid Condition

Fuel is present in the oil and is lowering the viscosity. The oil is no longer serviceable due to the presence of contaminants.

SAMPLE INFORMATION		method	limit/base	current	history1	history2
Sample Number		Client Info		**GFL0094201**	GFL0086508	GFL
Sample Date		Client Info		**11 Oct 2023**	22 Aug 2023	15 Aug 2023
Machine Age	kms	Client Info		**153620**	153620	0
Oil Age	kms	Client Info		**8648**	0	0
Oil Changed		Client Info		**Changed**	Not Changd	N/A
Sample Status				**ABNORMAL**	NORMAL	ABNORMAL

CONTAMINATION	method	limit/base	current	history1	history2
Glycol	WC Method		**NEG**	NEG	0.0

WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>80	**42**	20	▲ 82
Chromium	ppm	ASTM D5185(m)	>5	**2**	1	4
Nickel	ppm	ASTM D5185(m)	>2	**<1**	0	<1
Titanium	ppm	ASTM D5185(m)		**0**	0	<1
Silver	ppm	ASTM D5185(m)	>3	**<1**	0	<1
Aluminum	ppm	ASTM D5185(m)	>30	**8**	5	20
Lead	ppm	ASTM D5185(m)	>30	**<1**	0	<1
Copper	ppm	ASTM D5185(m)	>150	**1**	<1	2
Tin	ppm	ASTM D5185(m)	>5	**0**	0	<1
Antimony	ppm	ASTM D5185(m)		**0**	0	0
Vanadium	ppm	ASTM D5185(m)		**0**	0	0
Beryllium	ppm	ASTM D5185(m)		**0**	0	0
Cadmium	ppm	ASTM D5185(m)		**0**	0	0

ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)	0	**5**	6	5
Barium	ppm	ASTM D5185(m)	0	**<1**	0	0
Molybdenum	ppm	ASTM D5185(m)	60	**58**	55	56
Manganese	ppm	ASTM D5185(m)	0	**0**	<1	<1
Magnesium	ppm	ASTM D5185(m)	1010	**892**	885	892
Calcium	ppm	ASTM D5185(m)	1070	**1014**	976	997
Phosphorus	ppm	ASTM D5185(m)	1150	**905**	980	978
Zinc	ppm	ASTM D5185(m)	1270	**1116**	1085	1105
Sulfur	ppm	ASTM D5185(m)	2060	**2243**	2357	2083
Lithium	ppm	ASTM D5185(m)		**<1**	<1	<1

CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>20	**8**	5	14
Sodium	ppm	ASTM D5185(m)		**9**	6	11
Potassium	ppm	ASTM D5185(m)	>20	**10**	6	25
Fuel	%	ASTM D7593*	>5	▲ **5**	<1.0	<1.0

INFRA-RED		method	limit/base	current	history1	history2
Soot %	%	ASTM D7844*	>3	**0.5**	0.2	1.3
Nitration	Abs/cm	ASTM D7624*	>20	**12.7**	9.7	17.7
Sulfation	Abs/.1mm	ASTM D7415*	>30	**24.0**	21.0	▲ 31.5

FLUID DEGRADATION		method	limit/base	current	history1	history2
Oxidation	Abs/.1mm	ASTM D7414*	>25	**23.2**	17.5	▲ 33.1

OIL ANALYSIS REPORT

Fuel Dilution

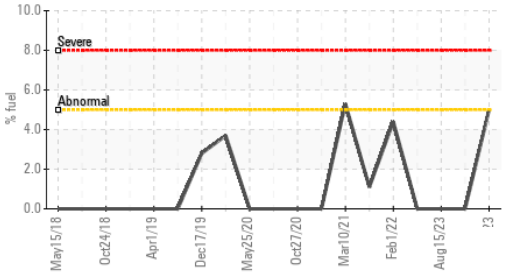

Viscosity @ 100°C

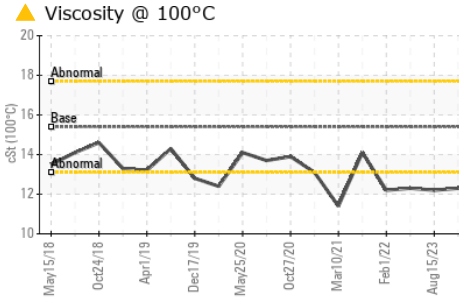

VISUAL		method	limit/base	current	history1	history2
Emulsified Water	scalar	Visual*	>0.2	**NEG**	NEG	NEG
Free Water	scalar	Visual*		**NEG**	NEG	NEG

FLUID PROPERTIES		method	limit/base	current	history1	history2
Visc @ 100°C	cSt	ASTM D7279(m)	15.4	▲ **12.6**	12.3	12.2

GRAPHS

Iron (ppm)

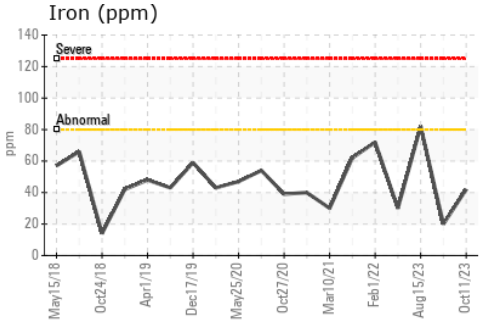

Lead (ppm)

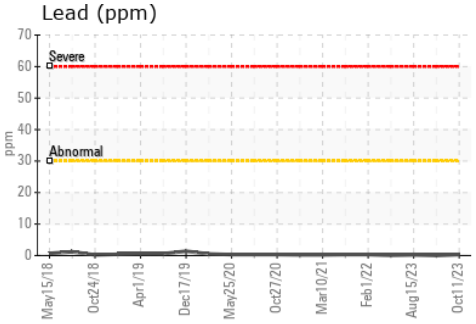

Aluminum (ppm)

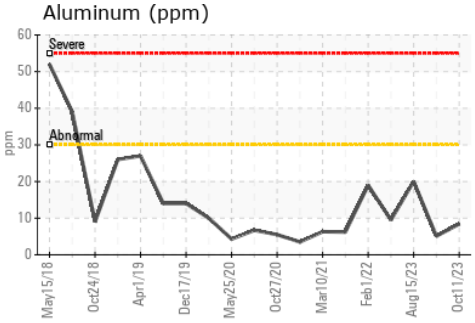

Chromium (ppm)

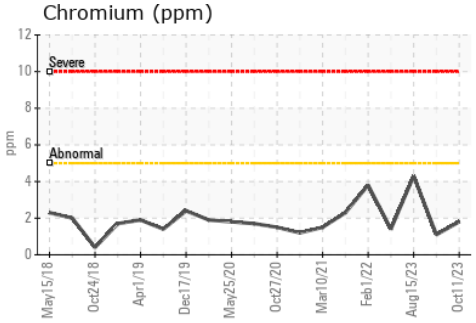

Copper (ppm)

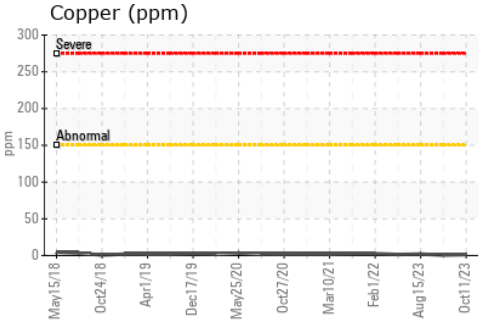

Silicon (ppm)

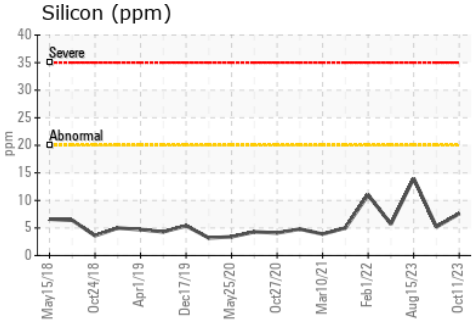

Viscosity @ 100°C

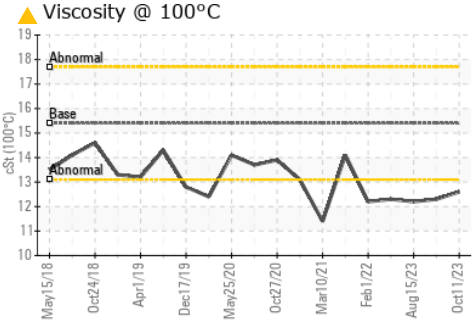

Fuel Dilution

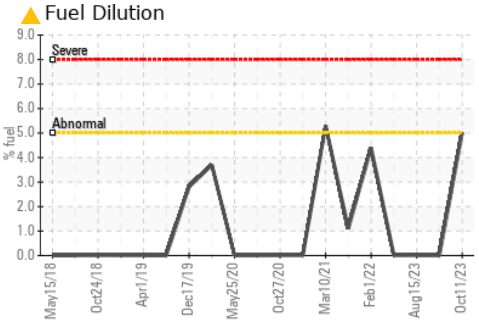

ISO 17025:2017 Accredited Laboratory

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : GFL0094201
Lab Number : 02588836
Unique Number : 5657902
Test Package : MOB 1 (Additional Tests: FuelDilution, PercentFuel)

Received : 13 Oct 2023
Diagnosed : 16 Oct 2023
Diagnostician : Wes Davis

To discuss this sample report, contact Customer Service at 1-800-268-2131.
Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
Validity of results and interpretation are based on the sample and information as supplied.

GFL Environmental - 217 - Aurora
14131 BAYVIEW AVE, AURORA YARD
AURORA, ON
CA L4G 0K6
Contact: Mike Havens
MHavens@gflenv.com
T:
F: (905)713-2445