OIL ANALYSIS REPORT

Sample Rating Trend

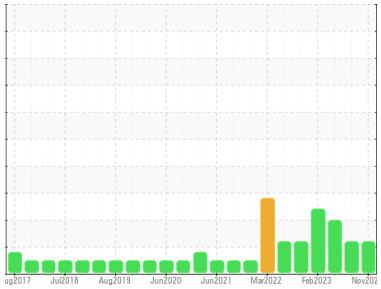

FUEL

Machine Id
8425
Component
Diesel Engine
Fluid
PETRO CANADA DURON SHP 15W40 (--- LTR)

DIAGNOSIS

Recommendation
The oil change at the time of sampling has been noted. We recommend an early resample to monitor this condition.

Wear
Metal levels are typical for a new component breaking in.

Contamination
There is a moderate amount of fuel present in the oil. Tests confirm the presence of fuel in the oil.

Fluid Condition
Fuel is present in the oil and is lowering the viscosity. The oil is no longer serviceable due to the presence of contaminants.

SAMPLE INFORMATION		method	limit/base	current	history1	history2
Sample Number		Client Info		**GFL0085661**	GFL0085690	GFL0077311
Sample Date		Client Info		**09 Nov 2023**	22 Aug 2023	26 May 2023
Machine Age	hrs	Client Info		**631**	631	631
Oil Age	hrs	Client Info		**631**	631	631
Oil Changed		Client Info		**Changed**	Changed	Changed
Sample Status				**ABNORMAL**	ABNORMAL	ABNORMAL

CONTAMINATION		method	limit/base	current	history1	history2
Glycol		WC Method		**NEG**	NEG	NEG

WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>100	**21**	28	28
Chromium	ppm	ASTM D5185(m)	>20	**<1**	<1	<1
Nickel	ppm	ASTM D5185(m)	>4	**0**	0	<1
Titanium	ppm	ASTM D5185(m)		**0**	0	<1
Silver	ppm	ASTM D5185(m)	>3	**<1**	0	0
Aluminum	ppm	ASTM D5185(m)	>20	**1**	1	2
Lead	ppm	ASTM D5185(m)	>40	**<1**	<1	<1
Copper	ppm	ASTM D5185(m)	>330	**1**	2	1
Tin	ppm	ASTM D5185(m)	>15	**0**	0	0
Antimony	ppm	ASTM D5185(m)		**0**	<1	0
Vanadium	ppm	ASTM D5185(m)		**0**	0	0
Beryllium	ppm	ASTM D5185(m)		**0**	0	0
Cadmium	ppm	ASTM D5185(m)		**0**	0	0

ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)	0	**2**	2	<1
Barium	ppm	ASTM D5185(m)	0	**<1**	0	0
Molybdenum	ppm	ASTM D5185(m)	60	**53**	53	53
Manganese	ppm	ASTM D5185(m)	0	**0**	<1	<1
Magnesium	ppm	ASTM D5185(m)	1010	**831**	872	861
Calcium	ppm	ASTM D5185(m)	1070	**901**	943	976
Phosphorus	ppm	ASTM D5185(m)	1150	**853**	957	961
Zinc	ppm	ASTM D5185(m)	1270	**1048**	1083	1071
Sulfur	ppm	ASTM D5185(m)	2060	**2129**	2212	2224
Lithium	ppm	ASTM D5185(m)		**<1**	<1	<1

CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>25	**4**	4	5
Sodium	ppm	ASTM D5185(m)		**2**	2	2
Potassium	ppm	ASTM D5185(m)	>20	**<1**	<1	<1
Fuel	%	ASTM D7593*	>5	▲ **7.9**	▲ 6.4	▲ 7.2

INFRA-RED		method	limit/base	current	history1	history2
Soot %	%	ASTM D7844*	>3	**0.3**	0.4	0.4
Nitration	Abs/cm	ASTM D7624*	>20	**11.8**	12.3	13.3
Sulfation	Abs/.1mm	ASTM D7415*	>30	**23.4**	24.8	25.1

FLUID DEGRADATION		method	limit/base	current	history1	history2
Oxidation	Abs/.1mm	ASTM D7414*	>25	**23.7**	24.3	▲ 28.2

OIL ANALYSIS REPORT

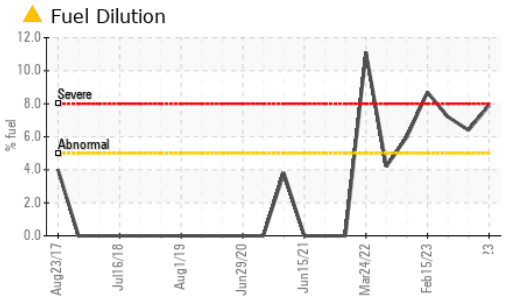

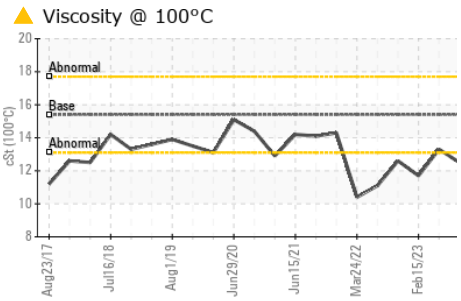

VISUAL		method	limit/base	current	history1	history2
Emulsified Water	scalar	Visual*	>0.2	**NEG**	NEG	NEG
Free Water	scalar	Visual*		**NEG**	NEG	NEG

FLUID PROPERTIES		method	limit/base	current	history1	history2
Visc @ 100°C	cSt	ASTM D7279(m)	15.4	▲ **12.2**	▲ 12.5	13.3

GRAPHS

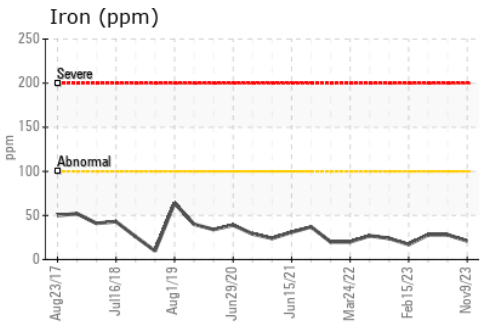

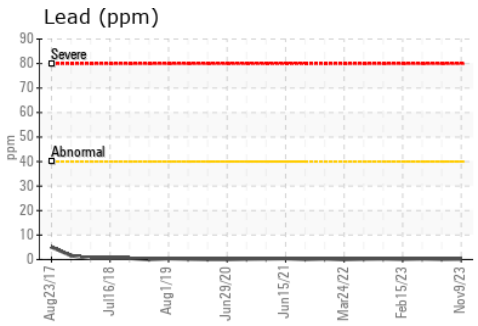

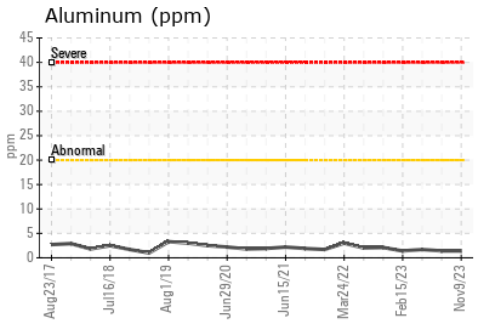

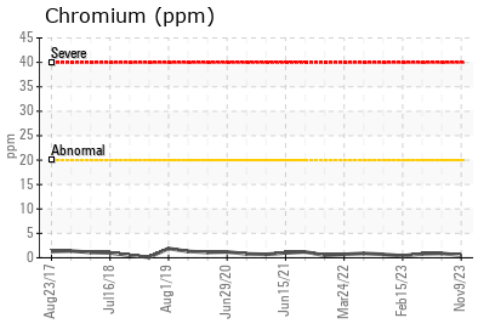

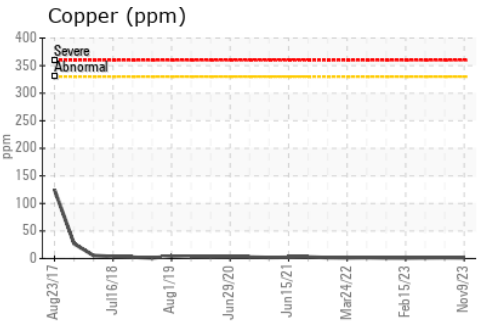

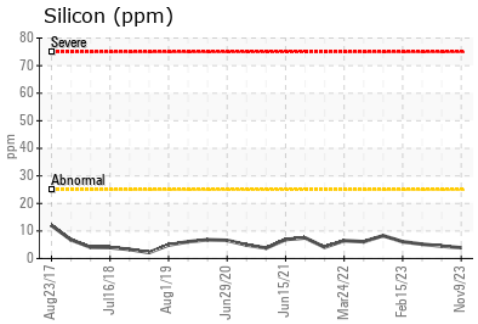

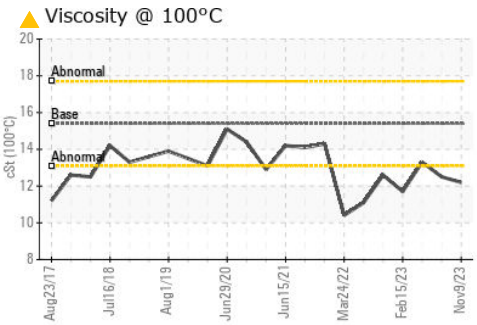

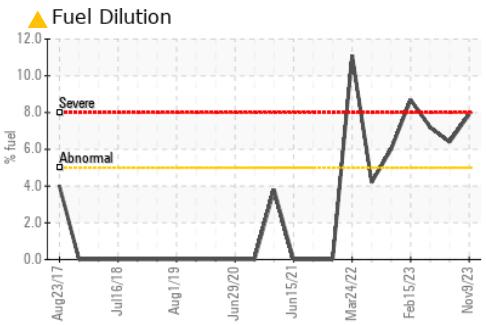

ISO 17025:2017 Accredited Laboratory

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 **GFL Environmental - 221 - Windsor**
Sample No. : GFL0085661 **Received** : 13 Nov 2023 905 Tecumseh Road W
Lab Number : 02595701 **Diagnosed** : 14 Nov 2023 Windsor, ON
Unique Number : 5672780 **Diagnostician** : Kevin Marson CA N8W 4J5
Test Package : MOB 1 (Additional Tests: PercentFuel) Contact: Rhys Marotte

To discuss this sample report, contact Customer Service at 1-800-268-2131. rmarotte@gflenv.com
Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. T:
Validity of results and interpretation are based on the sample and information as supplied. F: