OIL ANALYSIS REPORT

Sample Rating Trend

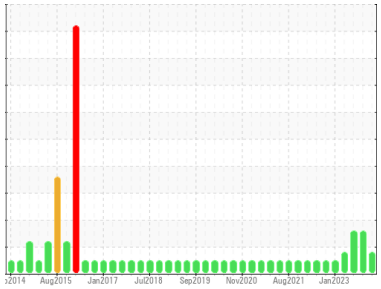

WEAR

Area
TEAM 1
Machine Id
160130 Scrubber ID Fan Inboard Bearing
Component
Inboard Bearing
Fluid
PETRO CANADA TURBOFLO R&O 150 (1 GAL)

DIAGNOSIS

Recommendation
We recommend that you drain the oil from the component if this has not already been done. We recommend an early resample to monitor this condition.

Wear
Lead ppm levels are abnormal. Bearing wear is indicated.

Contamination
There is no indication of any contamination in the oil.

Fluid Condition
The AN level is acceptable for this fluid. The oil is no longer serviceable as a result of the abnormal and/or severe wear.

SAMPLE INFORMATION		method	limit/base	current	history1	history2
Sample Number		Client Info		**PC0077089**	PC0074780	PC0074772
Sample Date		Client Info		**13 Jan 2024**	25 Oct 2023	18 Jul 2023
Machine Age	hrs	Client Info		**0**	0	0
Oil Age	hrs	Client Info		**0**	0	0
Oil Changed		Client Info		**N/A**	N/A	N/A
Sample Status				**ABNORMAL**	ABNORMAL	ABNORMAL

CONTAMINATION		method	limit/base	current	history1	history2
Water		WC Method	>2	**NEG**	NEG	NEG

WEAR METALS		method	limit/base	current	history1	history2
PQ		ASTM D8184*		**0**	0	0
Iron	ppm	ASTM D5185(m)	>20	**13**	▲ 20	▲ 20
Chromium	ppm	ASTM D5185(m)	>20	**0**	0	0
Nickel	ppm	ASTM D5185(m)	>20	**<1**	<1	<1
Titanium	ppm	ASTM D5185(m)		**0**	0	0
Silver	ppm	ASTM D5185(m)		**0**	<1	0
Aluminum	ppm	ASTM D5185(m)	>20	**<1**	0	<1
Lead	ppm	ASTM D5185(m)	>20	▲ **28**	▲ 32	▲ 22
Copper	ppm	ASTM D5185(m)	>20	**2**	3	3
Tin	ppm	ASTM D5185(m)	>20	**<1**	<1	1
Antimony	ppm	ASTM D5185(m)		**0**	0	<1
Vanadium	ppm	ASTM D5185(m)		**0**	0	0
Beryllium	ppm	ASTM D5185(m)		**0**	0	0
Cadmium	ppm	ASTM D5185(m)		**0**	0	0

ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)		**0**	<1	<1
Barium	ppm	ASTM D5185(m)		**0**	<1	0
Molybdenum	ppm	ASTM D5185(m)		**0**	0	0
Manganese	ppm	ASTM D5185(m)		**0**	0	<1
Magnesium	ppm	ASTM D5185(m)		**<1**	0	<1
Calcium	ppm	ASTM D5185(m)	0	**5**	6	6
Phosphorus	ppm	ASTM D5185(m)	4	**5**	4	6
Zinc	ppm	ASTM D5185(m)	0	**6**	6	6
Sulfur	ppm	ASTM D5185(m)		**3730**	3943	5051
Lithium	ppm	ASTM D5185(m)		**<1**	<1	<1

CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>15	**<1**	2	2
Sodium	ppm	ASTM D5185(m)		**0**	<1	<1
Potassium	ppm	ASTM D5185(m)	>20	**<1**	0	<1

FLUID DEGRADATION		method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D974*	0.18	**0.09**	---	---

OIL ANALYSIS REPORT

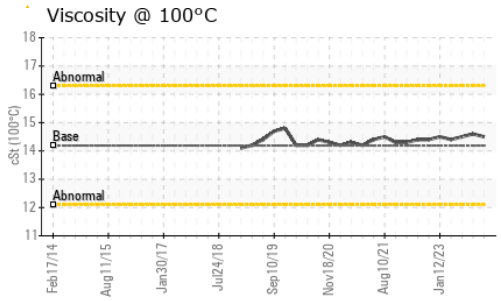

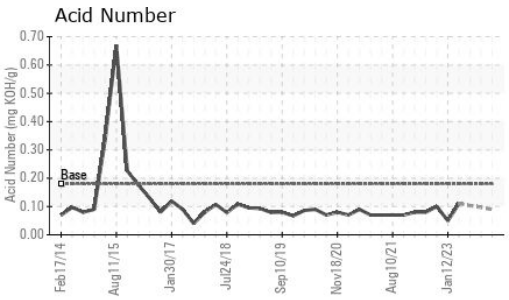

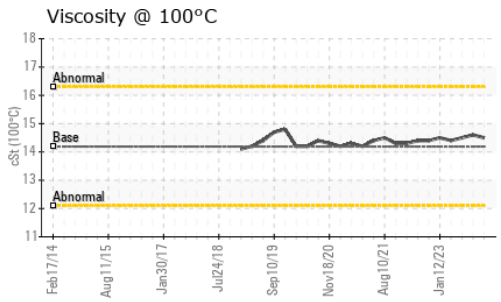

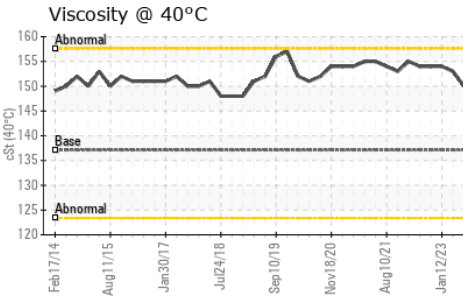

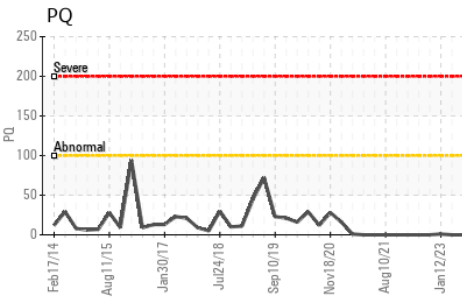

VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	**NONE**	NONE	NONE
Yellow Metal	scalar	Visual*	NONE	**NONE**	NONE	NONE
Precipitate	scalar	Visual*	NONE	**NONE**	NONE	NONE
Silt	scalar	Visual*	NONE	**NONE**	NONE	NONE
Debris	scalar	Visual*	NONE	**NONE**	NONE	VLITE
Sand/Dirt	scalar	Visual*	NONE	**NONE**	NONE	NONE
Appearance	scalar	Visual*	NORML	**NORML**	NORML	NORML
Odor	scalar	Visual*	NORML	**NORML**	NORML	NORML
Emulsified Water	scalar	Visual*	>2	**NEG**	NEG	NEG
Free Water	scalar	Visual*		**NEG**	NEG	NEG

FLUID PROPERTIES		method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D7279(m)	137.1	**149**	150	150
Visc @ 100°C	cSt	ASTM D7279(m)	14.19	**14.5**	14.6	14.5
Viscosity Index (VI)	Scale	ASTM D2270*	101	**95**	95	94

SAMPLE IMAGES	method	limit/base	current	history1	history2
Color					
Bottom					

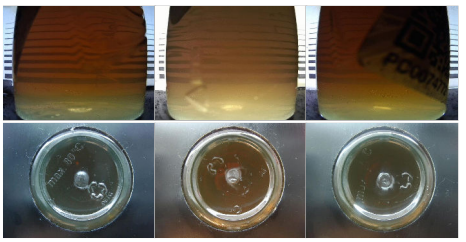

GRAPHS

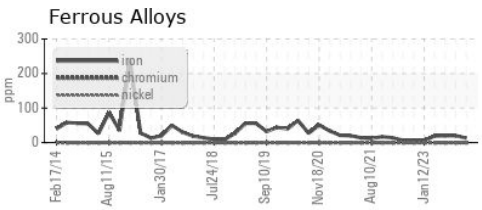

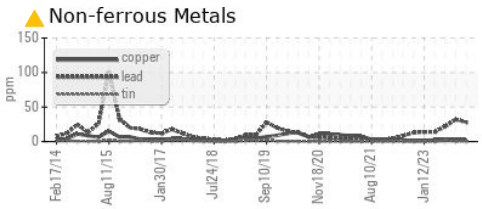

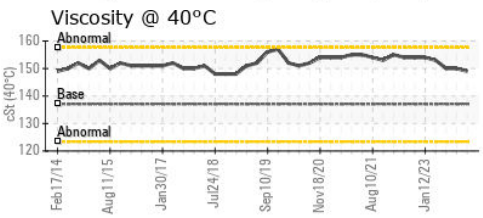

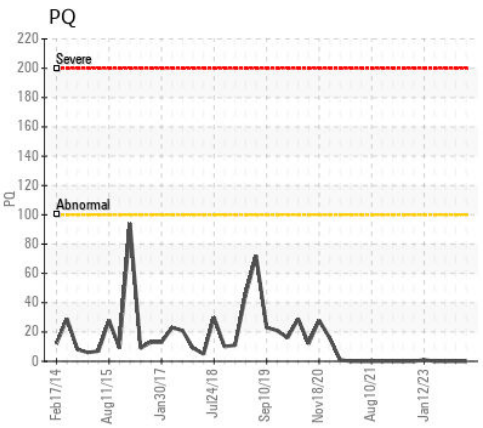

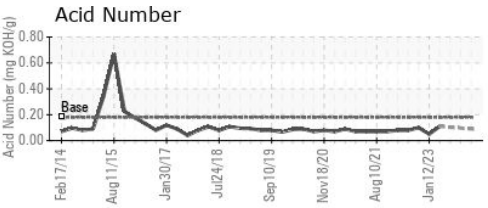

ISO 17025:2017 Accredited Laboratory

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : PC0077089 **Recieved** : 24 Jan 2024
Lab Number : 02610909 **Diagnosed** : 25 Jan 2024
Unique Number : 5720004 **Diagnostician** : Kevin Marson
Test Package : IND 2 (Additional Tests: KV100, TAN Man, VI)

To discuss this sample report, contact Customer Service at 1-800-268-2131.
Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
Validity of results and interpretation are based on the sample and information as supplied.

Dryden Fibre
Box 3001, 1 Duke Street
Dryden, ON
CA P8N 2Z7
Contact: Adebukola Adekanye
aadekanye@drydenfibre.ca
T: (807)223-9950
F: (807)223-9176