PROBLEM SUMMARY

Sample Rating Trend

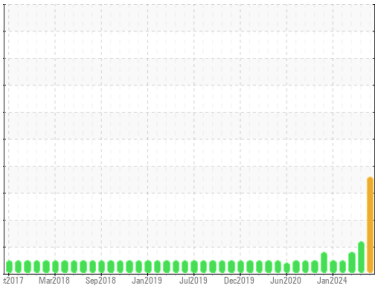

ISO

Area
Gas Compression [450296476]
Machine Id
Compressor (MP)- Lubrication System (S/N Sample Tag XX-23002-S1)
Component
Lube System
Fluid
PETRO CANADA TURBOFLO XL32 (10350 LTR)

COMPONENT CONDITION SUMMARY

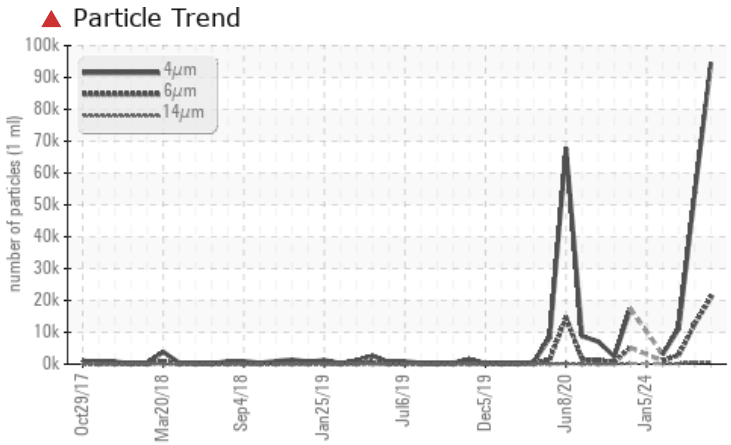

RECOMMENDATION

Check seals and/or filters for points of contaminant entry. The air breather requires service. If unrated, we recommend that you replace with a suitable micron rated and/or desiccant air breather. If rated, we recommend that you service/replace the breather. We recommend you service the filters on this component. Resample in 30-45 days to monitor this situation. Please contact your representative for information regarding the proper sampling kits for your service. NOTE: We recommend using MAR 3 test kits, this testkit includes Analytical Ferrography which provides a detailed morphological analysis of wear particles present in the fluid.

PROBLEMATIC TEST RESULTS

Sample Status				SEVERE	ABNORMAL	ATTENTION
Particles >6µm		ASTM D7647	>2500	**20907**	12630	2906
Particles >14µm		ASTM D7647	>320	**695**	521	196
Oil Cleanliness		ISO 4406 (c)	>--/18/15	**24/22/17**	23/21/16	21/19/15

Customer Id: TERHAM
Sample No.: PC0081650
Lab Number: 02631142
Test Package: MAR 2

To manage this report scan the QR code

To discuss the diagnosis or test data:
Kevin Marson +1 (289)291-4644 x4644
Kevin.Marson@wearcheck.com

To change component or sample information:
Gloria Gonzalez +1 (289)291-4643 x4643
gloria.gonzalez@wearcheck.com

RECOMMENDED ACTIONS

Action	Status	Date	Done By	Description
Change Filter	---	---	?	We recommend you service the filters on this component.
Resample	---	---	?	Resample in 30-45 days to monitor this situation.
Contact Required	---	---	?	Please contact your representative for information regarding the proper sampling kits for your service.
Alert	---	---	?	NOTE: We recommend using MAR 3 test kits,
Check Breathers	---	---	?	The air breather requires service. If unrated, we recommend that you replace with a suitable micron rated and/or desiccant air breather. If rated, we recommend that you service/replace the breather.
Check Seals	---	---	?	Check seals and/or filters for points of contaminant entry.

HISTORICAL DIAGNOSIS

ISO

01 Mar 2024 Diag: Kevin Marson

We recommend you service the filters on this component. We recommend an early resample to monitor this condition. Please contact your representative for information regarding the proper sampling kits for your service. NOTE: We recommend using MAR 3 test kits, this testkit includes Analytical Ferrography which provides a detailed morphological analysis of wear particles present in the fluid.Component wear rates appear to be normal (unconfirmed). There is a moderate amount of silt (particulates < 14 microns in size) present in the oil. The system cleanliness is above the acceptable limit for the target ISO 4406 cleanliness code. The AN level is acceptable for this fluid. The oil is still serviceable provided that the contaminant(s) can be reduced to acceptable levels.

view report

ISO

08 Feb 2024 Diag: Kevin Marson

We recommend you service the filters on this component. Resample at the next service interval to monitor.All component wear rates are normal. There is a light amount of silt (particulates < 14 microns in size) present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

view report

NORMAL

29 Jan 2024 Diag: Kevin Marson

Resample at the next service interval to monitor. Please contact your representative for information regarding the proper sampling kits for your service. NOTE: We recommend using IND 3 test kits, this testkit includes Analytical Ferrography which provides a detailed morphological analysis of wear particles present in the fluid.Component wear rates appear to be normal (unconfirmed). The system cleanliness is acceptable for your target ISO 4406 cleanliness code. The system and fluid cleanliness is acceptable. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

view report

OIL ANALYSIS REPORT

Sample Rating Trend

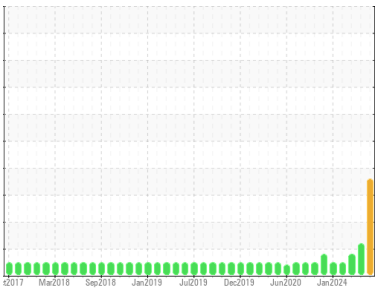

ISO

Area
Gas Compression [450296476]
Machine Id
Compressor (MP)- Lubrication System (S/N Sample Tag XX-23002-S1)
Component
Lube System
Fluid
PETRO CANADA TURBOFLO XL32 (10350 LTR)

DIAGNOSIS

Recommendation

Check seals and/or filters for points of contaminant entry. The air breather requires service. If unrated, we recommend that you replace with a suitable micron rated and/or desiccant air breather. If rated, we recommend that you service/replace the breather. We recommend you service the filters on this component. Resample in 30-45 days to monitor this situation. Please contact your representative for information regarding the proper sampling kits for your service. NOTE: We recommend using MAR 3 test kits, this testkit includes Analytical Ferrography which provides a detailed morphological analysis of wear particles present in the fluid.

Wear

Component wear rates appear to be normal (unconfirmed).

Contamination

There is a high amount of silt (particulates < 14 microns in size) present in the oil. The system cleanliness code is much higher than the acceptable limit for the target ISO 4406 cleanliness code.

Fluid Condition

The AN level is acceptable for this fluid. The oil is still serviceable provided that the contaminant(s) can be reduced to acceptable levels.

SAMPLE INFORMATION		method	limit/base	current	history1	history2
Sample Number		Client Info		**PC0081650**	PC0082746	PC
Sample Date		Client Info		**29 Mar 2024**	01 Mar 2024	08 Feb 2024
Machine Age	hrs	Client Info		**0**	0	0
Oil Age	hrs	Client Info		**0**	0	0
Oil Changed		Client Info		**N/A**	N/A	N/A
Sample Status				**SEVERE**	ABNORMAL	ATTENTION

CONTAMINATION		method	limit/base	current	history1	history2
Water		WC Method	>0.05	**NEG**	NEG	NEG

WEAR METALS		method	limit/base	current	history1	history2
PQ		ASTM D8184*		**0**	0	0
Iron	ppm	ASTM D5185(m)	>20	**<1**	<1	0
Chromium	ppm	ASTM D5185(m)	>10	**0**	0	0
Nickel	ppm	ASTM D5185(m)	>10	**0**	<1	0
Titanium	ppm	ASTM D5185(m)		**0**	0	0
Silver	ppm	ASTM D5185(m)		**0**	0	0
Aluminum	ppm	ASTM D5185(m)	>10	**0**	<1	<1
Lead	ppm	ASTM D5185(m)	>20	**0**	0	0
Copper	ppm	ASTM D5185(m)	>20	**<1**	<1	<1
Tin	ppm	ASTM D5185(m)	>10	**0**	0	0
Antimony	ppm	ASTM D5185(m)		**0**	0	0
Vanadium	ppm	ASTM D5185(m)		**0**	0	0
Beryllium	ppm	ASTM D5185(m)		**0**	0	0
Cadmium	ppm	ASTM D5185(m)		**0**	0	0

ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)	0	**<1**	0	<1
Barium	ppm	ASTM D5185(m)	0	**0**	0	0
Molybdenum	ppm	ASTM D5185(m)	0	**0**	0	0
Manganese	ppm	ASTM D5185(m)	0	**0**	0	0
Magnesium	ppm	ASTM D5185(m)	0	**<1**	<1	<1
Calcium	ppm	ASTM D5185(m)	0	**0**	<1	<1
Phosphorus	ppm	ASTM D5185(m)	5	**67**	69	70
Zinc	ppm	ASTM D5185(m)	0	**1**	1	1
Sulfur	ppm	ASTM D5185(m)	750	**493**	500	552
Lithium	ppm	ASTM D5185(m)		**<1**	<1	<1

CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>15	**<1**	2	2
Sodium	ppm	ASTM D5185(m)		**<1**	0	0
Potassium	ppm	ASTM D5185(m)	>20	**<1**	<1	<1

OIL ANALYSIS REPORT

Particle Count

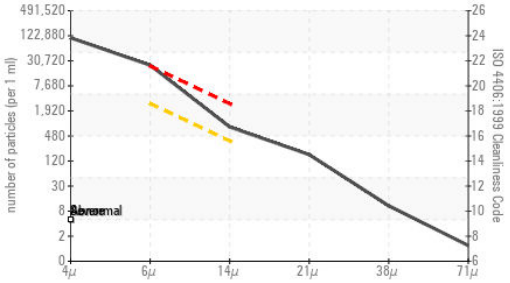

Particle Trend

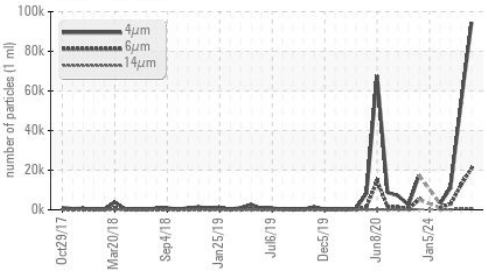

Acid Number

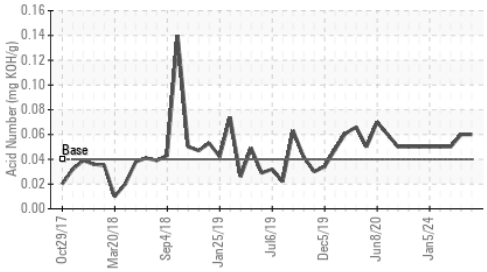

Viscosity @ 100°C

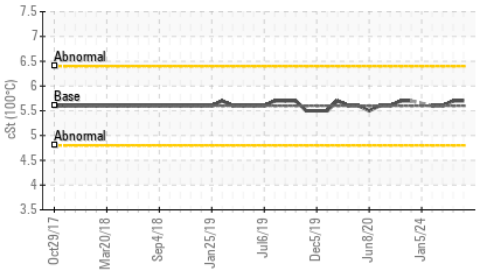

Viscosity @ 40°C

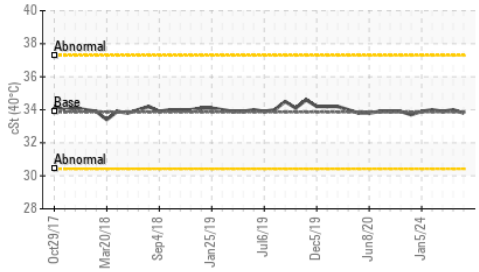

FLUID CLEANLINESS	method	limit/base	current	history1	history2
Particles >4µm	ASTM D7647		**94594**	53985	11069
Particles >6µm	ASTM D7647	>2500	▲ **20907**	▲ 12630	● 2906
Particles >14µm	ASTM D7647	>320	▲ **695**	● 521	196
Particles >21µm	ASTM D7647	>80	● **151**	103	57
Particles >38µm	ASTM D7647	>20	**9**	6	4
Particles >71µm	ASTM D7647	>4	**1**	1	0
Oil Cleanliness	ISO 4406 (c)	>--/18/15	▲ **24/22/17**	▲ 23/21/16	● 21/19/15

FLUID DEGRADATION		method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D974*	0.04	**0.06**	0.06	0.05

VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	**NONE**	NONE	NONE
Yellow Metal	scalar	Visual*	NONE	**NONE**	NONE	NONE
Precipitate	scalar	Visual*	NONE	**NONE**	NONE	NONE
Silt	scalar	Visual*	NONE	**NONE**	NONE	NONE
Debris	scalar	Visual*	NONE	**NONE**	NONE	VLITE
Sand/Dirt	scalar	Visual*	NONE	**NONE**	NONE	NONE
Appearance	scalar	Visual*	NORML	**NORML**	NORML	NORML
Odor	scalar	Visual*	NORML	**NORML**	NORML	NORML
Emulsified Water	scalar	Visual*	>0.05	**NEG**	NEG	NEG
Free Water	scalar	Visual*		**NEG**	NEG	NEG

FLUID PROPERTIES		method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D7279(m)	33.86	**33.8**	34.0	33.9
Visc @ 100°C	cSt	ASTM D7279(m)	5.60	**5.7**	5.7	5.6
Viscosity Index (VI)	Scale	ASTM D2270*	101	**108**	107	102

SAMPLE IMAGES	method	limit/base	current	history1	history2
Color			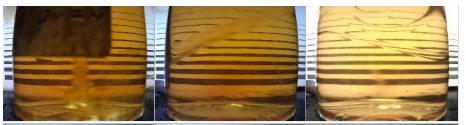		
Bottom					

ISO 17025:2017 Accredited Laboratory

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : PC0081650 **Received** : 24 Apr 2024
Lab Number : 02631142 **Tested** : 24 Apr 2024
Unique Number : 5772295 **Diagnosed** : 24 Apr 2024 - Kevin Marson
Test Package : MAR 2 (Additional Tests: KV100, PQ, TAN Man, VI)

To discuss this sample report, contact Customer Service at 1-800-268-2131.
Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
Validity of results and interpretation are based on the sample and information as supplied.

Suncor - Terra Nova Projects
Scotia Centre, 235 Water Strret
St. John`s, NL
CA A1C 1B6
Contact: Josh Hynes
joshynes@suncor.com
T: (709)778-3575
F: (709)724-2835