OIL ANALYSIS REPORT

Sample Rating Trend

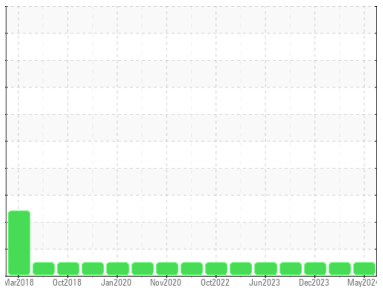

NORMAL

Machine Id
801035
Component
Diesel Engine
Fluid
PETRO CANADA DURON SHP 15W40 (22 LTR)

DIAGNOSIS

Recommendation
Resample at the next service interval to monitor.

Wear
Metal levels are typical for a new component breaking in.

Contamination
There is no indication of any contamination in the oil.

Fluid Condition
The condition of the oil is acceptable for the time in service.

SAMPLE INFORMATION		method	limit/base	current	history1	history2
Sample Number		Client Info		**GFL0122309**	GFL0107131	GFL0091071
Sample Date		Client Info		**15 May 2024**	24 Apr 2024	01 Dec 2023
Machine Age	kms	Client Info		**86836**	11952	11411
Oil Age	kms	Client Info		**600**	600	365
Oil Changed		Client Info		**Changed**	Changed	N/A
Sample Status				**NORMAL**	NORMAL	NORMAL

CONTAMINATION		method	limit/base	current	history1	history2
Fuel		WC Method	>5	**<1.0**	<1.0	<1.0
Water		WC Method	>0.2	**NEG**	NEG	NEG
Glycol		WC Method		**NEG**	NEG	NEG

WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>80	**8**	27	14
Chromium	ppm	ASTM D5185(m)	>5	**0**	<1	<1
Nickel	ppm	ASTM D5185(m)	>2	**0**	<1	<1
Titanium	ppm	ASTM D5185(m)		**0**	0	0
Silver	ppm	ASTM D5185(m)	>3	**0**	0	<1
Aluminum	ppm	ASTM D5185(m)	>30	**1**	4	2
Lead	ppm	ASTM D5185(m)	>30	**0**	0	<1
Copper	ppm	ASTM D5185(m)	>150	**<1**	1	<1
Tin	ppm	ASTM D5185(m)	>5	**0**	0	0
Antimony	ppm	ASTM D5185(m)		**0**	0	0
Vanadium	ppm	ASTM D5185(m)		**0**	0	0
Beryllium	ppm	ASTM D5185(m)		**0**	0	0
Cadmium	ppm	ASTM D5185(m)		**0**	0	0

ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)	0	**7**	10	3
Barium	ppm	ASTM D5185(m)	0	**0**	0	<1
Molybdenum	ppm	ASTM D5185(m)	60	**57**	62	58
Manganese	ppm	ASTM D5185(m)	0	**0**	<1	0
Magnesium	ppm	ASTM D5185(m)	1010	**921**	967	936
Calcium	ppm	ASTM D5185(m)	1070	**1005**	1093	1022
Phosphorus	ppm	ASTM D5185(m)	1150	**986**	1014	951
Zinc	ppm	ASTM D5185(m)	1270	**1152**	1229	1178
Sulfur	ppm	ASTM D5185(m)	2060	**2448**	2350	2343
Lithium	ppm	ASTM D5185(m)		**<1**	<1	<1

CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>20	**2**	5	5
Sodium	ppm	ASTM D5185(m)		**5**	9	7
Potassium	ppm	ASTM D5185(m)	>20	**3**	2	2

INFRA-RED		method	limit/base	current	history1	history2
Soot %	%	ASTM D7844*	>3	**0.1**	0.6	0.4
Nitration	Abs/cm	ASTM D7624*	>20	**7.2**	11.6	9.9
Sulfation	Abs/.1mm	ASTM D7415*	>30	**19.6**	24.6	21.0

OIL ANALYSIS REPORT

FT-IR (Direct Trend)

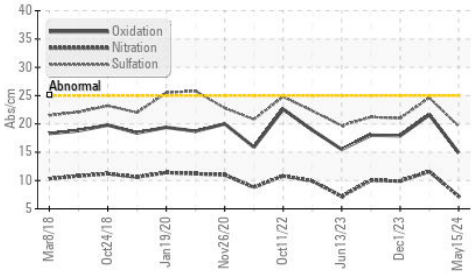

Viscosity @ 100°C

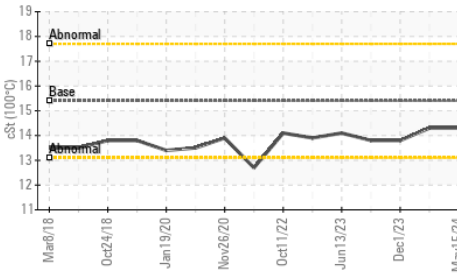

FLUID DEGRADATION		method	limit/base	current	history1	history2
Oxidation	Abs/.1mm	ASTM D7414*	>25	**14.9**	21.6	17.9

VISUAL		method	limit/base	current	history1	history2
Emulsified Water	scalar	Visual*	>0.2	**NEG**	NEG	NEG
Free Water	scalar	Visual*		**NEG**	NEG	NEG

FLUID PROPERTIES		method	limit/base	current	history1	history2
Visc @ 100°C	cSt	ASTM D7279(m)	15.4	**14.3**	14.3	13.8

GRAPHS

Iron (ppm)

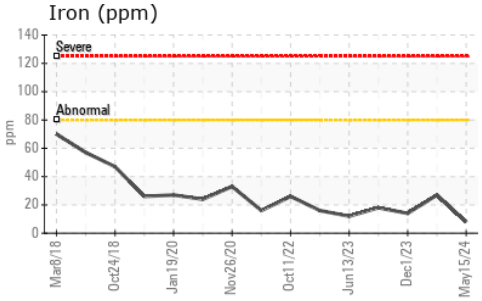

Lead (ppm)

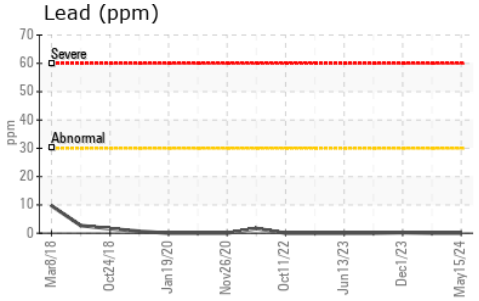

Aluminum (ppm)

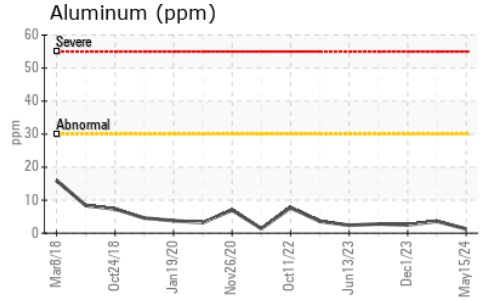

Chromium (ppm)

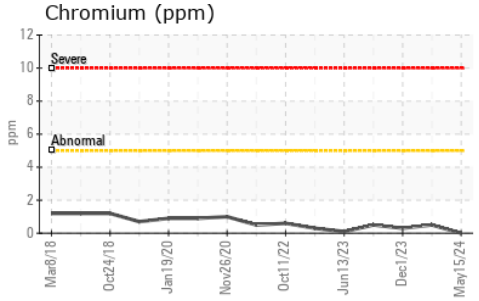

Copper (ppm)

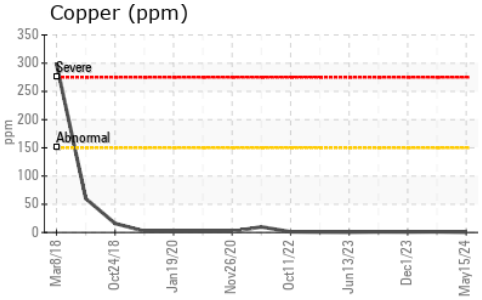

Silicon (ppm)

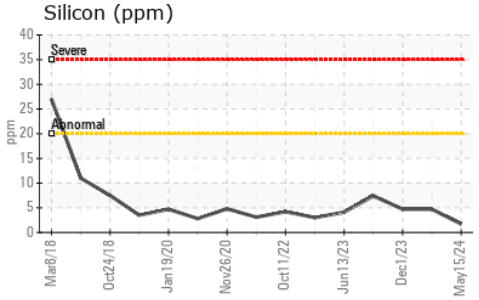

Viscosity @ 100°C

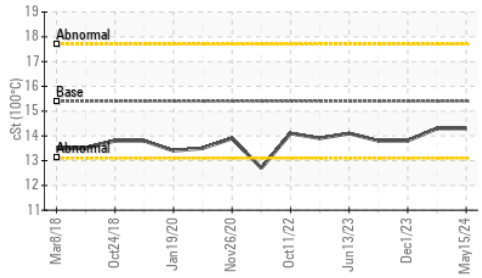

Soot %

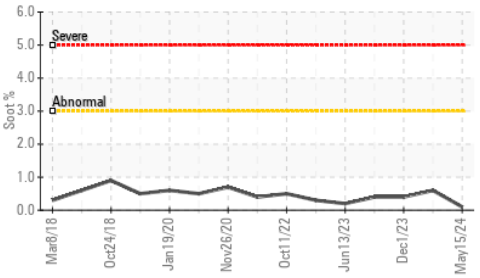

ISO 17025:2017 Accredited Laboratory

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : GFL0122309
Lab Number : 02636253
Unique Number : 5785415
Test Package : MOB 1

Received : 17 May 2024
Tested : 17 May 2024
Diagnosed : 17 May 2024 - Wes Davis

To discuss this sample report, contact Customer Service at 1-800-268-2131.
Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
Validity of results and interpretation are based on the sample and information as supplied.

GFL Environmental - 217 - Aurora
14131 BAYVIEW AVE, AURORA YARD
AURORA, ON
CA L4G 0K6
Contact: Mike Havens
MHavens@gflenv.com
T:
F: (905)713-2445

Report Id: GFL217 [WCAMIS] 02636253 (Generated: 05/17/2024 12:53:49) Rev: 1

Submitted By: Scott Ewan