# PROBLEM SUMMARY

**Sample Rating Trend**

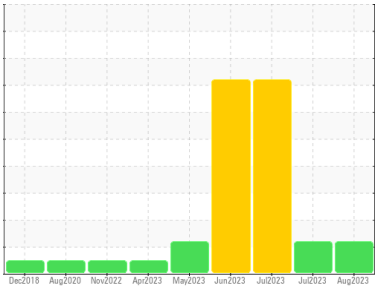


**GLYCOL**

Machine Id
**727103-361675**
Component
**Diesel Engine**
Fluid
**PETRO CANADA DURON SHP 15W40 (--- GAL)**

## COMPONENT CONDITION SUMMARY

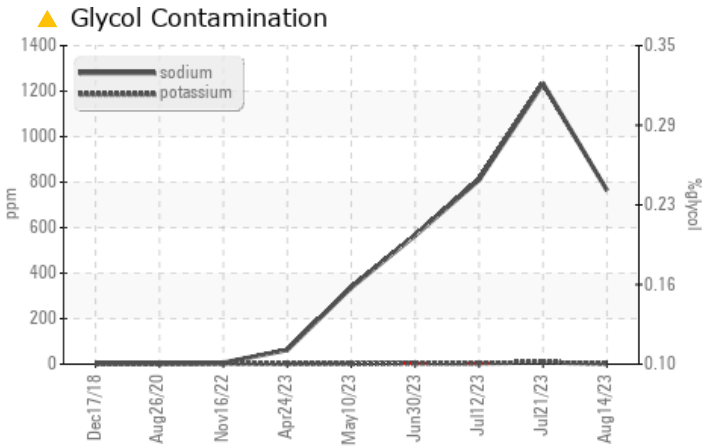


## RECOMMENDATION

We advise that you check for the source of the coolant leak. Check for low coolant level. We recommend an early resample to monitor this condition.

## PROBLEMATIC TEST RESULTS

| Sample Status | | | | ATTENTION | ABNORMAL | SEVERE |
|---|---|---|---|---|---|---|
| Sodium | ppm | ASTM D5185m | | ▲ **764** | ▲ 1233 | ▲ 810 |

**Customer Id:** GFL820
**Sample No.:** GFL0067684
**Lab Number:** 05929283
**Test Package:** FLEET

*To manage this report scan the QR code*

*To discuss the diagnosis or test data:*
Angela Borella +1 800-237-1369
angela.borella@wearcheckusa.com

*To change component or sample information:*
Customer Service +1 1-800-237-1369
customerservice@wearcheck.com

## RECOMMENDED ACTIONS

| Action | Status | Date | Done By | Description |
|---|---|---|---|---|
| Resample | --- | --- | ? | We recommend an early resample to monitor this condition. |
| Check Glycol Access | --- | --- | ? | We advise that you check for the source of the coolant leak. |

## HISTORICAL DIAGNOSIS

**21 Jul 2023 Diag: Jonathan Hester**

GLYCOL

We advise that you check for the source of the coolant leak. Check for low coolant level. We recommend an early resample to monitor this condition.All component wear rates are normal. Sodium and/or potassium levels are high. The BN result indicates that there is suitable alkalinity remaining in the oil.

view report

**12 Jul 2023 Diag: Wes Davis**

GLYCOL

We advise that you check for the source of the coolant leak. We recommend that you drain the oil from the component if this has not already been done. We advise that you flush the component thoroughly before re-filling with oil. We recommend an early resample to monitor this condition.All component wear rates are normal. Test for glycol is positive. There is a high concentration of glycol present in the oil. The BN result indicates that there is suitable alkalinity remaining in the oil. The oil is no longer serviceable due to the presence of contaminants.

view report

**30 Jun 2023 Diag: Doug Bogart**

GLYCOL

We advise that you check for possible coolant leak. We recommend an early resample to monitor this condition.All component wear rates are normal. Sodium and/or potassium levels are high. Test for glycol is positive. The BN result indicates that there is suitable alkalinity remaining in the oil.

view report

# OIL ANALYSIS REPORT

Sample Rating Trend

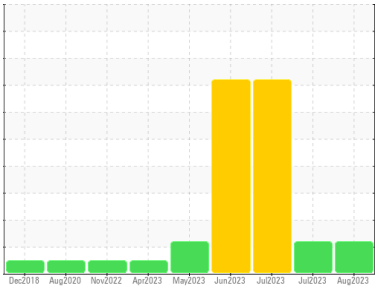


**GLYCOL**

Machine Id
**727103-361675**
Component
**Diesel Engine**
Fluid
**PETRO CANADA DURON SHP 15W40 (--- GAL)**

## DIAGNOSIS

**Recommendation**
We advise that you check for the source of the coolant leak. Check for low coolant level. We recommend an early resample to monitor this condition.

**Wear**
All component wear rates are normal.

**Contamination**
Sodium and/or potassium levels are high.

**Fluid Condition**
The BN result indicates that there is suitable alkalinity remaining in the oil.

| SAMPLE INFORMATION | | method | limit/base | current | history1 | history2 |
|---|---|---|---|---|---|---|
| Sample Number | | Client Info | | **GFL0067684** | GFL0088169 | GFL0067727 |
| Sample Date | | Client Info | | **14 Aug 2023** | 21 Jul 2023 | 12 Jul 2023 |
| Machine Age | hrs | Client Info | | **0** | 0 | 0 |
| Oil Age | hrs | Client Info | | **0** | 0 | 0 |
| Oil Changed | | Client Info | | **N/A** | N/A | N/A |
| Sample Status | | | | **ATTENTION** | ABNORMAL | SEVERE |

| CONTAMINATION | | method | limit/base | current | history1 | history2 |
|---|---|---|---|---|---|---|
| Fuel | | WC Method | >5 | **<1.0** | <1.0 | <1.0 |

| WEAR METALS | | method | limit/base | current | history1 | history2 |
|---|---|---|---|---|---|---|
| Iron | ppm | ASTM D5185m | >100 | **21** | 29 | 17 |
| Chromium | ppm | ASTM D5185m | >20 | **2** | 2 | 1 |
| Nickel | ppm | ASTM D5185m | >4 | **0** | <1 | 0 |
| Titanium | ppm | ASTM D5185m | | **<1** | <1 | <1 |
| Silver | ppm | ASTM D5185m | >3 | **0** | <1 | 0 |
| Aluminum | ppm | ASTM D5185m | >20 | **7** | 6 | 4 |
| Lead | ppm | ASTM D5185m | >40 | **0** | 1 | <1 |
| Copper | ppm | ASTM D5185m | >330 | **0** | 2 | 1 |
| Tin | ppm | ASTM D5185m | >15 | **0** | <1 | 0 |
| Vanadium | ppm | ASTM D5185m | | **0** | <1 | <1 |
| Cadmium | ppm | ASTM D5185m | | **0** | 0 | 0 |

| ADDITIVES | | method | limit/base | current | history1 | history2 |
|---|---|---|---|---|---|---|
| Boron | ppm | ASTM D5185m | 0 | **4** | 5 | 0 |
| Barium | ppm | ASTM D5185m | 0 | **0** | 0 | 0 |
| Molybdenum | ppm | ASTM D5185m | 60 | **173** | 207 | 161 |
| Manganese | ppm | ASTM D5185m | 0 | **0** | <1 | <1 |
| Magnesium | ppm | ASTM D5185m | 1010 | **1178** | 961 | 1004 |
| Calcium | ppm | ASTM D5185m | 1070 | **1294** | 1103 | 1104 |
| Phosphorus | ppm | ASTM D5185m | 1150 | **1263** | 932 | 1067 |
| Zinc | ppm | ASTM D5185m | 1270 | **1678** | 1246 | 1278 |
| Sulfur | ppm | ASTM D5185m | 2060 | **5060** | 3565 | 3668 |

| CONTAMINANTS | | method | limit/base | current | history1 | history2 |
|---|---|---|---|---|---|---|
| Silicon | ppm | ASTM D5185m | >25 | **9** | 11 | 7 |
| Sodium | ppm | ASTM D5185m | | ▲ **764** | ▲ 1233 | ▲ 810 |
| Potassium | ppm | ASTM D5185m | >20 | **1** | 9 | 4 |
| Glycol | % | *ASTM D2982 | | **NEG** | NEG | ⬢ 0.10 |

| INFRA-RED | | method | limit/base | current | history1 | history2 |
|---|---|---|---|---|---|---|
| Soot % | % | *ASTM D7844 | >3 | **0.5** | 0.5 | 0.3 |
| Nitration | Abs/cm | *ASTM D7624 | >20 | **9.9** | 11.5 | 10.7 |
| Sulfation | Abs/.1mm | *ASTM D7415 | >30 | **21.2** | 22.2 | 20.3 |

| FLUID DEGRADATION | | method | limit/base | current | history1 | history2 |
|---|---|---|---|---|---|---|
| Oxidation | Abs/.1mm | *ASTM D7414 | >25 | **16.5** | 18.8 | 16.5 |
| Base Number (BN) | mg KOH/g | ASTM D2896 | 9.8 | **9.8** | 9.0 | 9.9 |

# OIL ANALYSIS REPORT

Glycol Contamination

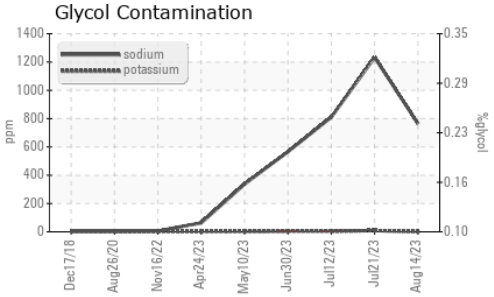


Viscosity @ 100°C

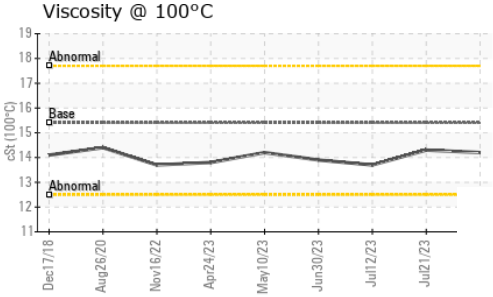


Glycol Contamination

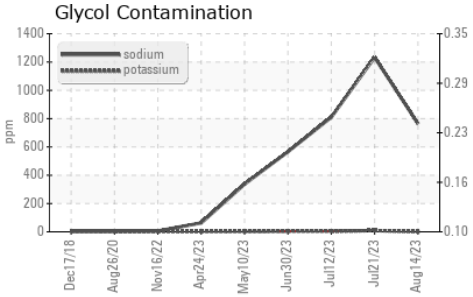


| VISUAL | | method | limit/base | current | history1 | history2 |
|---|---|---|---|---|---|---|
| White Metal | scalar | *Visual | NONE | **NONE** | NONE | NONE |
| Yellow Metal | scalar | *Visual | NONE | **NONE** | NONE | NONE |
| Precipitate | scalar | *Visual | NONE | **NONE** | NONE | NONE |
| Silt | scalar | *Visual | NONE | **NONE** | NONE | NONE |
| Debris | scalar | *Visual | NONE | **NONE** | NONE | NONE |
| Sand/Dirt | scalar | *Visual | NONE | **NONE** | NONE | NONE |
| Appearance | scalar | *Visual | NORML | **NORML** | NORML | NORML |
| Odor | scalar | *Visual | NORML | **NORML** | NORML | NORML |
| Emulsified Water | scalar | *Visual | >0.2 | **NEG** | NEG | NEG |
| Free Water | scalar | *Visual | | **NEG** | NEG | NEG |

| FLUID PROPERTIES | | method | limit/base | current | history1 | history2 |
|---|---|---|---|---|---|---|
| Visc @ 100°C | cSt | ASTM D445 | 15.4 | **14.2** | 14.3 | 13.7 |

## GRAPHS

Ferrous Alloys

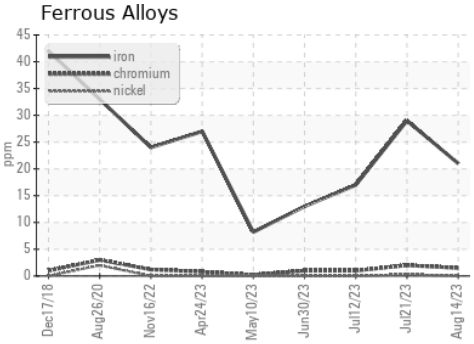


Non-ferrous Metals

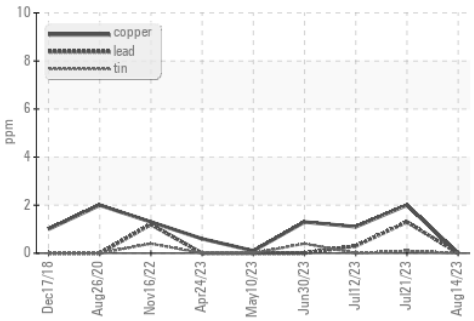


Viscosity @ 100°C

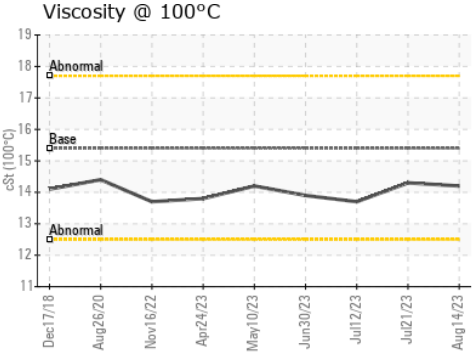


Base Number

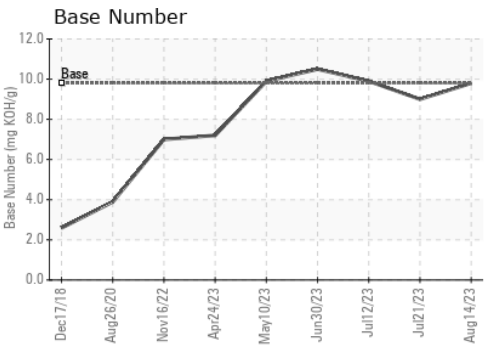


Certificate L2367

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513
**Sample No.** : GFL0067684 **Received** : 21 Aug 2023
**Lab Number** : 05929283 **Diagnosed** : 22 Aug 2023
**Unique Number** : 10609230 **Diagnostician** : Angela Borella
**Test Package** : FLEET ( Additional Tests: Glycol )

*To discuss this sample report, contact Customer Service at 1-800-237-1369.*
** - Denotes test methods that are outside of the ISO 17025 scope of accreditation.*
*Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)*


**GFL Environmental - 820 - Joplin Hauling**
3700 West 7th Street
Joplin, MO
US 64801
Contact: James Jarrett
jjarrett@gflenv.com
T: (417)310-2802
F: