PROBLEM SUMMARY

Sample Rating Trend

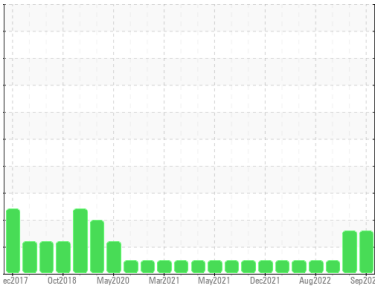

DIRT

Machine Id
2697
Component
Diesel Engine
Fluid
PETRO CANADA DURON SHP 15W40 (10 GAL)

COMPONENT CONDITION SUMMARY

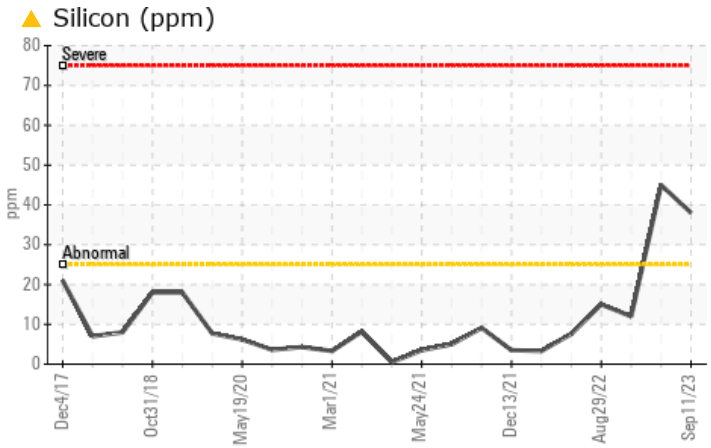

RECOMMENDATION

No corrective action is recommended at this time.
Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS

Sample Status				**ABNORMAL**	ABNORMAL	NORMAL
Silicon	ppm	ASTM D5185m	>25	▲ **38**	▲ 45	12

Customer Id: GFL112
Sample No.: GFL0092333
Lab Number: 05947718
Test Package: FLEET

To manage this report scan the QR code

To discuss the diagnosis or test data:
Jonathan Hester +1 919-379-4092 x4092
jhester@wearcheckusa.com

To change component or sample information:
Customer Service +1 1-800-237-1369
customerservice@wearcheck.com

RECOMMENDED ACTIONS

There are no recommended actions for this sample.

HISTORICAL DIAGNOSIS

08 Jun 2023 Diag: Don Baldridge

DIRT

Oil and filter change at the time of sampling has been noted. No corrective action is recommended at this time. Resample at the next service interval to monitor.All component wear rates are normal. Elemental level of silicon (Si) above normal. The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is acceptable for the time in service.

view report

30 Nov 2022 Diag: Wes Davis

NORMAL

Resample at the next service interval to monitor.All component wear rates are normal. There is no indication of any contamination in the oil. The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

view report

29 Aug 2022 Diag: Doug Bogart

NORMAL

Resample at the next service interval to monitor.All component wear rates are normal. There is no indication of any contamination in the oil. The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

view report

OIL ANALYSIS REPORT

Sample Rating Trend

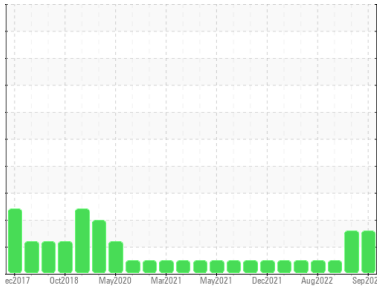

DIRT

Machine Id
2697
Component
Diesel Engine
Fluid
PETRO CANADA DURON SHP 15W40 (10 GAL)

DIAGNOSIS

Recommendation
No corrective action is recommended at this time. Resample at the next service interval to monitor.

Wear
All component wear rates are normal.

Contamination
Elemental level of silicon (Si) above normal indicating ingress of seal material.

Fluid Condition
The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

SAMPLE INFORMATION		method	limit/base	current	history1	history2
Sample Number		Client Info		**GFL0092333**	GFL0078212	GFL0060011
Sample Date		Client Info		**11 Sep 2023**	08 Jun 2023	30 Nov 2022
Machine Age	hrs	Client Info		**0**	19912	0
Oil Age	hrs	Client Info		**0**	21575	0
Oil Changed		Client Info		**N/A**	Changed	N/A
Sample Status				**ABNORMAL**	ABNORMAL	NORMAL

CONTAMINATION		method	limit/base	current	history1	history2
Fuel		WC Method	>3.0	**<1.0**	<1.0	<1.0
Glycol		WC Method		**NEG**	NEG	NEG

WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>120	**22**	13	10
Chromium	ppm	ASTM D5185m	>20	**1**	<1	<1
Nickel	ppm	ASTM D5185m	>5	**0**	<1	<1
Titanium	ppm	ASTM D5185m	>2	**<1**	<1	<1
Silver	ppm	ASTM D5185m	>2	**0**	0	0
Aluminum	ppm	ASTM D5185m	>20	**7**	<1	3
Lead	ppm	ASTM D5185m	>40	**<1**	<1	1
Copper	ppm	ASTM D5185m	>330	**<1**	1	<1
Tin	ppm	ASTM D5185m	>15	**<1**	<1	<1
Vanadium	ppm	ASTM D5185m		**0**	0	0
Cadmium	ppm	ASTM D5185m		**0**	0	0

ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	0	**7**	11	6
Barium	ppm	ASTM D5185m	0	**0**	0	0
Molybdenum	ppm	ASTM D5185m	60	**63**	88	62
Manganese	ppm	ASTM D5185m	0	**<1**	<1	<1
Magnesium	ppm	ASTM D5185m	1010	**974**	1342	1001
Calcium	ppm	ASTM D5185m	1070	**1246**	1634	1190
Phosphorus	ppm	ASTM D5185m	1150	**1050**	1420	1043
Zinc	ppm	ASTM D5185m	1270	**1302**	1800	1322
Sulfur	ppm	ASTM D5185m	2060	**3584**	4302	3225

CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	▲ **38**	▲ 45	12
Sodium	ppm	ASTM D5185m		**4**	3	3
Potassium	ppm	ASTM D5185m	>20	**4**	2	2

INFRA-RED		method	limit/base	current	history1	history2
Soot %	%	*ASTM D7844	>4	**0.1**	0.1	0.1
Nitration	Abs/cm	*ASTM D7624	>20	**7.6**	8.4	8.5
Sulfation	Abs/.1mm	*ASTM D7415	>30	**19.6**	20.9	21.4

FLUID DEGRADATION		method	limit/base	current	history1	history2
Oxidation	Abs/.1mm	*ASTM D7414	>25	**15.4**	17.2	17.0
Base Number (BN)	mg KOH/g	ASTM D2896	9.8	**8.5**	8.2	9.5

OIL ANALYSIS REPORT

Silicon (ppm)

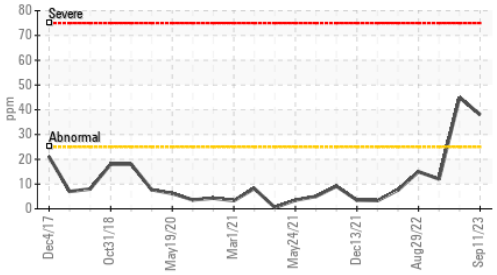

Base Number

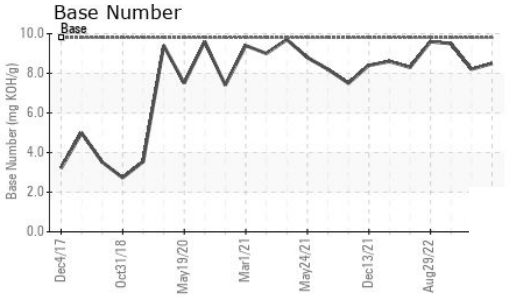

Viscosity @ 100°C

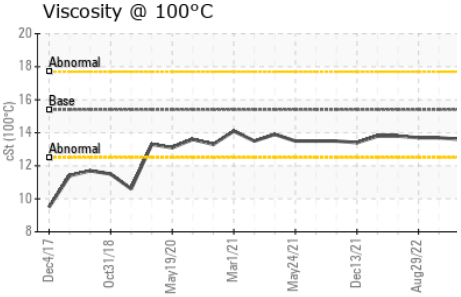

VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	**NONE**	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	**NONE**	NONE	NONE
Precipitate	scalar	*Visual	NONE	**NONE**	NONE	NONE
Silt	scalar	*Visual	NONE	**NONE**	NONE	NONE
Debris	scalar	*Visual	NONE	**NONE**	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	**NONE**	NONE	NONE
Appearance	scalar	*Visual	NORML	**NORML**	NORML	NORML
Odor	scalar	*Visual	NORML	**NORML**	NORML	NORML
Emulsified Water	scalar	*Visual	>0.2	**NEG**	NEG	NEG
Free Water	scalar	*Visual		**NEG**	NEG	NEG

FLUID PROPERTIES		method	limit/base	current	history1	history2
Visc @ 100°C	cSt	ASTM D445	15.4	**13.8**	13.6	13.7

GRAPHS

Ferrous Alloys

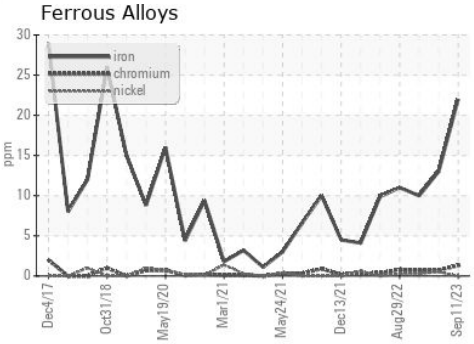

Non-ferrous Metals

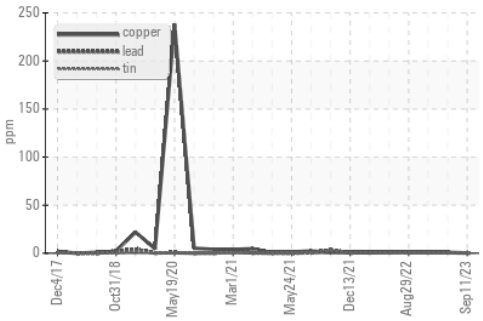

Viscosity @ 100°C

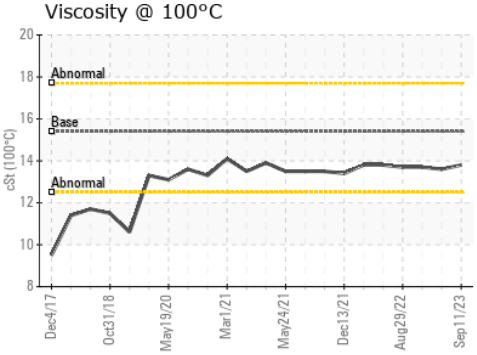

Base Number

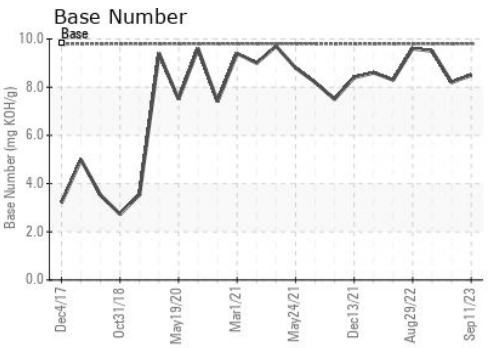

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : GFL0092333
Lab Number : 05947718
Unique Number : 10643677
Test Package : FLEET

Received : 12 Sep 2023
Diagnosed : 14 Sep 2023
Diagnostician : Jonathan Hester

To discuss this sample report, contact Customer Service at 1-800-237-1369.
** - Denotes test methods that are outside of the ISO 17025 scope of accreditation.*
Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

GFL Environmental - 112 - New Bern
705 Airport Road
New Bern, NC
US 28560
Contact: Marquis Williams
marquis.williams@gflenv.com
T:
F: