OIL ANALYSIS REPORT

Sample Rating Trend

WEAR

Machine Id
813045
Component
Diesel Engine
Fluid
PETRO CANADA DURON SHP 15W40 (--- GAL)

DIAGNOSIS

Recommendation

No corrective action is recommended at this time. Resample at the next service interval to monitor.

Wear

The nickel level is abnormal. All other metal levels are typical for a new component breaking in.

Contamination

Fuel content negligible. There is no indication of any contamination in the oil.

Fluid Condition

The oil viscosity is lower than normal. The BN result indicates that there is suitable alkalinity remaining in the oil. Confirm oil type.

SAMPLE INFORMATION		method	limit/base	current	history1	history2
Sample Number		Client Info		**GFL0104580**	---	---
Sample Date		Client Info		**18 Dec 2023**	---	---
Machine Age	hrs	Client Info		**594**	---	---
Oil Age	hrs	Client Info		**594**	---	---
Oil Changed		Client Info		**Not Changd**	---	---
Sample Status				**ABNORMAL**	---	---

CONTAMINATION		method	limit/base	current	history1	history2
Water		WC Method	>0.2	**NEG**	---	---
Glycol		WC Method		**NEG**	---	---

WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>120	**59**	---	---
Chromium	ppm	ASTM D5185m	>20	**1**	---	---
Nickel	ppm	ASTM D5185m	>5	▲ **20**	---	---
Titanium	ppm	ASTM D5185m	>2	**0**	---	---
Silver	ppm	ASTM D5185m	>2	**1**	---	---
Aluminum	ppm	ASTM D5185m	>20	**4**	---	---
Lead	ppm	ASTM D5185m	>40	**<1**	---	---
Copper	ppm	ASTM D5185m	>330	**59**	---	---
Tin	ppm	ASTM D5185m	>15	**2**	---	---
Vanadium	ppm	ASTM D5185m		**<1**	---	---
Cadmium	ppm	ASTM D5185m		**0**	---	---

ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	0	**180**	---	---
Barium	ppm	ASTM D5185m	0	**0**	---	---
Molybdenum	ppm	ASTM D5185m	60	**102**	---	---
Manganese	ppm	ASTM D5185m	0	**4**	---	---
Magnesium	ppm	ASTM D5185m	1010	**600**	---	---
Calcium	ppm	ASTM D5185m	1070	**1382**	---	---
Phosphorus	ppm	ASTM D5185m	1150	**617**	---	---
Zinc	ppm	ASTM D5185m	1270	**771**	---	---
Sulfur	ppm	ASTM D5185m	2060	**1987**	---	---

CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	**69**	---	---
Sodium	ppm	ASTM D5185m		**4**	---	---
Potassium	ppm	ASTM D5185m	>20	**12**	---	---
Fuel	%	ASTM D3524	>3.0	**0.2**	---	---

INFRA-RED		method	limit/base	current	history1	history2
Soot %	%	*ASTM D7844	>4	**0.9**	---	---
Nitration	Abs/cm	*ASTM D7624	>20	**10.4**	---	---
Sulfation	Abs/.1mm	*ASTM D7415	>30	**25.1**	---	---

FLUID DEGRADATION		method	limit/base	current	history1	history2
Oxidation	Abs/.1mm	*ASTM D7414	>25	**22.9**	---	---
Base Number (BN)	mg KOH/g	ASTM D2896	9.8	**7.2**	---	---

OIL ANALYSIS REPORT

Fuel Dilution

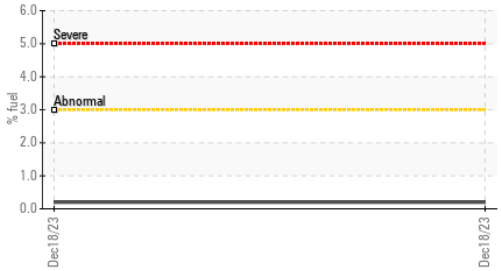

Viscosity @ 100°C

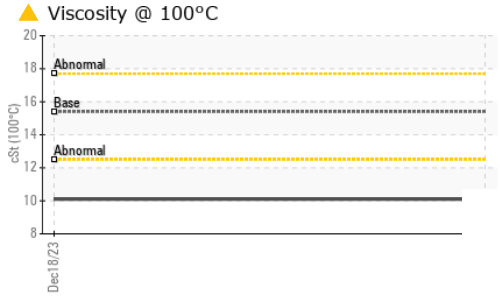

Fuel Dilution

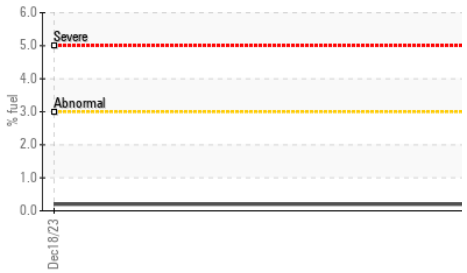

Base Number

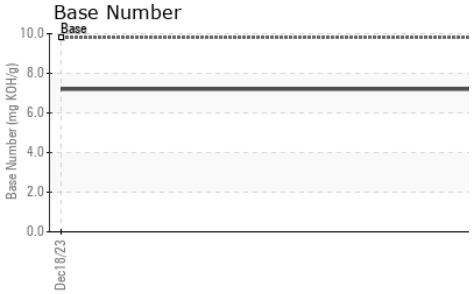

VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	**NONE**	---	---
Yellow Metal	scalar	*Visual	NONE	**NONE**	---	---
Precipitate	scalar	*Visual	NONE	**NONE**	---	---
Silt	scalar	*Visual	NONE	**NONE**	---	---
Debris	scalar	*Visual	NONE	**NONE**	---	---
Sand/Dirt	scalar	*Visual	NONE	**NONE**	---	---
Appearance	scalar	*Visual	NORML	**NORML**	---	---
Odor	scalar	*Visual	NORML	**NORML**	---	---
Emulsified Water	scalar	*Visual	>0.2	**NEG**	---	---
Free Water	scalar	*Visual		**NEG**	---	---

FLUID PROPERTIES		method	limit/base	current	history1	history2
Visc @ 100°C	cSt	ASTM D445	15.4	▲ **10.1**	---	---

GRAPHS

Ferrous Alloys

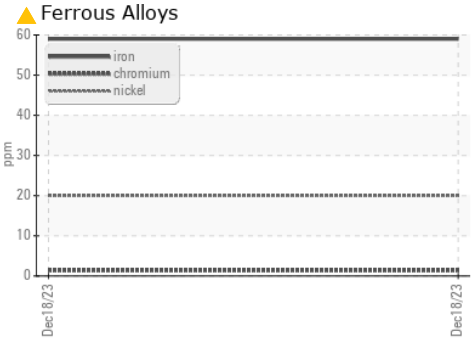

Non-ferrous Metals

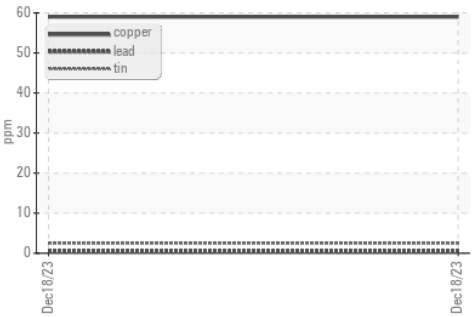

Viscosity @ 100°C

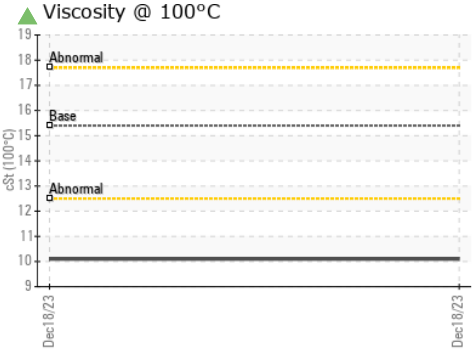

Base Number

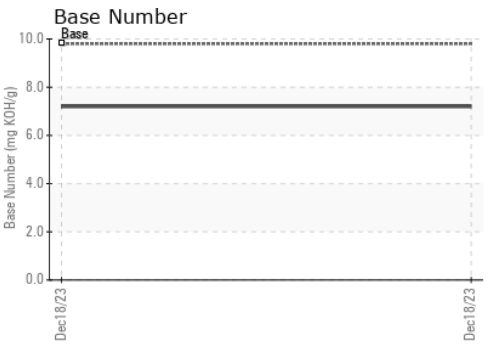

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : GFL0104580 **Recieved** : 27 Dec 2023
Lab Number : 06046057 **Diagnosed** : 02 Jan 2024
Unique Number : 10806665 **Diagnostician** : Jonathan Hester
Test Package : FLEET (Additional Tests: FuelDilution, PercentFuel)

To discuss this sample report, contact Customer Service at 1-800-237-1369.
** - Denotes test methods that are outside of the ISO 17025 scope of accreditation.*
Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

GFL Environmental - 947 - WB Horicon HC
N7296 County Rd V
Horicon, WI
US 53032
Contact: Tim Kieffer
tim.kieffer@gflenv.com
T: (608)219-0288
F: