PROBLEM SUMMARY

Sample Rating Trend

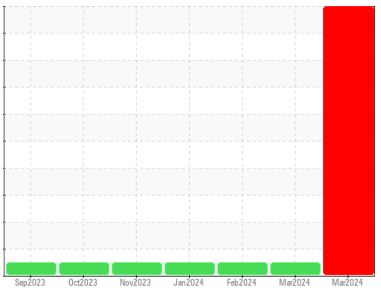

GLYCOL

Machine Id
413046
Component
Diesel Engine
Fluid
PETRO CANADA DURON SHP 15W40 (36 QTS)

COMPONENT CONDITION SUMMARY

▲ Glycol Contamination

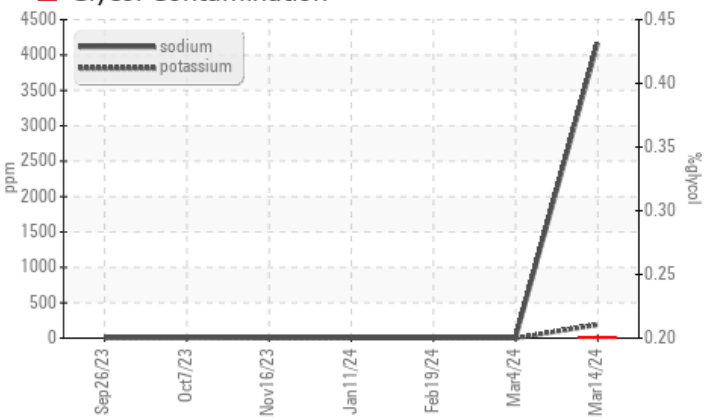

▲ Silicon (ppm)

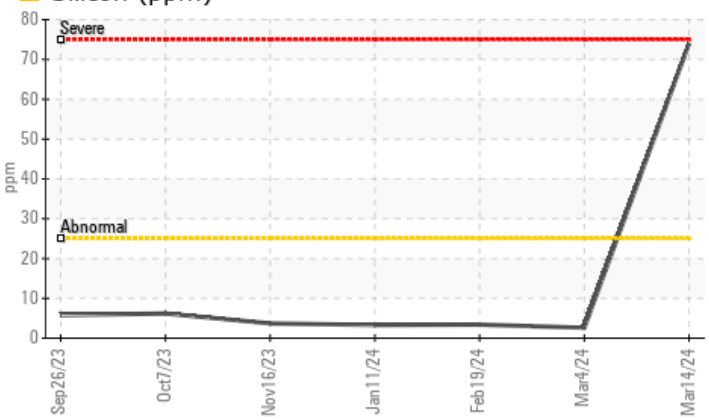

RECOMMENDATION

We advise that you check for the source of the coolant leak. Check for low coolant level. Oil and filter change at the time of sampling has been noted. We recommend an early resample to monitor this condition.

PROBLEMATIC TEST RESULTS

Sample Status				**SEVERE**	NORMAL	NORMAL
Silicon	ppm	ASTM D5185m	>25	▲ **74**	3	3
Sodium	ppm	ASTM D5185m		▲ **4167**	1	<1
Potassium	ppm	ASTM D5185m	>20	▲ **189**	0	<1
Glycol	%	*ASTM D2982		▲ **0.20**	NEG	NEG

Customer Id: GFL410
Sample No.: GFL0104404
Lab Number: 06140955
Test Package: FLEET

To manage this report scan the QR code

To discuss the diagnosis or test data:
Jonathan Hester +1 919-379-4092 x4092
jhester@wearcheckusa.com

To change component or sample information:
Customer Service +1 1-800-237-1369
customerservice@wearcheck.com

RECOMMENDED ACTIONS

Action	Status	Date	Done By	Description
Change Fluid	---	---	?	Oil and filter change at the time of sampling has been noted.
Change Filter	---	---	?	Oil and filter change at the time of sampling has been noted.
Resample	---	---	?	We recommend an early resample to monitor this condition.
Check Glycol Access	---	---	?	We advise that you check for the source of the coolant leak.

HISTORICAL DIAGNOSIS

NORMAL

04 Mar 2024 Diag: Wes Davis
Resample at the next service interval to monitor.All component wear rates are normal. There is no indication of any contamination in the oil. The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

view report

NORMAL

19 Feb 2024 Diag: Wes Davis
Resample at the next service interval to monitor.All component wear rates are normal. There is no indication of any contamination in the oil. The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

view report

NORMAL

11 Jan 2024 Diag: Wes Davis
Resample at the next service interval to monitor.All component wear rates are normal. There is no indication of any contamination in the oil. The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

view report

OIL ANALYSIS REPORT

Sample Rating Trend

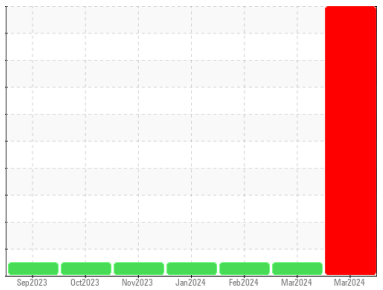

GLYCOL

Machine Id
413046
Component
Diesel Engine
Fluid
PETRO CANADA DURON SHP 15W40 (36 QTS)

DIAGNOSIS

▲ Recommendation
We advise that you check for the source of the coolant leak. Check for low coolant level. Oil and filter change at the time of sampling has been noted. We recommend an early resample to monitor this condition.

Wear
All component wear rates are normal.

▲ Contamination
Sodium and/or potassium levels are high. There is a high concentration of glycol present in the oil. Elemental level of silicon (Si) above normal indicating ingress of seal material.

▲ Fluid Condition
The BN result indicates that there is suitable alkalinity remaining in the oil. The oil is no longer serviceable due to the presence of contaminants.

SAMPLE INFORMATION		method	limit/base	current	history1	history2
Sample Number		Client Info		**GFL0104404**	GFL0104330	GFL0110144
Sample Date		Client Info		**14 Mar 2024**	04 Mar 2024	19 Feb 2024
Machine Age	hrs	Client Info		**0**	2964	2870
Oil Age	hrs	Client Info		**300**	600	600
Oil Changed		Client Info		**Changed**	Changed	Changed
Sample Status				**SEVERE**	NORMAL	NORMAL

CONTAMINATION		method	limit/base	current	history1	history2
Fuel		WC Method	>3.0	**<1.0**	<1.0	<1.0
Water		WC Method	>0.2	**NEG**	NEG	NEG

WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>120	**26**	1	8
Chromium	ppm	ASTM D5185m	>20	**1**	0	<1
Nickel	ppm	ASTM D5185m	>5	**<1**	0	<1
Titanium	ppm	ASTM D5185m	>2	**<1**	0	0
Silver	ppm	ASTM D5185m	>2	**<1**	0	0
Aluminum	ppm	ASTM D5185m	>20	**5**	<1	1
Lead	ppm	ASTM D5185m	>40	**<1**	0	0
Copper	ppm	ASTM D5185m	>330	**4**	0	5
Tin	ppm	ASTM D5185m	>15	**<1**	0	<1
Vanadium	ppm	ASTM D5185m		**<1**	0	<1
Cadmium	ppm	ASTM D5185m		**<1**	0	0

ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	0	**184**	<1	11
Barium	ppm	ASTM D5185m	0	**0**	0	0
Molybdenum	ppm	ASTM D5185m	60	**222**	53	56
Manganese	ppm	ASTM D5185m	0	**<1**	0	<1
Magnesium	ppm	ASTM D5185m	1010	**882**	893	893
Calcium	ppm	ASTM D5185m	1070	**988**	973	991
Phosphorus	ppm	ASTM D5185m	1150	**991**	1023	963
Zinc	ppm	ASTM D5185m	1270	**1174**	1162	1170
Sulfur	ppm	ASTM D5185m	2060	**2920**	2880	2864

CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	▲ **74**	3	3
Sodium	ppm	ASTM D5185m		▲ **4167**	1	<1
Potassium	ppm	ASTM D5185m	>20	▲ **189**	0	<1
Glycol	%	*ASTM D2982		▲ **0.20**	NEG	NEG

INFRA-RED		method	limit/base	current	history1	history2
Soot %	%	*ASTM D7844	>4	**0.3**	0.1	0.2
Nitration	Abs/cm	*ASTM D7624	>20	**12.5**	4.9	6.6
Sulfation	Abs/.1mm	*ASTM D7415	>30	**23.3**	17.7	18.6

FLUID DEGRADATION		method	limit/base	current	history1	history2
Oxidation	Abs/.1mm	*ASTM D7414	>25	**15.3**	13.9	14.5
Base Number (BN)	mg KOH/g	ASTM D2896	9.8	**27.2**	8.9	7.9

OIL ANALYSIS REPORT

Glycol Contamination

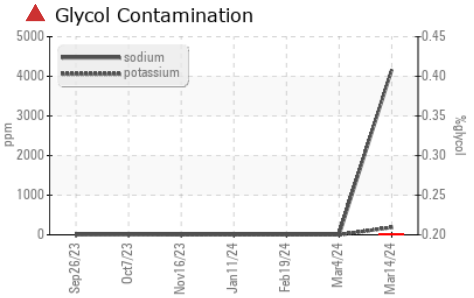

Silicon (ppm)

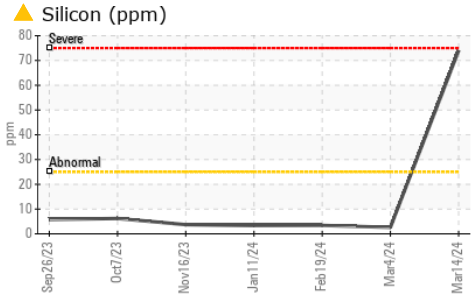

FT-IR (Direct Trend)

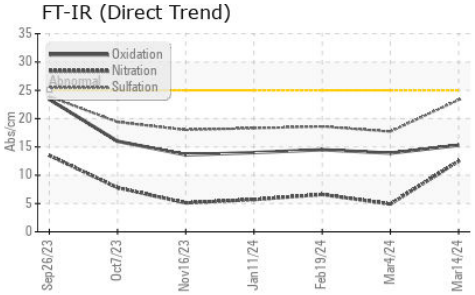

Base Number

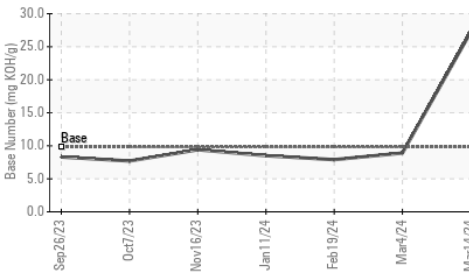

Viscosity @ 100°C

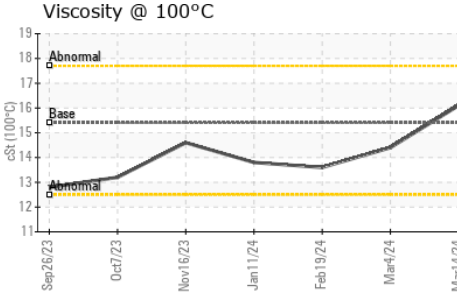

VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	**NONE**	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	**NONE**	NONE	NONE
Precipitate	scalar	*Visual	NONE	**NONE**	NONE	NONE
Silt	scalar	*Visual	NONE	**NONE**	NONE	NONE
Debris	scalar	*Visual	NONE	**NONE**	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	**NONE**	NONE	NONE
Appearance	scalar	*Visual	NORML	**NORML**	NORML	NORML
Odor	scalar	*Visual	NORML	**NORML**	NORML	NORML
Emulsified Water	scalar	*Visual	>0.2	**NEG**	NEG	NEG
Free Water	scalar	*Visual		**NEG**	NEG	NEG

FLUID PROPERTIES		method	limit/base	current	history1	history2
Visc @ 100°C	cSt	ASTM D445	15.4	**16.1**	14.4	13.6

GRAPHS

Ferrous Alloys

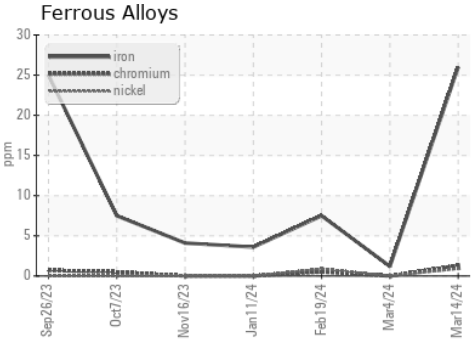

Non-ferrous Metals

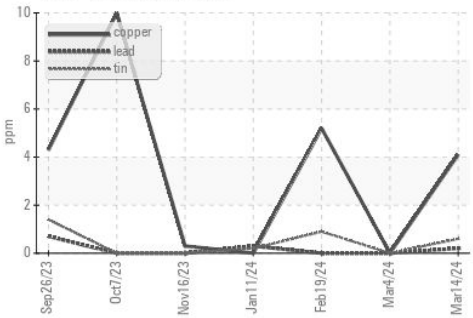

Viscosity @ 100°C

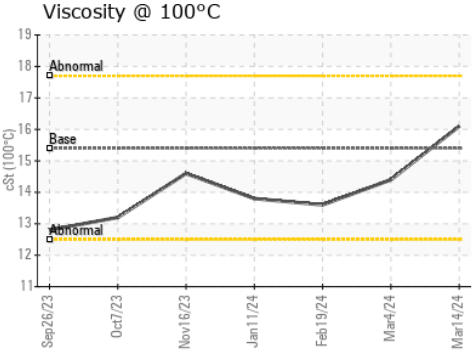

Base Number

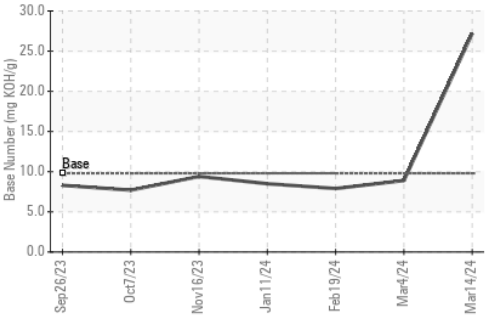

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : GFL0104404
Lab Number : 06140955
Unique Number : 10965763
Test Package : FLEET (Additional Tests: Glycol)

Received : 08 Apr 2024
Tested : 10 Apr 2024
Diagnosed : 10 Apr 2024 - Jonathan Hester

To discuss this sample report, contact Customer Service at 1-800-237-1369.
** - Denotes test methods that are outside of the ISO 17025 scope of accreditation.*
Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

GFL Environmental - 410 - Michigan West
39000 Van Born Rd
Wayne, MI
US 48184
Contact: Belal Dgheish
bdgheish@gflenv.com
T: (734)714-2340
F: