OIL ANALYSIS REPORT

Sample Rating Trend

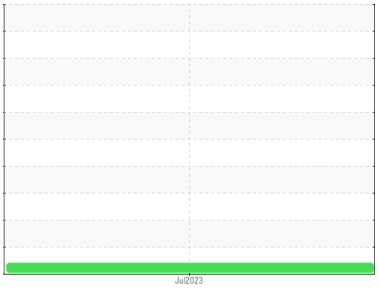

VISCOSITY

Machine Id
EPIROC ST14 SCP205
Component
Diesel Engine
Fluid
DIESEL ENGINE OIL SAE 15W40 (--- GAL)

DIAGNOSIS

Recommendation
No corrective action is recommended at this time. Resample at the next service interval to monitor.

Wear
Metal levels are typical for a new component breaking in.

Contamination
Fuel content negligible. There is no indication of any contamination in the oil.

Fluid Condition
Viscosity of sample indicates oil is within SAE 30 range, advise investigate. The condition of the oil is acceptable for the time in service.

SAMPLE INFORMATION		method	limit/base	current	history1	history2
Sample Number		Client Info		**WC0835139**	---	---
Sample Date		Client Info		**28 Jul 2023**	---	---
Machine Age	hrs	Client Info		**826**	---	---
Oil Age	hrs	Client Info		**0**	---	---
Oil Changed		Client Info		**Not Changd**	---	---
Sample Status				**ABNORMAL**	---	---

CONTAMINATION		method	limit/base	current	history1	history2
Glycol		WC Method		**NEG**	---	---

WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>100	**3**	---	---
Chromium	ppm	ASTM D5185(m)	>20	**0**	---	---
Nickel	ppm	ASTM D5185(m)	>4	**0**	---	---
Titanium	ppm	ASTM D5185(m)		**0**	---	---
Silver	ppm	ASTM D5185(m)	>3	**0**	---	---
Aluminum	ppm	ASTM D5185(m)	>20	**1**	---	---
Lead	ppm	ASTM D5185(m)	>40	**<1**	---	---
Copper	ppm	ASTM D5185(m)	>330	**<1**	---	---
Tin	ppm	ASTM D5185(m)	>15	**0**	---	---
Antimony	ppm	ASTM D5185(m)		**0**	---	---
Vanadium	ppm	ASTM D5185(m)		**0**	---	---
Beryllium	ppm	ASTM D5185(m)		**0**	---	---
Cadmium	ppm	ASTM D5185(m)		**0**	---	---

ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)	250	**16**	---	---
Barium	ppm	ASTM D5185(m)	10	**0**	---	---
Molybdenum	ppm	ASTM D5185(m)	100	**52**	---	---
Manganese	ppm	ASTM D5185(m)		**<1**	---	---
Magnesium	ppm	ASTM D5185(m)	450	**789**	---	---
Calcium	ppm	ASTM D5185(m)	3000	**1122**	---	---
Phosphorus	ppm	ASTM D5185(m)	1150	**986**	---	---
Zinc	ppm	ASTM D5185(m)	1350	**1073**	---	---
Sulfur	ppm	ASTM D5185(m)	4250	**2475**	---	---
Lithium	ppm	ASTM D5185(m)		**<1**	---	---

CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>25	**5**	---	---
Sodium	ppm	ASTM D5185(m)	>158	**4**	---	---
Potassium	ppm	ASTM D5185(m)	>20	**<1**	---	---
Fuel	%	ASTM D7593*	>5	**0.6**	---	---

INFRA-RED		method	limit/base	current	history1	history2
Soot %	%	ASTM D7844*	>3	**0**	---	---
Nitration	Abs/cm	ASTM D7624*	>20	**3.9**	---	---
Sulfation	Abs/.1mm	ASTM D7415*	>30	**17.6**	---	---

FLUID DEGRADATION		method	limit/base	current	history1	history2
Oxidation	Abs/.1mm	ASTM D7414*	>25	**11.3**	---	---

OIL ANALYSIS REPORT

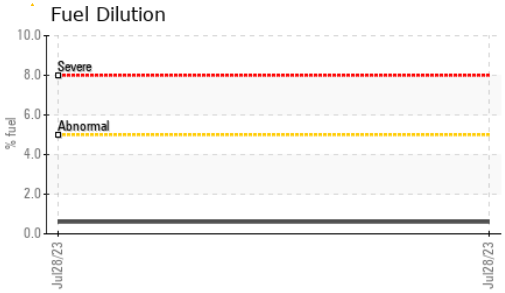

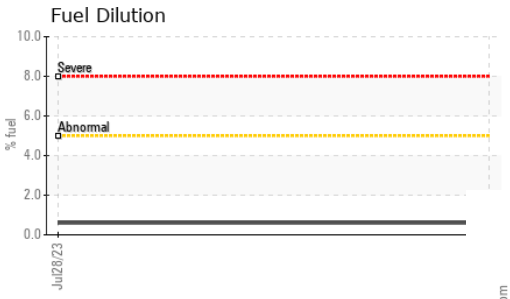

VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	**NONE**	---	---
Yellow Metal	scalar	Visual*	NONE	**NONE**	---	---
Precipitate	scalar	Visual*	NONE	**NONE**	---	---
Silt	scalar	Visual*	NONE	**VLITE**	---	---
Debris	scalar	Visual*	NONE	**NONE**	---	---
Sand/Dirt	scalar	Visual*	NONE	**NONE**	---	---
Appearance	scalar	Visual*	NORML	**NORML**	---	---
Odor	scalar	Visual*	NORML	**NORML**	---	---
Emulsified Water	scalar	Visual*	>0.2	**NEG**	---	---
Free Water	scalar	Visual*		**NEG**	---	---

FLUID PROPERTIES		method	limit/base	current	history1	history2
Visc @ 100°C	cSt	ASTM D7279(m)	14.4	▲ **11.3**	---	---

GRAPHS

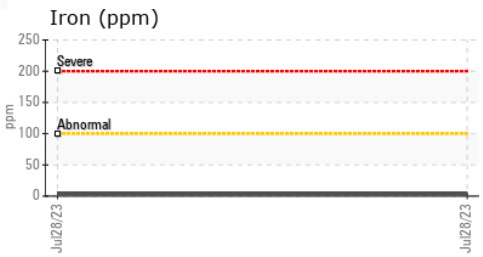

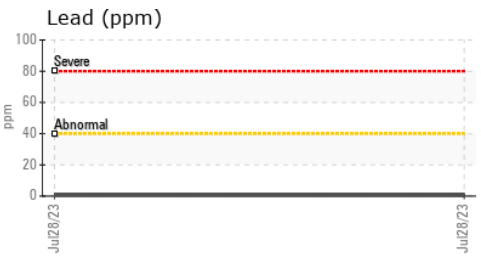

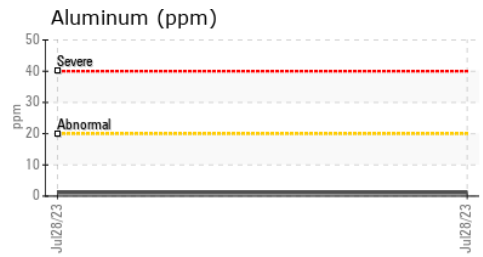

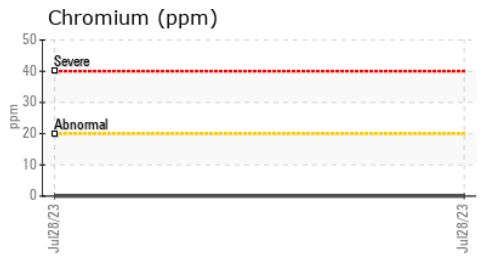

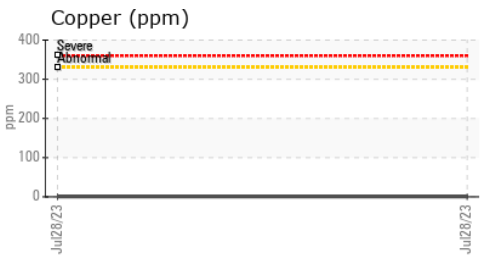

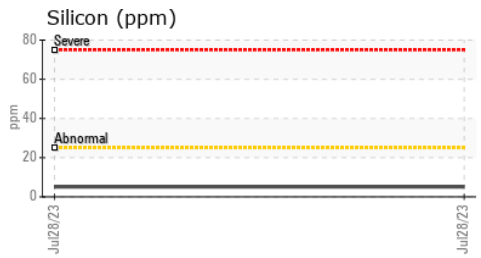

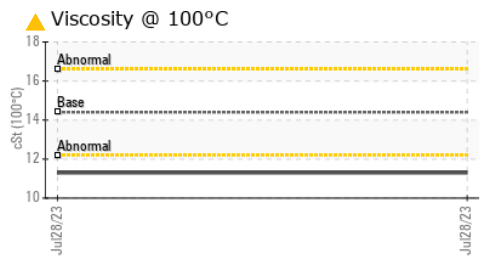

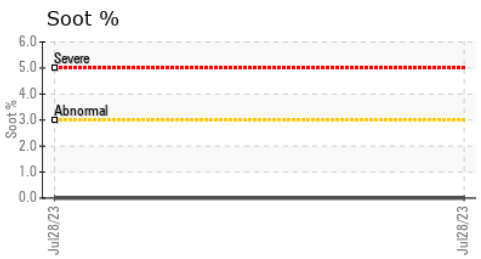

ISO 17025:2017 Accredited Laboratory

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : WC0835139 **Received** : 11 Aug 2023
Lab Number : 02575326 **Diagnosed** : 14 Aug 2023
Unique Number : 5620377 **Diagnostician** : Kevin Marson
Test Package : MOB 1 (Additional Tests: FuelDilution, PercentFuel, Visual)

To discuss this sample report, contact Customer Service at 1-800-268-2131.
Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
Validity of results and interpretation are based on the sample and information as supplied.

Agnico Eagle Canada
1350 Government Rd. W, MACASSA COMPLEX
Kirkland Lake, ON
CA P2N 3J1
Contact: Mike Campbell
mike.campbell@agnicoeagle.com
T: (705)567-5208
F: (705)567-5221