OIL ANALYSIS REPORT

Sample Rating Trend

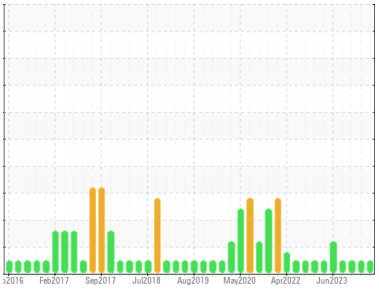

NORMAL

Area
[5919]
Machine Id
NEW FLYER 1202
Component
Diesel Engine
Fluid
VALVOLINE 15W40 (--- GAL)

DIAGNOSIS

Recommendation
Resample at the next service interval to monitor.

Wear
All component wear rates are normal.

Contamination
There is no indication of any contamination in the oil.

Fluid Condition
The condition of the oil is acceptable for the time in service.

SAMPLE INFORMATION		method	limit/base	current	history1	history2
Sample Number		Client Info		**WC0875110**	WC0843554	WC0843534
Sample Date		Client Info		**12 Dec 2023**	06 Oct 2023	29 Aug 2023
Machine Age	kms	Client Info		**426104**	447022	408234
Oil Age	kms	Client Info		**0**	0	0
Oil Changed		Client Info		**N/A**	Changed	N/A
Sample Status				**NORMAL**	NORMAL	NORMAL

CONTAMINATION		method	limit/base	current	history1	history2
Fuel		WC Method	>5	**<1.0**	<1.0	<1.0
Water		WC Method	>0.2	**NEG**	NEG	NEG
Glycol		WC Method		**NEG**	0.0	0.0

WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>100	**3**	12	13
Chromium	ppm	ASTM D5185(m)	>20	**0**	<1	<1
Nickel	ppm	ASTM D5185(m)	>4	**<1**	0	0
Titanium	ppm	ASTM D5185(m)		**0**	0	0
Silver	ppm	ASTM D5185(m)	>3	**<1**	<1	<1
Aluminum	ppm	ASTM D5185(m)	>20	**1**	1	1
Lead	ppm	ASTM D5185(m)	>40	**0**	0	<1
Copper	ppm	ASTM D5185(m)	>330	**<1**	<1	<1
Tin	ppm	ASTM D5185(m)	>15	**0**	0	0
Antimony	ppm	ASTM D5185(m)		**0**	0	0
Vanadium	ppm	ASTM D5185(m)		**0**	0	0
Beryllium	ppm	ASTM D5185(m)		**0**	0	0
Cadmium	ppm	ASTM D5185(m)		**0**	0	0

ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)	39	**13**	9	23
Barium	ppm	ASTM D5185(m)	1	**0**	<1	<1
Molybdenum	ppm	ASTM D5185(m)	49	**7**	11	30
Manganese	ppm	ASTM D5185(m)	1	**0**	0	0
Magnesium	ppm	ASTM D5185(m)	616	**45**	41	128
Calcium	ppm	ASTM D5185(m)	1554	**2165**	2251	2004
Phosphorus	ppm	ASTM D5185(m)	899	**854**	878	808
Zinc	ppm	ASTM D5185(m)	1069	**983**	1030	954
Sulfur	ppm	ASTM D5185(m)	2624	**3174**	2935	2686
Lithium	ppm	ASTM D5185(m)		**<1**	<1	<1

CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>25	**8**	4	5
Sodium	ppm	ASTM D5185(m)		**<1**	6	10
Potassium	ppm	ASTM D5185(m)	>20	**<1**	8	20

INFRA-RED		method	limit/base	current	history1	history2
Soot %	%	ASTM D7844*	>3	**0**	0.6	0.6
Nitration	Abs/cm	ASTM D7624*	>20	**5.7**	8.7	10.4
Sulfation	Abs/.1mm	ASTM D7415*	>30	**15.9**	21.8	24.2

OIL ANALYSIS REPORT

Additives

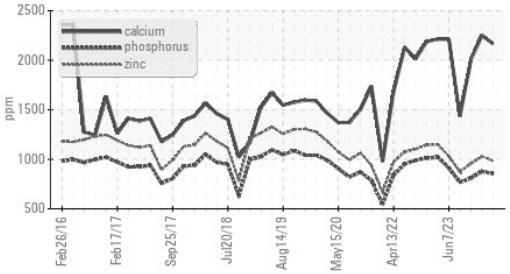

Additives

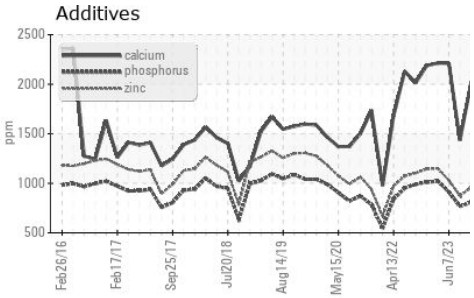

FLUID DEGRADATION		method	limit/base	current	history1	history2
Oxidation	Abs/.1mm	ASTM D7414*	>25	**9.2**	14.4	20.1

VISUAL		method	limit/base	current	history1	history2
Emulsified Water	scalar	Visual*	>0.2	**NEG**	NEG	NEG
Free Water	scalar	Visual*		**NEG**	NEG	NEG

FLUID PROPERTIES		method	limit/base	current	history1	history2
Visc @ 100°C	cSt	ASTM D7279(m)	13.6	**13.4**	13.9	12.8

GRAPHS

Iron (ppm)

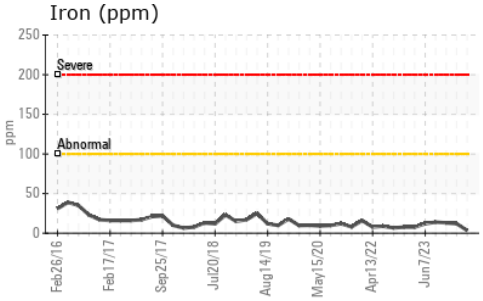

Lead (ppm)

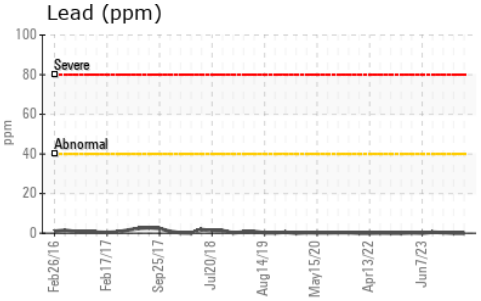

Aluminum (ppm)

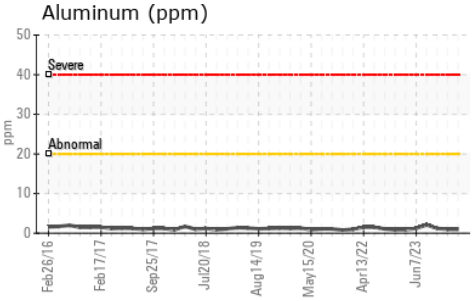

Chromium (ppm)

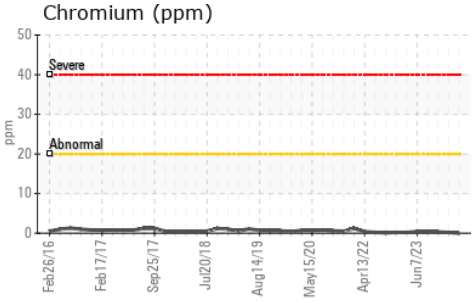

Copper (ppm)

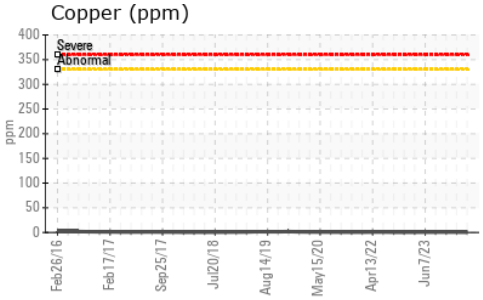

Silicon (ppm)

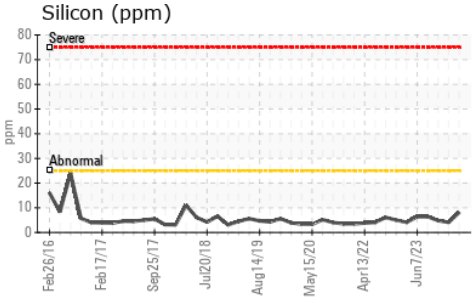

Viscosity @ 100°C

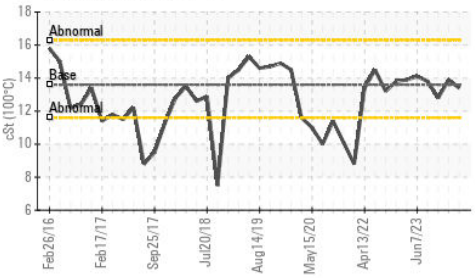

Soot %

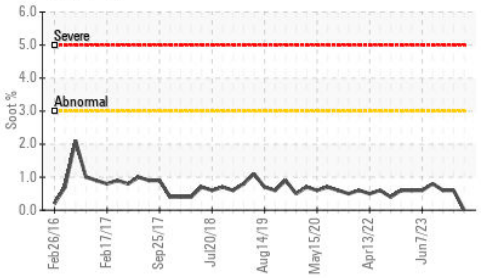

ISO 17025:2017 Accredited Laboratory

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : WC0875110
Lab Number : 02606969
Unique Number : 5708055
Test Package : MOB 1
Recieved : 08 Jan 2024
Diagnosed : 08 Jan 2024
Diagnostician : Wes Davis

To discuss this sample report, contact Customer Service at 1-800-268-2131.
Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
Validity of results and interpretation are based on the sample and information as supplied.

MVT Canadian Bus
133 Welham Road
Barrie, ON
CA L4N 8Y3
Contact: Frank Mastromarco
frank.mastromarco@mvtransit.com
T: (709)792-5033
F: