OIL ANALYSIS REPORT

Sample Rating Trend

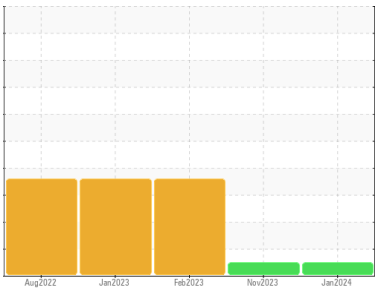

NORMAL

Area
5 Utilities/031 Water Pumping/Gearbox/P Pump/752B #2 Fire Pump
Machine Id
31EP751B #2 Fire Pump Engine
Component
Diesel Engine
Fluid
PETRO CANADA DURON UHP E6 10W40 (--- LTR)

DIAGNOSIS

Recommendation
Resample at the next service interval to monitor. Please specify the component make and model with your next sample.

Wear
All component wear rates are normal.

Contamination
There is no indication of any contamination in the oil.

Fluid Condition
The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

SAMPLE INFORMATION		method	limit/base	current	history1	history2
Sample Number		Client Info		**WC0902172**	WC087366	WC0783271
Sample Date		Client Info		**04 Jan 2024**	02 Nov 2023	08 Feb 2023
Machine Age	hrs	Client Info		**0**	0	0
Oil Age	hrs	Client Info		**0**	0	0
Oil Changed		Client Info		**N/A**	N/A	N/A
Sample Status				**NORMAL**	NORMAL	SEVERE

CONTAMINATION		method	limit/base	current	history1	history2
Fuel		WC Method	>5	**<1.0**	<1.0	<1.0
Water		WC Method	>0.2	**NEG**	NEG	NEG
Glycol		WC Method		**NEG**	NEG	NEG

WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>100	**2**	1	2
Chromium	ppm	ASTM D5185(m)	>20	**0**	0	0
Nickel	ppm	ASTM D5185(m)	>4	**0**	0	<1
Titanium	ppm	ASTM D5185(m)		**0**	0	<1
Silver	ppm	ASTM D5185(m)	>3	**0**	<1	0
Aluminum	ppm	ASTM D5185(m)	>20	**<1**	<1	<1
Lead	ppm	ASTM D5185(m)	>40	**<1**	0	0
Copper	ppm	ASTM D5185(m)	>330	**1**	<1	2
Tin	ppm	ASTM D5185(m)	>15	**0**	0	<1
Antimony	ppm	ASTM D5185(m)		**0**	0	0
Vanadium	ppm	ASTM D5185(m)		**0**	0	0
Beryllium	ppm	ASTM D5185(m)		**0**	0	0
Cadmium	ppm	ASTM D5185(m)		**0**	0	0

ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)	0	**<1**	1	4
Barium	ppm	ASTM D5185(m)	0	**0**	<1	0
Molybdenum	ppm	ASTM D5185(m)	0	**56**	61	59
Manganese	ppm	ASTM D5185(m)	0	**0**	0	<1
Magnesium	ppm	ASTM D5185(m)	80	**952**	1021	956
Calcium	ppm	ASTM D5185(m)	2400	**1019**	1102	1074
Phosphorus	ppm	ASTM D5185(m)	750	**982**	1071	1085
Zinc	ppm	ASTM D5185(m)	840	**1139**	1258	1159
Sulfur	ppm	ASTM D5185(m)	2130	**2548**	2776	2832
Lithium	ppm	ASTM D5185(m)		**<1**	<1	<1

CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>25	**2**	4	4
Sodium	ppm	ASTM D5185(m)		**1**	2	1
Potassium	ppm	ASTM D5185(m)	>20	**0**	0	<1

INFRA-RED		method	limit/base	current	history1	history2
Soot %	%	ASTM D7844*	>3	**0**	0	---
Nitration	Abs/cm	ASTM D7624*	>20	**4.4**	4.2	---
Sulfation	Abs/.1mm	ASTM D7415*	>30	**17.7**	17.7	---

OIL ANALYSIS REPORT

FT-IR (Direct Trend)

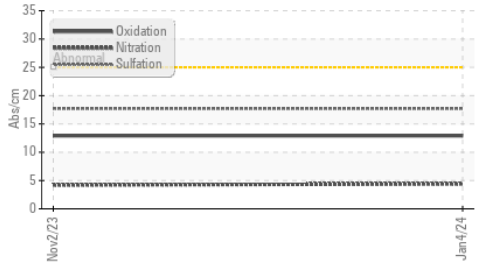

Base Number

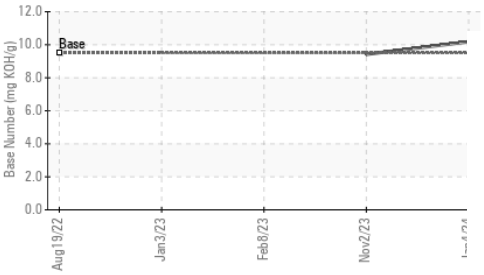

Viscosity @ 100°C

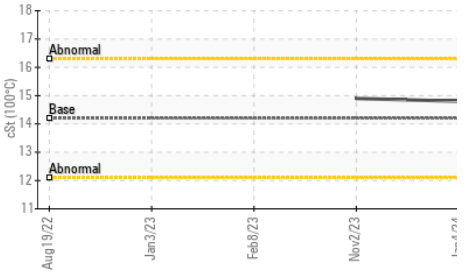

FLUID DEGRADATION		method	limit/base	current	history1	history2
Oxidation	Abs/.1mm	ASTM D7414*	>25	**12.9**	12.9	---
Base Number (BN)	mg KOH/g	ASTM D2896*	9.5	**10.18**	9.42	---

VISUAL		method	limit/base	current	history1	history2
Emulsified Water	scalar	Visual*	>0.2	**NEG**	NEG	NEG
Free Water	scalar	Visual*		**NEG**	NEG	NEG

FLUID PROPERTIES		method	limit/base	current	history1	history2
Visc @ 100°C	cSt	ASTM D7279(m)	14.2	**14.8**	14.9	---

GRAPHS

Iron (ppm)

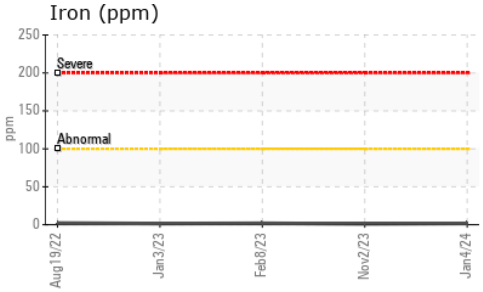

Lead (ppm)

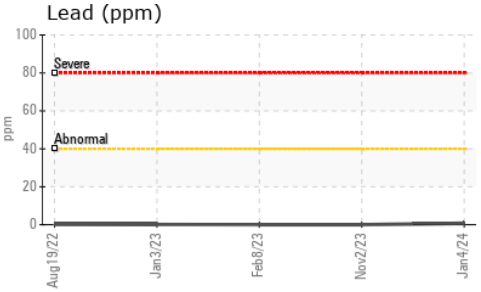

Aluminum (ppm)

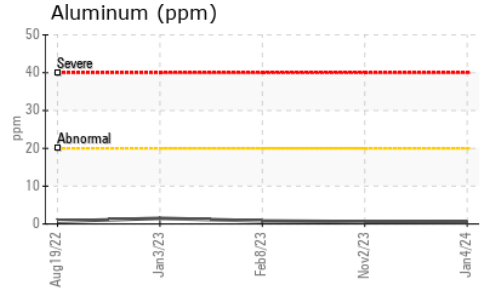

Chromium (ppm)

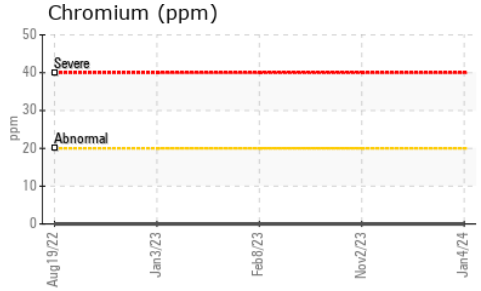

Copper (ppm)

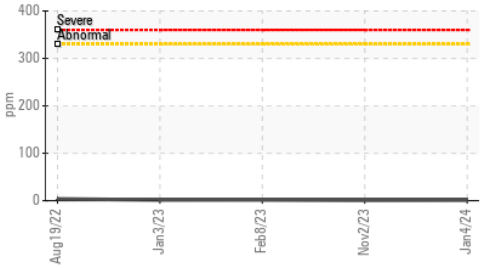

Silicon (ppm)

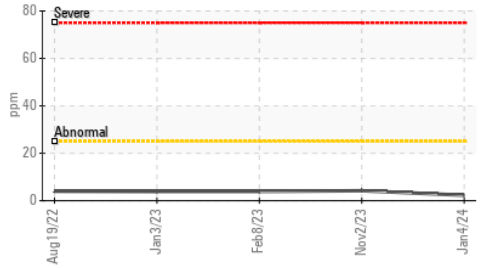

Viscosity @ 100°C

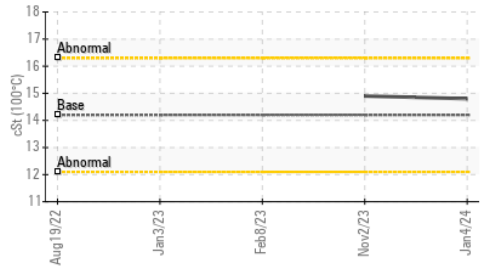

Base Number

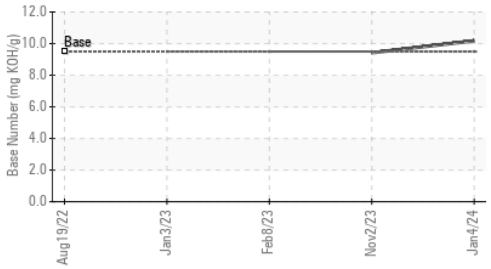

ISO 17025:2017 Accredited Laboratory

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : WC0902172
Lab Number : 02626922
Unique Number : 5760054
Test Package : MOB 2

Received : 05 Apr 2024
Tested : 08 Apr 2024
Diagnosed : 08 Apr 2024 - Wes Davis

To discuss this sample report, contact Customer Service at 1-800-268-2131.
Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
Validity of results and interpretation are based on the sample and information as supplied.

Petro Canada Lubricants Inc.
385 Southdown Road
Mississauga, ON
CA L5J 2Y3
Contact: Martin Wagenaar
martin.wagenaar@HFSinclair.com
T: (905)403-5682
F: (905)822-6025