OIL ANALYSIS REPORT

Area
BD SHOP
Machine Id
200301
Component
Diesel Engine
Fluid
TEST OIL GOLD 4 (40 LTR)

Sample Rating Trend

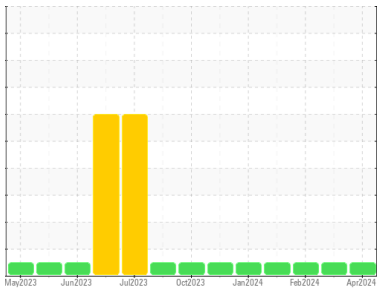

NORMAL

DIAGNOSIS

Recommendation
Resample at the next service interval to monitor.

Wear
All component wear rates are normal.

Contamination
Elevated aluminum (Al) and/or lead (Pb) and potassium (K) levels in your metals analysis are likely a result of solder flux release into the lubricant and is common on new equipment/components. There is no indication of any contamination in the oil.

Fluid Condition
The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

SAMPLE INFORMATION		method	limit/base	current	history1	history2
Sample Number		Client Info		**WC0926313**	WC0888922	WC0888883
Sample Date		Client Info		**16 Apr 2024**	22 Mar 2024	26 Feb 2024
Machine Age	kms	Client Info		**232541**	218655	205857
Oil Age	kms	Client Info		**26685**	12799	1
Oil Changed		Client Info		**Not Changd**	Not Changd	Changed
Sample Status				**NORMAL**	NORMAL	NORMAL

CONTAMINATION		method	limit/base	current	history1	history2
Fuel		WC Method	>3.0	**<1.0**	<1.0	<1.0
Water		WC Method	>0.2	**NEG**	NEG	NEG
Glycol		WC Method		**NEG**	NEG	NEG

WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>120	**19**	13	5
Chromium	ppm	ASTM D5185(m)	>20	**<1**	<1	0
Nickel	ppm	ASTM D5185(m)	>15	**4**	3	2
Titanium	ppm	ASTM D5185(m)	>2	**0**	0	0
Silver	ppm	ASTM D5185(m)	>3	**0**	0	0
Aluminum	ppm	ASTM D5185(m)	>20	**13**	9	3
Lead	ppm	ASTM D5185(m)	>40	**0**	0	<1
Copper	ppm	ASTM D5185(m)	>330	**14**	11	5
Tin	ppm	ASTM D5185(m)	>15	**0**	0	0
Antimony	ppm	ASTM D5185(m)		**0**	0	0
Vanadium	ppm	ASTM D5185(m)		**0**	0	0
Beryllium	ppm	ASTM D5185(m)		**0**	0	0
Cadmium	ppm	ASTM D5185(m)		**0**	0	0

ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)	1	**<1**	0	<1
Barium	ppm	ASTM D5185(m)	0	**0**	0	0
Molybdenum	ppm	ASTM D5185(m)	60	**58**	59	56
Manganese	ppm	ASTM D5185(m)	0	**<1**	0	0
Magnesium	ppm	ASTM D5185(m)	950	**955**	972	923
Calcium	ppm	ASTM D5185(m)	980	**1032**	1052	1007
Phosphorus	ppm	ASTM D5185(m)	1100	**955**	972	960
Zinc	ppm	ASTM D5185(m)	1150	**1143**	1160	1112
Sulfur	ppm	ASTM D5185(m)	2600	**2426**	2502	2650
Lithium	ppm	ASTM D5185(m)		**<1**	<1	<1

CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>25	**2**	1	4
Sodium	ppm	ASTM D5185(m)		**2**	1	1
Potassium	ppm	ASTM D5185(m)	>20	**20**	15	7

INFRA-RED		method	limit/base	current	history1	history2
Soot %	%	ASTM D7844*	>4	**0.3**	0.1	0
Nitration	Abs/cm	ASTM D7624*	>20	**8.0**	6.6	4.8
Nitration(Diff)	Abs/cm	ASTM E2412*	< 25	**8.3**	4.9	1.1
Sulfation	Abs/.1mm	ASTM D7415*	>30	**19.4**	18.6	17.9
Sulfation(Diff)	Abs/cm	ASTM E2412*		**2.1**	0.6	0

OIL ANALYSIS REPORT

FT-IR (Direct Trend)

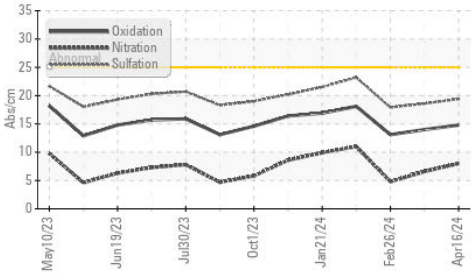

FT-IR (Differential)

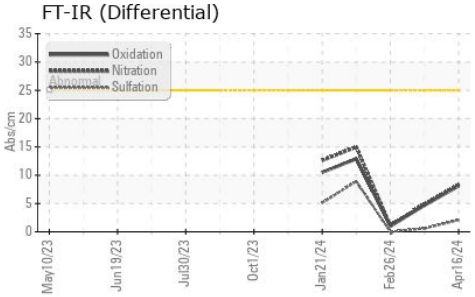

Viscosity @ 100°C

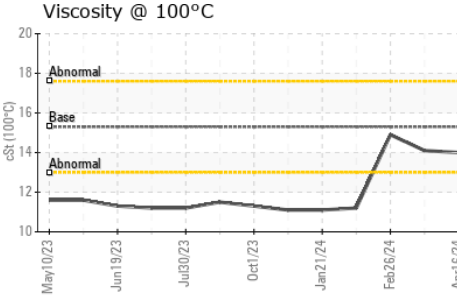

FT-IR (Differential)

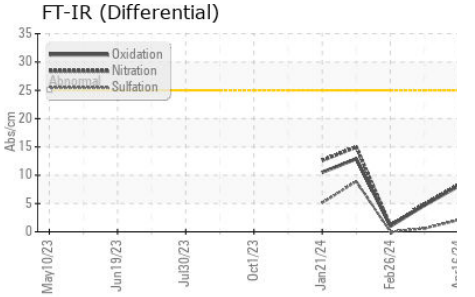

FLUID DEGRADATION		method	limit/base	current	history1	history2
Oxidation	Abs/.1mm	ASTM D7414*	>25	**14.8**	14.0	13.1
Oxidation(Diff)	Abs/cm	ASTM E2412*	< 25	**8.1**	4.7	1
Base Number (BN)	mg KOH/g	ASTM D2896*	9.5	**9.29**	10.19	9.11

VISUAL		method	limit/base	current	history1	history2
Emulsified Water	scalar	Visual*	>0.2	**NEG**	NEG	NEG
Free Water	scalar	Visual*		**NEG**	NEG	NEG

FLUID PROPERTIES		method	limit/base	current	history1	history2
Visc @ 100°C	cSt	ASTM D7279(m)	15.3	**14.0**	14.1	14.9

GRAPHS

Iron (ppm)

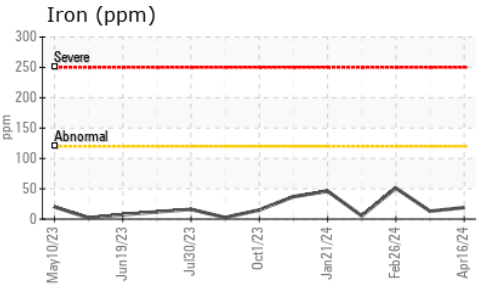

Lead (ppm)

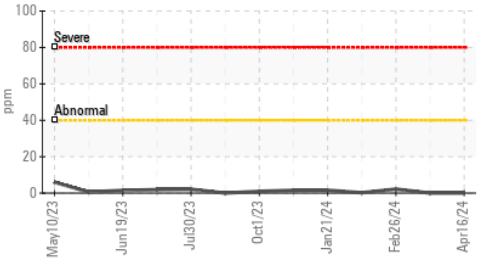

Aluminum (ppm)

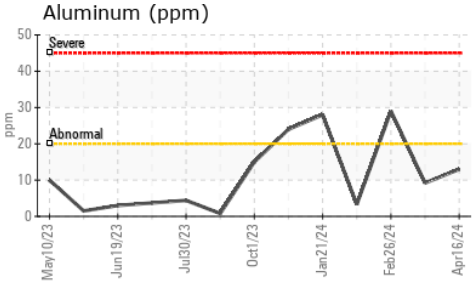

Chromium (ppm)

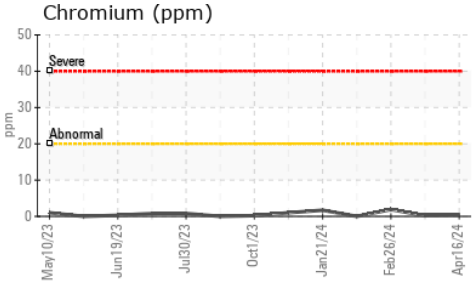

Copper (ppm)

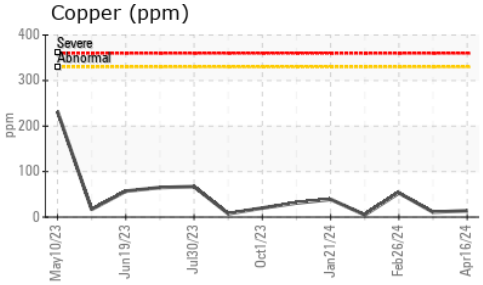

Silicon (ppm)

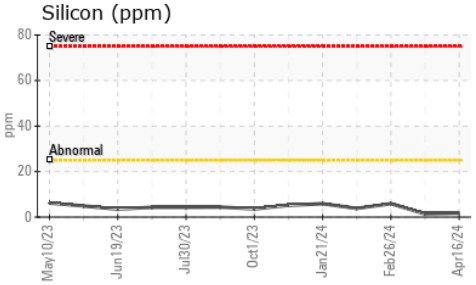

Viscosity @ 100°C

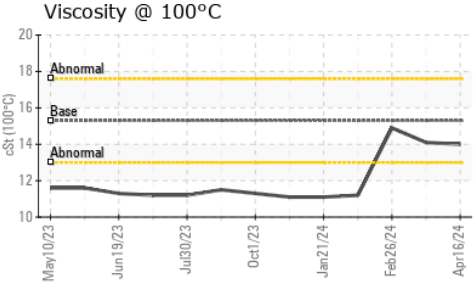

Base Number

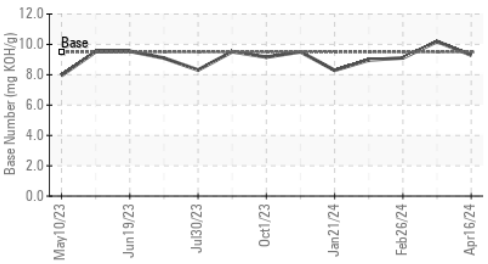

ISO 17025:2017 Accredited Laboratory

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : WC0926313 **Received** : 22 Apr 2024
Lab Number : 02630443 **Tested** : 23 Apr 2024
Unique Number : 5763575 **Diagnosed** : 23 Apr 2024 - Kevin Marson
Test Package : MOB 2 (Additional Tests: FT-IR(Diff))

To discuss this sample report, contact Customer Service at 1-800-268-2131.
Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
Validity of results and interpretation are based on the sample and information as supplied.

WFR Technical Services
5389 Riverside Drive
Burlington, ON
CA L7L 3Y1
Contact: William Ridley
wfr.technical.services@gmail.com
T:
F: