DIAMOND WTG ENGINEERING & SERVICES, INC.
a group company of MITSUBISHI HEAVY INDUSTRIES, LTD.

PROBLEM SUMMARY

Sample Rating Trend

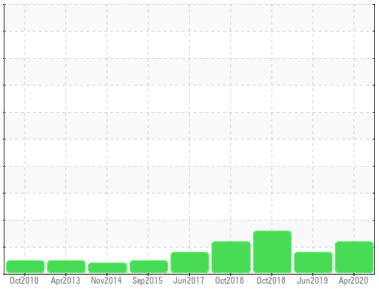

ISO

Machine Id
T-29
Component
Wind Turbine Gearbox
Fluid
MITSUBISHI Daphne Alpha Winforce (--- GAL)

COMPONENT CONDITION SUMMARY

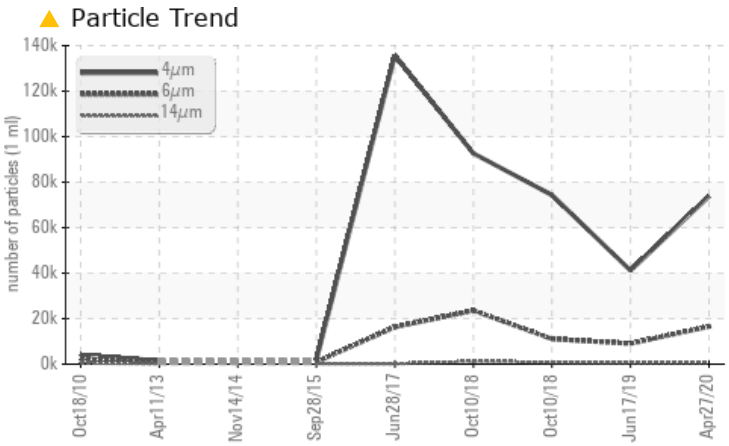

RECOMMENDATION

Replace filter element and resample at later date. In case already attempted and cleanliness was not improved then proceed to replace oil.

PROBLEMATIC TEST RESULTS

Sample Status				ABNORMAL	ABNORMAL	ABNORMAL
Particles >6µm		ASTM D7647	>5000	▲ **16486**	▲ 9029	▲ 23560
Particles >14µm		ASTM D7647	>640	▲ **724**	▲ 649	▲ 1219
Particles >21µm		ASTM D7647	>160	▲ **180**	147	▲ 257
Oil Cleanliness		ISO 4406 (c)	>--/19/16	▲ **23/21/17**	▲ 23/20/17	▲ 24/22/17

Customer Id: MITSANJON
Sample No.: MHI017768
Lab Number: 04975236
Test Package: IND 2

To manage this report scan the QR code

To discuss the diagnosis or test data:
Jonathan Hester +1 919-379-4092 x4092
jhester@wearcheckusa.com

To change component or sample information:
Customer Service +1 1-800-237-1369
customerservice@wearcheck.com

RECOMMENDED ACTIONS

Action	Status	Date	Done By	Description
Change Filter	---	---	?	Replace filter element and resample at later date. In case already attempted and cleanliness was not improved then proceed to replace oil.
Change Filter	---	---	?	Re-sample to verify the actual oil condition. Replace filter elements. Change oil if cleanliness level does not improve after replacing the filter(s).
Resample	---	---	?	Replace filter element and resample at later date. In case already attempted and cleanliness was not improved then proceed to replace oil.
Resample	---	---	?	Re-sample to verify the actual oil condition. Replace filter elements. Change oil if cleanliness level does not improve after replacing the filter(s).

HISTORICAL DIAGNOSIS

17 Jun 2019 Diag: Jonathan Hester

ISO

Re-sample to verify the actual oil condition. Replace filter elements. Change oil if cleanliness level does not improve after replacing the filter(s).All component wear rates are normal. There is a moderate amount of particulates present in the oil. The AN level is acceptable for this fluid.

view report

10 Oct 2018 Diag: Jonathan Hester

ISO

Re-sample to verify the actual oil condition. Replace filter elements. Change oil if cleanliness level does not improve after replacing the filter(s).All component wear rates are normal. There is a high amount of particulates present in the oil. Moderate concentration of visible dirt/debris present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

view report

10 Oct 2018 Diag: Jonathan Hester

ISO

Re-sample to verify the actual oil condition. Replace filter elements. Change oil if cleanliness level does not improve after replacing the filter(s).All component wear rates are normal. There is a high amount of particulates present in the oil. The AN level is acceptable for this fluid.

view report

DIAMOND WTG ENGINEERING & SERVICES, INC.
a group company of MITSUBISHI HEAVY INDUSTRIES, LTD.

OIL ANALYSIS REPORT

Sample Rating Trend

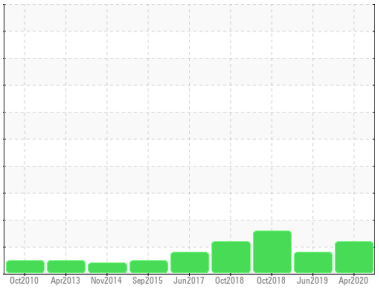

ISO

Machine Id
T-29
Component
Wind Turbine Gearbox
Fluid
MITSUBISHI Daphne Alpha Winforce (--- GAL)

DIAGNOSIS

Recommendation
Replace filter element and resample at later date. In case already attempted and cleanliness was not improved then proceed to replace oil.

Wear
All component wear rates are normal.

Contamination
There is a high amount of particulates present in the oil.

Fluid Condition
The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORMATION		method	limit/base	current	history1	history2
Sample Number		Client Info		**MHI017768**	MHI022539	MHI009060
Sample Date		Client Info		**27 Apr 2020**	17 Jun 2019	10 Oct 2018
Machine Age	hrs	Client Info		**0**	0	0
Oil Age	hrs	Client Info		**0**	0	0
Oil Changed		Client Info		**N/A**	N/A	N/A
Sample Status				**ABNORMAL**	ABNORMAL	ABNORMAL

WEAR METALS		method	limit/base	current	history1	history2
PQ		ASTM D8184	>200	**17**	18	24
Iron	ppm	ASTM D5185m	>200	**32**	22	24
Chromium	ppm	ASTM D5185m		**<1**	<1	<1
Nickel	ppm	ASTM D5185m		**0**	<1	0
Titanium	ppm	ASTM D5185m		**0**	0	0
Silver	ppm	ASTM D5185m		**0**	0	0
Aluminum	ppm	ASTM D5185m		**0**	<1	<1
Lead	ppm	ASTM D5185m		**0**	<1	0
Copper	ppm	ASTM D5185m	>75	**2**	1	2
Tin	ppm	ASTM D5185m		**<1**	<1	<1
Antimony	ppm	ASTM D5185m		**0**	0	0
Vanadium	ppm	ASTM D5185m		**0**	0	0
Cadmium	ppm	ASTM D5185m		**0**	0	0

ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		**<1**	0	<1
Barium	ppm	ASTM D5185m		**0**	0	0
Molybdenum	ppm	ASTM D5185m		**<1**	<1	3
Manganese	ppm	ASTM D5185m		**<1**	<1	<1
Magnesium	ppm	ASTM D5185m		**0**	0	0
Calcium	ppm	ASTM D5185m		**<1**	0	0
Phosphorus	ppm	ASTM D5185m		**375**	312	301
Zinc	ppm	ASTM D5185m		**0**	2	3
Sulfur	ppm	ASTM D5185m		**4962**	3759	6018

CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>+30	**2**	3	3
Sodium	ppm	ASTM D5185m		**<1**	<1	<1
Potassium	ppm	ASTM D5185m	>20	**0**	0	1
Water	%	ASTM D6304	>0.1	**0.004**	0.007	0.012
ppm Water	ppm	ASTM D6304	>1000	**49.9**	70	120

FLUID CLEANLINESS		method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647		**73834**	41150	92627
Particles >6µm		ASTM D7647	>5000	▲ **16486**	▲ 9029	▲ 23560
Particles >14µm		ASTM D7647	>640	▲ **724**	▲ 649	▲ 1219
Particles >21µm		ASTM D7647	>160	▲ **180**	147	▲ 257
Particles >38µm		ASTM D7647	>40	**6**	5	8
Particles >71µm		ASTM D7647	>10	**0**	0	1
Oil Cleanliness		ISO 4406 (c)	>--/19/16	▲ **23/21/17**	▲ 23/20/17	▲ 24/22/17

DIAMOND WTG ENGINEERING & SERVICES, INC.
a group company of MITSUBISHI HEAVY INDUSTRIES, LTD.

OIL ANALYSIS REPORT

Particle Trend

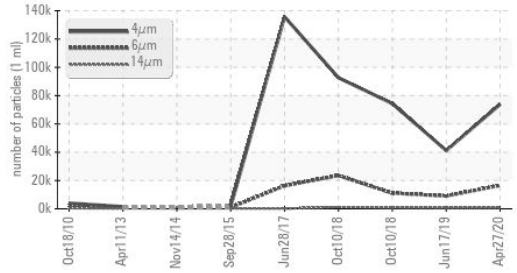

Water (KF)

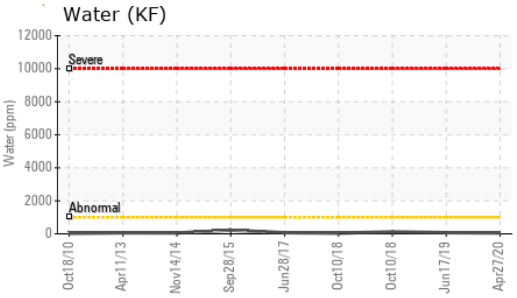

PQ

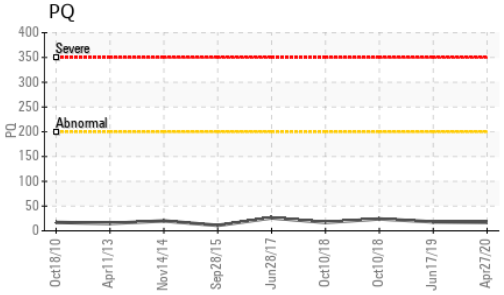

Water (KF)

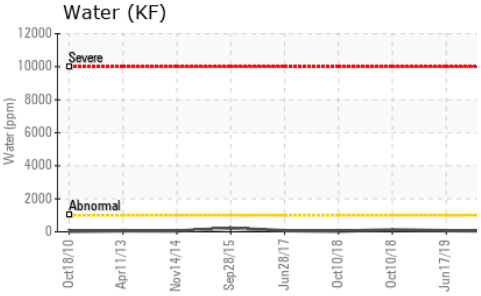

Viscosity @ 40°C

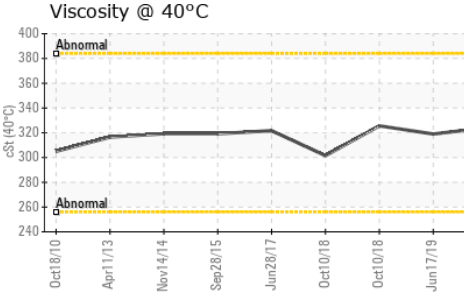

FLUID DEGRADATION		method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		**0.855**	0.884	1.023

VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	**LIGHT**	NONE	LIGHT
Yellow Metal	scalar	*Visual	NONE	**NONE**	NONE	NONE
Precipitate	scalar	*Visual	NONE	**NONE**	NONE	NONE
Silt	scalar	*Visual	NONE	**NONE**	NONE	NONE
Debris	scalar	*Visual	NONE	**NONE**	LIGHT	▲ MODER
Sand/Dirt	scalar	*Visual	NONE	**NONE**	NONE	NONE
Appearance	scalar	*Visual	NORML	**NORML**	NORML	NORML
Odor	scalar	*Visual	NORML	**NORML**	NORML	NORML
Emulsified Water	scalar	*Visual	>0.1	**NEG**	NEG	NEG
Free Water	scalar	*Visual		**NEG**	NEG	NEG

FLUID PROPERTIES		method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445		**324**	319	325.6

SAMPLE IMAGES	method	limit/base	current	history1	history2
Color					
Bottom					

GRAPHS

Ferrous Alloys

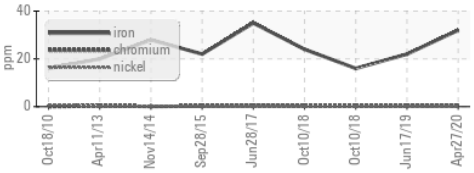

Non-ferrous Metals

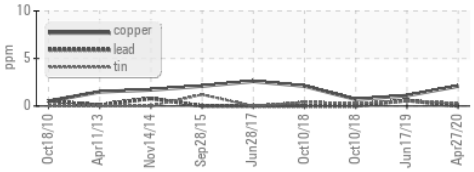

Viscosity @ 40°C

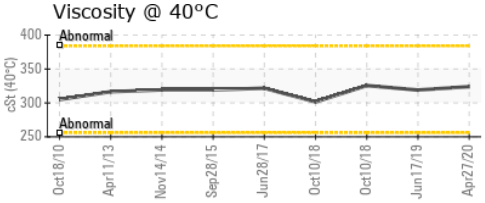

Particle Count

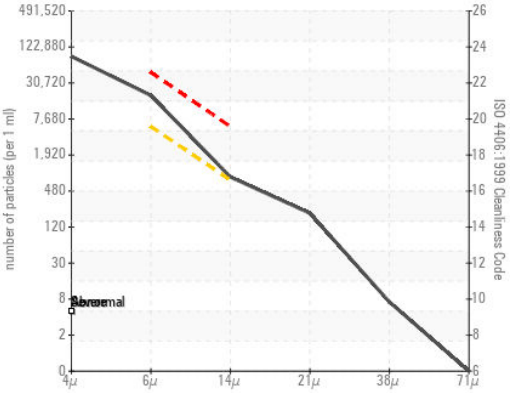

Acid Number

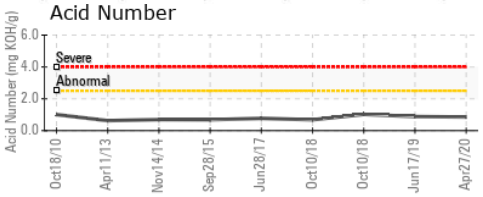

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : MHI017768 **Received** : 12 May 2020
Lab Number : 04975236 **Diagnosed** : 13 May 2020
Unique Number : 9025378 **Diagnostician** : Jonathan Hester
Test Package : IND 2 (Additional Tests: KF, PQ, PrtCount)

To discuss this sample report, contact Customer Service at 1-800-237-1369.
** - Denotes test methods that are outside of the ISO 17025 scope of accreditation.*
Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

DIAMOND WTG - CAPROCK SITE - MPS CAP
PO BOX 44
SAN JON, NM
US 88434
Contact: SANTIAGO ROMERO
Santiago.Romero@Diamondwtg.com
T:
F: (575)576-9472