PROBLEM SUMMARY

Sample Rating Trend

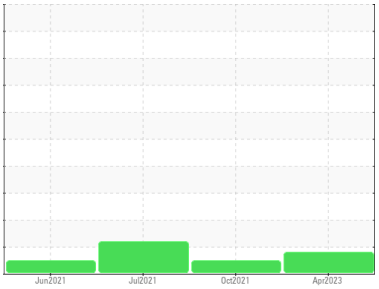

ISO

Area
FRONTIER II [200006776]
Machine Id
49WEA86912
Component
Wind Turbine Gearbox
Fluid
FUCHS RENOLIN CLP ISO 320 (--- LTR)

COMPONENT CONDITION SUMMARY

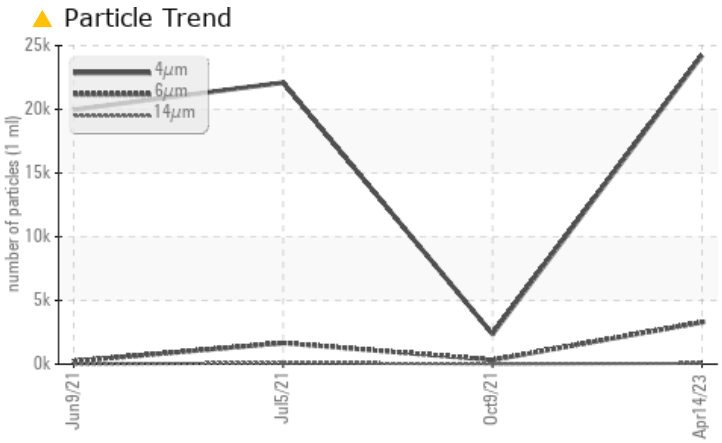

RECOMMENDATION

No corrective action is recommended at this time.
Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS

				ATTENTION	NORMAL	ABNORMAL
Sample Status						
Particles >6µm		ASTM D7647	>2500	▲ **3287**	330	▲ 1662
Oil Cleanliness		ISO 4406 (c)	>--/18/15	▲ **22/19/13**	18/16/12	▲ 22/18/14

Customer Id: NORDEX
Sample No.: NX05867859
Lab Number: 05867859
Test Package: IND 2

To manage this report scan the QR code

To discuss the diagnosis or test data:
Doug Bogart +1 (800)237-1369 x4016
dougb@wearcheckusa.com

To change component or sample information:
Customer Service +1 1-800-237-1369
customerservice@wearcheck.com

RECOMMENDED ACTIONS

There are no recommended actions for this sample.

HISTORICAL DIAGNOSIS

09 Oct 2021 Diag: Angela Borella

NORMAL

Resample at the next service interval to monitor.All component wear rates are normal. The amount and size of particulates present in the system are acceptable. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

view report

05 Jul 2021 Diag: Jonathan Hester

ISO

We recommend you service the filters on this component if applicable. Resample at the next service interval to monitor.All component wear rates are normal. There is a high amount of particulates present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

view report

09 Jun 2021 Diag: Jonathan Hester

NORMAL

Resample at the next service interval to monitor.All component wear rates are normal. There is no indication of any contamination in the oil. The amount and size of particulates present in the system are acceptable. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

view report

OIL ANALYSIS REPORT

Sample Rating Trend

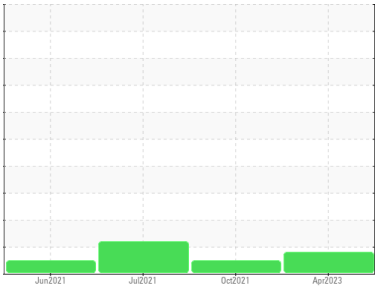

ISO

Area
FRONTIER II [200006776]
Machine Id
49WEA86912
Component
Wind Turbine Gearbox
Fluid
FUCHS RENOLIN CLP ISO 320 (--- LTR)

DIAGNOSIS

Recommendation
No corrective action is recommended at this time. Resample at the next service interval to monitor.

Wear
All component wear rates are normal.

Contamination
There is a moderate amount of silt (particulates < 14 microns in size) present in the oil.

Fluid Condition
The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORMATION		method	limit/base	current	history1	history2
Sample Number		Client Info		**NX05867859**	NX008447	NX008425
Sample Date		Client Info		**14 Apr 2023**	09 Oct 2021	05 Jul 2021
Machine Age	hrs	Client Info		**10312**	0	0
Oil Age	hrs	Client Info		**0**	0	0
Oil Changed		Client Info		**N/A**	N/A	N/A
Sample Status				**ATTENTION**	NORMAL	ABNORMAL

WEAR METALS		method	limit/base	current	history1	history2
PQ		ASTM D8184	>80	**13**	23	20
Iron	ppm	ASTM D5185m	>150	**17**	8	7
Chromium	ppm	ASTM D5185m	>5	**<1**	0	0
Nickel	ppm	ASTM D5185m	>10	**0**	<1	0
Titanium	ppm	ASTM D5185m	>10	**0**	0	0
Silver	ppm	ASTM D5185m		**0**	<1	0
Aluminum	ppm	ASTM D5185m	>10	**<1**	<1	<1
Lead	ppm	ASTM D5185m	>20	**0**	0	0
Copper	ppm	ASTM D5185m	>50	**2**	1	<1
Tin	ppm	ASTM D5185m	>10	**0**	<1	0
Antimony	ppm	ASTM D5185m	>5	**---**	0	0
Vanadium	ppm	ASTM D5185m		**0**	0	0
Cadmium	ppm	ASTM D5185m		**0**	0	0

ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		**3**	12	6
Barium	ppm	ASTM D5185m		**0**	0	0
Molybdenum	ppm	ASTM D5185m		**0**	0	0
Manganese	ppm	ASTM D5185m		**<1**	<1	0
Magnesium	ppm	ASTM D5185m		**0**	<1	0
Calcium	ppm	ASTM D5185m		**6**	13	2
Phosphorus	ppm	ASTM D5185m		**162**	112	196
Zinc	ppm	ASTM D5185m		**0**	0	0
Sulfur	ppm	ASTM D5185m		**6123**	4883	4246

CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>50	**4**	4	3
Sodium	ppm	ASTM D5185m	>20	**3**	1	<1
Potassium	ppm	ASTM D5185m	>20	**0**	<1	0
Water	%	ASTM D6304	>0.05	**0.008**	0.006	0.007
ppm Water	ppm	ASTM D6304	>500	**85.1**	65.8	79.2

FLUID CLEANLINESS	method	limit/base	current	history1	history2
Particles >4µm	ASTM D7647		**24224**	2353	22097
Particles >6µm	ASTM D7647	>2500	▲ **3287**	330	▲ 1662
Particles >14µm	ASTM D7647	>320	**64**	24	▲ 91
Particles >21µm	ASTM D7647	>80	**12**	4	▲ 18
Particles >38µm	ASTM D7647	>20	**1**	0	2
Particles >71µm	ASTM D7647	>4	**0**	0	0
Oil Cleanliness	ISO 4406 (c)	>--/18/15	▲ **22/19/13**	18/16/12	▲ 22/18/14

OIL ANALYSIS REPORT

Particle Trend

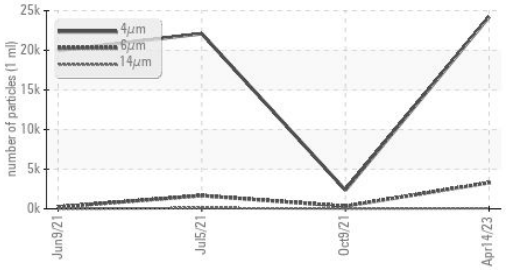

Water

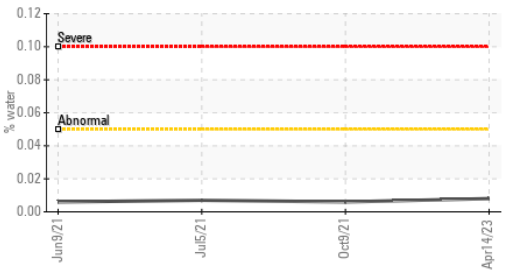

PQ

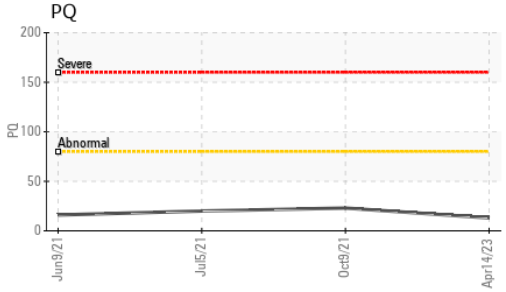

Water

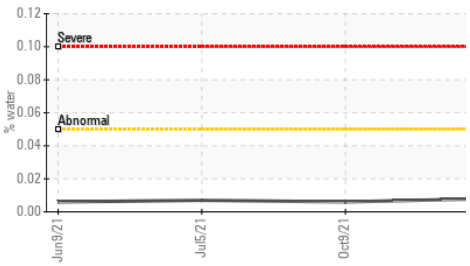

Viscosity @ 40°C

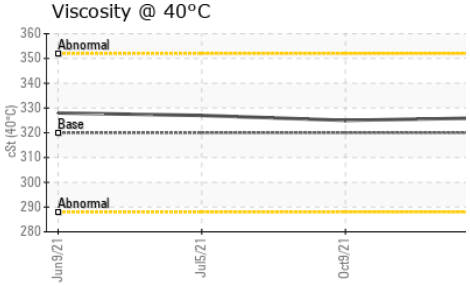

FLUID DEGRADATION		method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		**0.57**	0.507	0.493

VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	**NONE**	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	**NONE**	NONE	NONE
Precipitate	scalar	*Visual	NONE	**NONE**	NONE	NONE
Silt	scalar	*Visual	NONE	**NONE**	NONE	NONE
Debris	scalar	*Visual	NONE	**NONE**	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	**NONE**	NONE	NONE
Appearance	scalar	*Visual	NORML	**NORML**	NORML	NORML
Odor	scalar	*Visual	NORML	**NORML**	NORML	NORML
Emulsified Water	scalar	*Visual	>0.05	**NEG**	NEG	NEG
Free Water	scalar	*Visual		**NEG**	NEG	NEG

FLUID PROPERTIES		method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445	320	**326**	325	327

SAMPLE IMAGES	method	limit/base	current	history1	history2
Color					
Bottom					

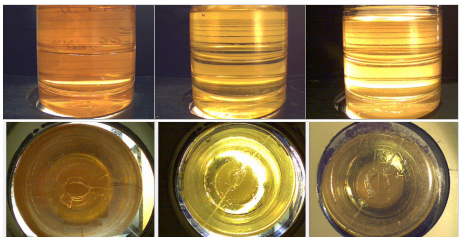

GRAPHS

Ferrous Alloys

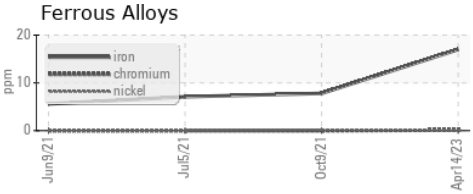

Non-ferrous Metals

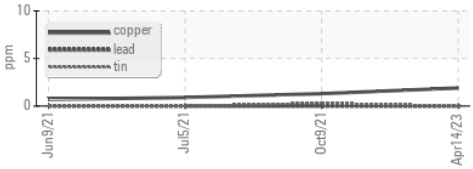

Viscosity @ 40°C

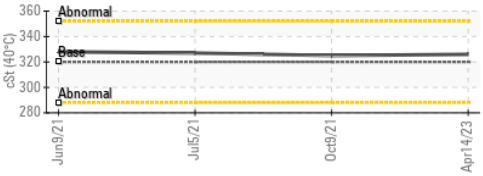

Particle Count

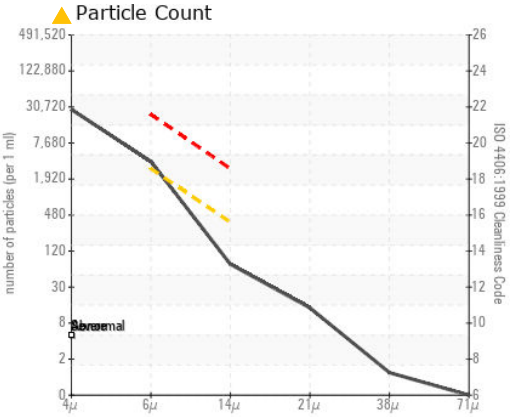

Acid Number

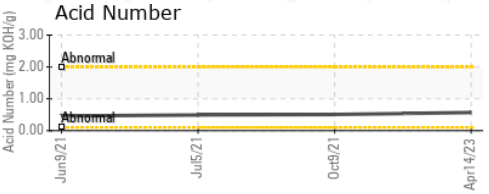

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : NX05867859 **Received** : 08 Jun 2023
Lab Number : 05867859 **Diagnosed** : 11 Jun 2023
Unique Number : 10507643 **Diagnostician** : Doug Bogart
Test Package : IND 2 (Additional Tests: KF, PQ, PrtCount)

To discuss this sample report, contact Customer Service at 1-800-237-1369.
** - Denotes test methods that are outside of the ISO 17025 scope of accreditation.*
Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

NORDEX USA - Chicago
300 SOUTH WACKER DRIVE, SUITE 1500
CHICAGO, IL
US 60606
Contact: DEVIN LINEHAN
DLinehan@nordex-online.com
T: (312)386-4124
F: (312)386-7102