OIL ANALYSIS REPORT

Sample Rating Trend

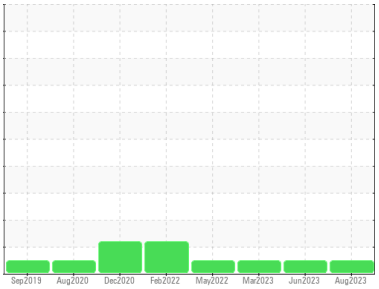

NORMAL

Machine Id
SPLITTER PUMP (S/N 129)
Component
Hydraulic System
Fluid
NOT GIVEN (--- GAL)

DIAGNOSIS

Recommendation
Resample at the next service interval to monitor. Please specify the component make and model with your next sample. Please specify the brand, type, and viscosity of the oil on your next sample.

Wear
All component wear rates are normal.

Contamination
The system cleanliness is acceptable for your target ISO 4406 cleanliness code. The system and fluid cleanliness is acceptable.

Fluid Condition
The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORMATION		method	limit/base	current	history1	history2
Sample Number		Client Info		**PTK0004438**	PTK0002766	PTK0003894
Sample Date		Client Info		**22 Aug 2023**	01 Jun 2023	01 Mar 2023
Machine Age	mths	Client Info		**0**	0	0
Oil Age	mths	Client Info		**0**	0	0
Oil Changed		Client Info		**Not Changd**	Not Changd	N/A
Sample Status				**NORMAL**	NORMAL	NORMAL

WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>20	**<1**	<1	<1
Chromium	ppm	ASTM D5185m	>10	**0**	0	0
Nickel	ppm	ASTM D5185m	>10	**0**	0	0
Titanium	ppm	ASTM D5185m		**0**	0	0
Silver	ppm	ASTM D5185m		**0**	0	0
Aluminum	ppm	ASTM D5185m	>10	**<1**	0	<1
Lead	ppm	ASTM D5185m	>10	**0**	0	0
Copper	ppm	ASTM D5185m	>75	**<1**	0	<1
Tin	ppm	ASTM D5185m	>10	**0**	0	0
Vanadium	ppm	ASTM D5185m		**0**	0	0
Cadmium	ppm	ASTM D5185m		**0**	0	0

ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		**0**	1	1
Barium	ppm	ASTM D5185m		**2**	0	0
Molybdenum	ppm	ASTM D5185m		**115**	106	100
Manganese	ppm	ASTM D5185m		**0**	0	0
Magnesium	ppm	ASTM D5185m		**1**	1	2
Calcium	ppm	ASTM D5185m		**62**	60	56
Phosphorus	ppm	ASTM D5185m		**417**	453	394
Zinc	ppm	ASTM D5185m		**452**	467	399
Sulfur	ppm	ASTM D5185m		**1627**	1713	1464

CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>20	**1**	2	2
Sodium	ppm	ASTM D5185m		**0**	0	<1
Potassium	ppm	ASTM D5185m	>20	**<1**	0	0

FLUID CLEANLINESS		method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647		**2039**	1675	1378
Particles >6µm		ASTM D7647	>2500	**555**	444	269
Particles >14µm		ASTM D7647	>320	**65**	24	24
Particles >21µm		ASTM D7647	>80	**21**	7	7
Particles >38µm		ASTM D7647	>20	**1**	0	0
Particles >71µm		ASTM D7647	>4	**0**	0	0
Oil Cleanliness		ISO 4406 (c)	>18/15	**16/13**	16/12	15/12

FLUID DEGRADATION		method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		**0.63**	0.61	0.62

OIL ANALYSIS REPORT

Particle Trend

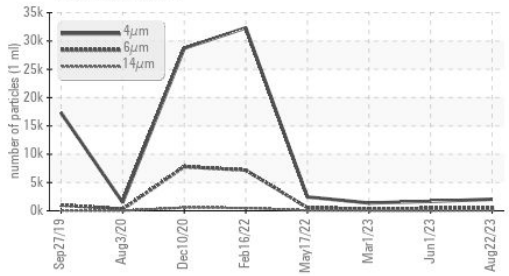

Acid Number

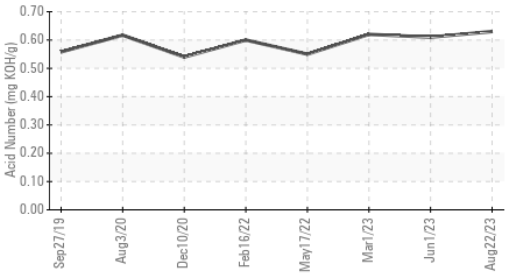

Viscosity @ 40°C

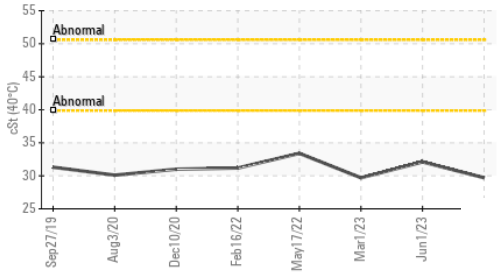

Particle Trend

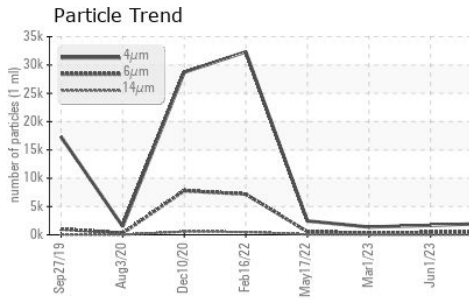

VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	**NONE**	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	**NONE**	NONE	NONE
Precipitate	scalar	*Visual	NONE	**NONE**	NONE	NONE
Silt	scalar	*Visual	NONE	**NONE**	NONE	NONE
Debris	scalar	*Visual	NONE	**NONE**	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	**NONE**	NONE	NONE
Appearance	scalar	*Visual	NORML	**NORML**	NORML	NORML
Odor	scalar	*Visual	NORML	**NORML**	NORML	NORML
Emulsified Water	scalar	*Visual	>0.1	**NEG**	NEG	NEG
Free Water	scalar	*Visual		**NEG**	NEG	NEG

FLUID PROPERTIES		method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445		**29.7**	32.1	29.7

SAMPLE IMAGES	method	limit/base	current	history1	history2
Color			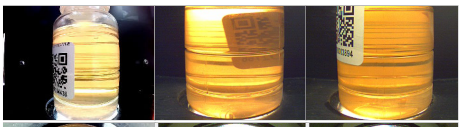		
Bottom			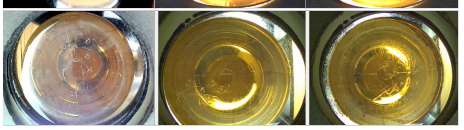		

GRAPHS

Ferrous Alloys

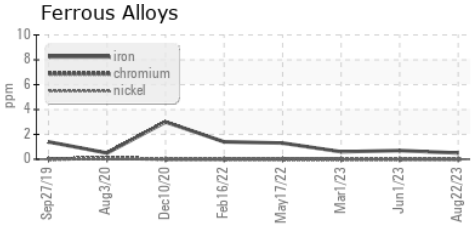

Non-ferrous Metals

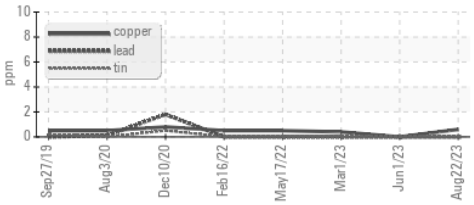

Viscosity @ 40°C

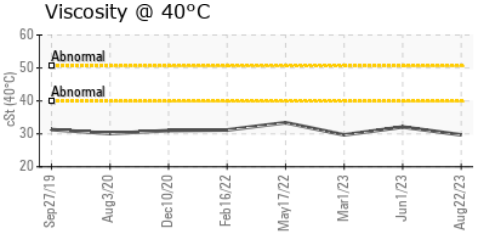

Particle Count

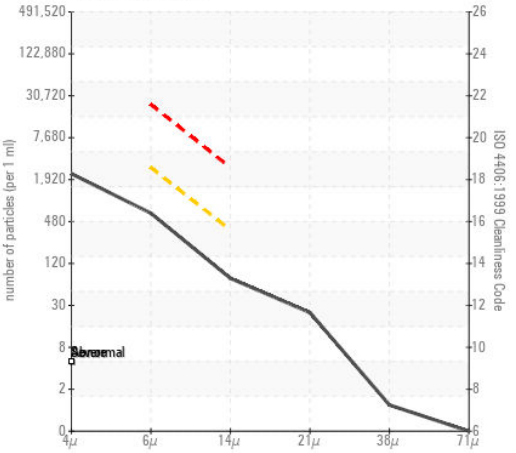

Acid Number

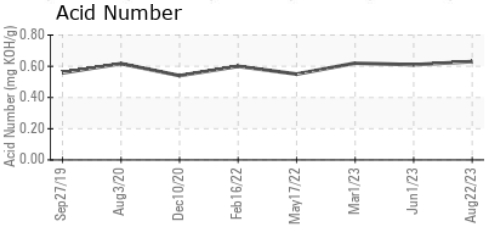

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : PTK0004438
Lab Number : 05938249
Unique Number : 10628861
Test Package : MOB 2

Received : 30 Aug 2023
Diagnosed : 31 Aug 2023
Diagnostician : Wes Davis

To discuss this sample report, contact Customer Service at 1-800-237-1369.
** - Denotes test methods that are outside of the ISO 17025 scope of accreditation.*
Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

MUTUAL MATERIALS
7414 S 206TH ST
KENT, WA
US 98032
Contact: SUTTON CHRISTIANSON
schristianson@mutualmaterials.com
T: (253)395-7376
F: