OIL ANALYSIS REPORT

Sample Rating Trend

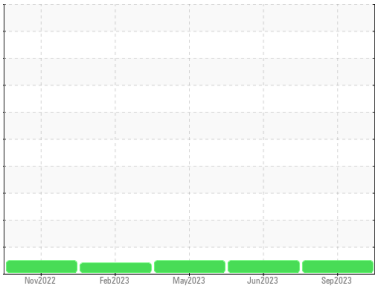

NORMAL

Area
[772297]
Machine Id
LCT-1
Component
Diesel Engine
Fluid
DIESEL ENGINE OIL SAE 15W40 (--- GAL)

DIAGNOSIS

Recommendation
No corrective action is recommended at this time. Resample at the next service interval to monitor. Please specify the component make and model with your next sample.

Wear
All component wear rates are normal.

Contamination
Fuel content negligible. There is no indication of any contamination in the oil.

Fluid Condition
The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

SAMPLE INFORMATION		method	limit/base	current	history1	history2
Sample Number		Client Info		**WC0816964**	WC0816965	WC0793393
Sample Date		Client Info		**11 Sep 2023**	21 Jun 2023	24 May 2023
Machine Age	hrs	Client Info		**2708**	2686	2673
Oil Age	hrs	Client Info		**91**	69	56
Oil Changed		Client Info		**Not Changd**	Not Changd	Not Changd
Sample Status				**NORMAL**	NORMAL	NORMAL

CONTAMINATION		method	limit/base	current	history1	history2
Glycol		WC Method		**NEG**	NEG	NEG

WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>100	**1**	4	3
Chromium	ppm	ASTM D5185m	>20	**0**	0	0
Nickel	ppm	ASTM D5185m	>4	**0**	0	0
Titanium	ppm	ASTM D5185m		**<1**	<1	0
Silver	ppm	ASTM D5185m	>3	**0**	0	0
Aluminum	ppm	ASTM D5185m	>20	**0**	1	7
Lead	ppm	ASTM D5185m	>40	**0**	0	0
Copper	ppm	ASTM D5185m	>330	**0**	<1	0
Tin	ppm	ASTM D5185m	>15	**0**	<1	0
Vanadium	ppm	ASTM D5185m		**0**	<1	0
Cadmium	ppm	ASTM D5185m		**0**	0	0

ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	250	**107**	108	104
Barium	ppm	ASTM D5185m	10	**0**	0	0
Molybdenum	ppm	ASTM D5185m	100	**0**	<1	2
Manganese	ppm	ASTM D5185m		**<1**	<1	0
Magnesium	ppm	ASTM D5185m	450	**784**	748	811
Calcium	ppm	ASTM D5185m	3000	**1395**	1397	1470
Phosphorus	ppm	ASTM D5185m	1150	**1124**	1068	1151
Zinc	ppm	ASTM D5185m	1350	**1288**	1213	1368
Sulfur	ppm	ASTM D5185m	4250	**4430**	4623	4934

CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	**3**	3	2
Sodium	ppm	ASTM D5185m	>158	**3**	3	3
Potassium	ppm	ASTM D5185m	>20	**3**	5	2
Fuel	%	ASTM D3524	>5	**0.6**	<1.0	<1.0

INFRA-RED		method	limit/base	current	history1	history2
Soot %	%	*ASTM D7844	>3	**0.1**	0.1	0.1
Nitration	Abs/cm	*ASTM D7624	>20	**6.4**	6.5	6.5
Sulfation	Abs/.1mm	*ASTM D7415	>30	**17.7**	18.1	18.7

FLUID DEGRADATION		method	limit/base	current	history1	history2
Oxidation	Abs/.1mm	*ASTM D7414	>25	**11.4**	11.7	12.1
Base Number (BN)	mg KOH/g	ASTM D2896	8.5	**8.4**	9.0	9.3

OIL ANALYSIS REPORT

Fuel Dilution

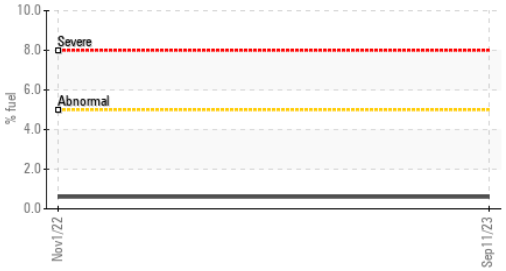

Base Number

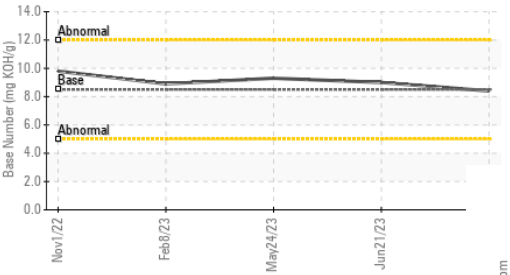

Viscosity @ 100°C

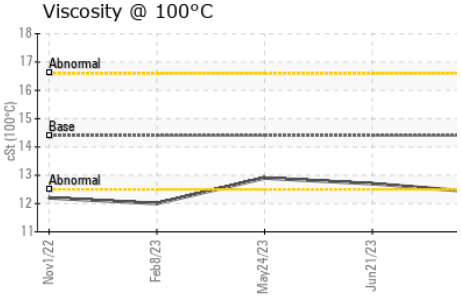

VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	**NONE**	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	**NONE**	NONE	NONE
Precipitate	scalar	*Visual	NONE	**NONE**	NONE	NONE
Silt	scalar	*Visual	NONE	**NONE**	NONE	NONE
Debris	scalar	*Visual	NONE	**NONE**	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	**NONE**	NONE	NONE
Appearance	scalar	*Visual	NORML	**NORML**	NORML	NORML
Odor	scalar	*Visual	NORML	**NORML**	NORML	NORML
Emulsified Water	scalar	*Visual	>0.2	**NEG**	NEG	NEG
Free Water	scalar	*Visual		**NEG**	NEG	NEG

FLUID PROPERTIES		method	limit/base	current	history1	history2
Visc @ 100°C	cSt	ASTM D445	14.4	**12.4**	12.7	12.9

GRAPHS

Iron (ppm)

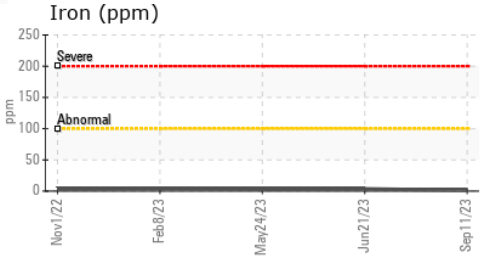

Lead (ppm)

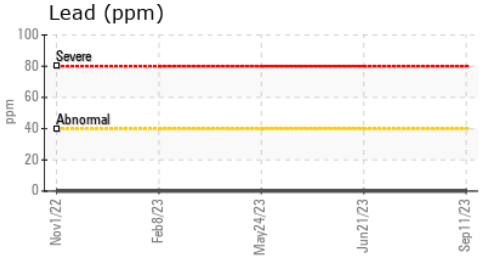

Aluminum (ppm)

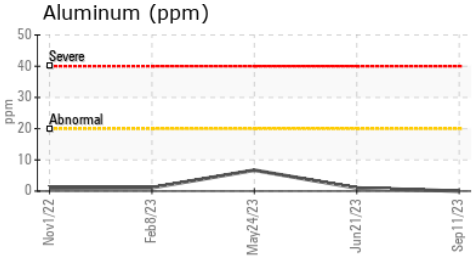

Chromium (ppm)

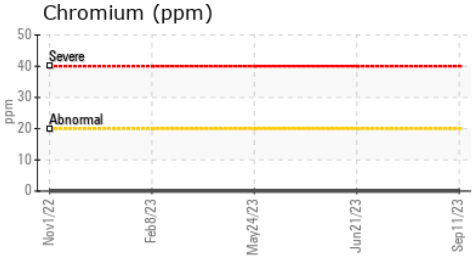

Copper (ppm)

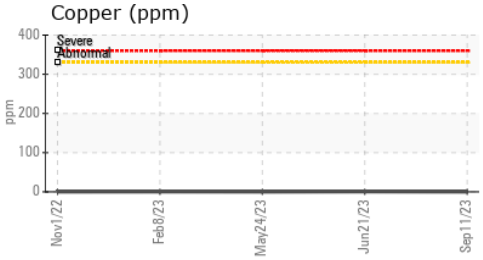

Silicon (ppm)

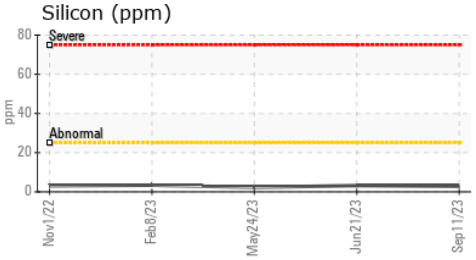

Viscosity @ 100°C

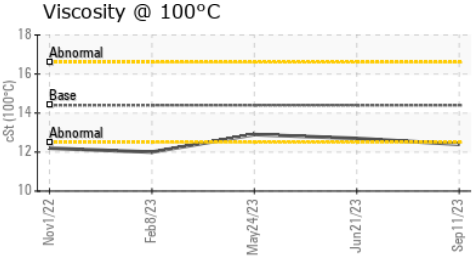

Base Number

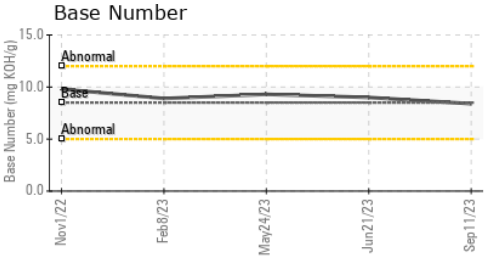

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : WC0816964 **Received** : 26 Sep 2023
Lab Number : 05961686 **Diagnosed** : 28 Sep 2023
Unique Number : 10662899 **Diagnostician** : Wes Davis
Test Package : MOB 1 (Additional Tests: FuelDilution, PercentFuel, TBN)

To discuss this sample report, contact Customer Service at 1-800-237-1369.
** - Denotes test methods that are outside of the ISO 17025 scope of accreditation.*
Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

AES USA - EVERETT
3003 W CASINO RD BLDG 40-26 DR S2
EVERETT, WA
US 98204-1910
Contact: TIM FELLER
tim.feller@aes-gse.com
T: (425)266-4649
F: