# PROBLEM SUMMARY

Sample Rating Trend




ISO

Machine Id
## BUSCH WENDYS PUMP 3 (DOWNSTAIRS) (S/N 5593913)
Component
**Vacuum Pump**
Fluid
**USPI VAC 100 (--- GAL)**

## COMPONENT CONDITION SUMMARY

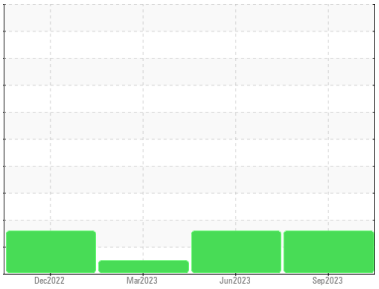


## RECOMMENDATION

We recommend you service the filters on this component. Resample at the next service interval to monitor.

## PROBLEMATIC TEST RESULTS

| Sample Status | | | | ABNORMAL | ABNORMAL | NORMAL |
|---|---|---|---|---|---|---|
| Particles >4µm | | ASTM D7647 | >5000 | ▲ **52577** | ▲ 41713 | 111 |
| Particles >6µm | | ASTM D7647 | >1300 | ▲ **10312** | ▲ 7520 | 27 |
| Particles >14µm | | ASTM D7647 | >160 | ▲ **195** | ▲ 344 | 4 |
| Oil Cleanliness | | ISO 4406 (c) | >19/17/14 | ▲ **23/21/15** | ▲ 23/20/16 | 14/12/9 |

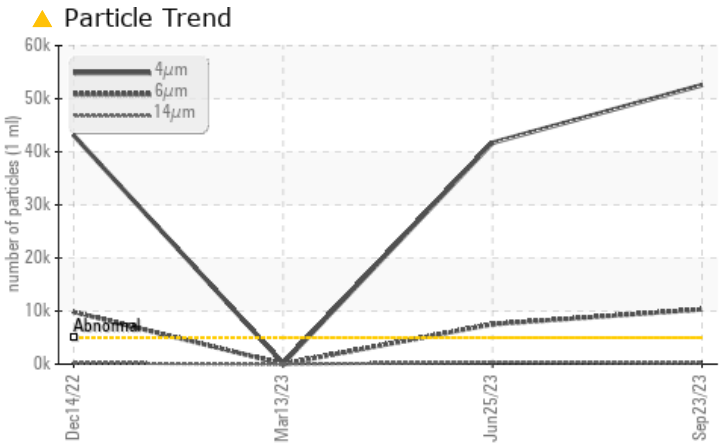**Customer Id:** TYSAMAPRO
**Sample No.:** USPM29750
**Lab Number:** 05961788
**Test Package:** IND 2

*To manage this report scan the QR code*

*To discuss the diagnosis or test data:*
Doug Bogart +1 (800)237-1369 x4016
dougb@wearcheckusa.com

*To change component or sample information:*
Customer Service +1 1-800-237-1369
customerservice@wearcheck.com

## RECOMMENDED ACTIONS

| Action | Status | Date | Done By | Description |
|---|---|---|---|---|
| Change Filter | --- | --- | ? | We recommend you service the filters on this component. |

## HISTORICAL DIAGNOSIS

**25 Jun 2023 Diag: Doug Bogart**

ISO

We recommend you service the filters on this component. Resample at the next service interval to monitor.All component wear rates are normal. There is a high amount of particulates present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

view report

**13 Mar 2023 Diag: Doug Bogart**

NORMAL

Resample at the next service interval to monitor.All component wear rates are normal. There is no indication of any contamination in the oil. The amount and size of particulates present in the system are acceptable. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

view report

**14 Dec 2022 Diag: Jonathan Hester**

ISO

We recommend you service the filters on this component. Resample at the next service interval to monitor.All component wear rates are normal. There is a high amount of particulates present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

view report

# OIL ANALYSIS REPORT

Sample Rating Trend




ISO

Machine Id
## BUSCH WENDYS PUMP 3 (DOWNSTAIRS) (S/N 5593913)
Component
**Vacuum Pump**
Fluid
**USPI VAC 100 (--- GAL)**

## DIAGNOSIS

**Recommendation**
We recommend you service the filters on this component. Resample at the next service interval to monitor.

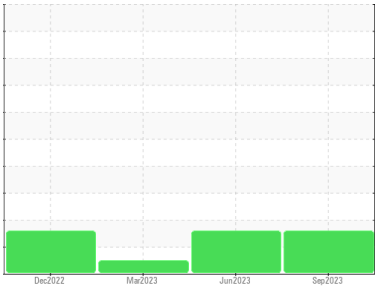**Wear**
All component wear rates are normal.

**Contamination**
There is a high amount of particulates present in the oil.

**Fluid Condition**
The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

| SAMPLE INFORMATION | | method | limit/base | current | history1 | history2 |
|---|---|---|---|---|---|---|
| Sample Number | | Client Info | | **USPM29750** | USPM27171 | USPM27594 |
| Sample Date | | Client Info | | **23 Sep 2023** | 25 Jun 2023 | 13 Mar 2023 |
| Machine Age | hrs | Client Info | | **0** | 0 | 0 |
| Oil Age | hrs | Client Info | | **0** | 0 | 0 |
| Oil Changed | | Client Info | | **N/A** | N/A | N/A |
| Sample Status | | | | **ABNORMAL** | ABNORMAL | NORMAL |

| WEAR METALS | | method | limit/base | current | history1 | history2 |
|---|---|---|---|---|---|---|
| Iron | ppm | ASTM D5185m | >20 | **16** | 6 | 2 |
| Chromium | ppm | ASTM D5185m | >20 | **0** | <1 | 0 |
| Nickel | ppm | ASTM D5185m | >20 | **0** | <1 | 0 |
| Titanium | ppm | ASTM D5185m | | **<1** | 0 | <1 |
| Silver | ppm | ASTM D5185m | | **0** | 0 | 0 |
| Aluminum | ppm | ASTM D5185m | >20 | **3** | 2 | 1 |
| Lead | ppm | ASTM D5185m | >20 | **0** | 1 | 0 |
| Copper | ppm | ASTM D5185m | >20 | **<1** | <1 | 0 |
| Tin | ppm | ASTM D5185m | >20 | **<1** | 2 | <1 |
| Vanadium | ppm | ASTM D5185m | | **<1** | 0 | <1 |
| Cadmium | ppm | ASTM D5185m | | **<1** | 0 | 0 |

| ADDITIVES | | method | limit/base | current | history1 | history2 |
|---|---|---|---|---|---|---|
| Boron | ppm | ASTM D5185m | 0 | **0** | <1 | 0 |
| Barium | ppm | ASTM D5185m | 0 | **0** | 0 | 0 |
| Molybdenum | ppm | ASTM D5185m | 0 | **0** | 0 | <1 |
| Manganese | ppm | ASTM D5185m | | **<1** | <1 | <1 |
| Magnesium | ppm | ASTM D5185m | 0 | **0** | <1 | 0 |
| Calcium | ppm | ASTM D5185m | 0 | **0** | 0 | 1 |
| Phosphorus | ppm | ASTM D5185m | 1800 | **713** | 777 | 656 |
| Zinc | ppm | ASTM D5185m | 0 | **0** | 0 | 5 |
| Sulfur | ppm | ASTM D5185m | 0 | **27** | 33 | 0 |

| CONTAMINANTS | | method | limit/base | current | history1 | history2 |
|---|---|---|---|---|---|---|
| Silicon | ppm | ASTM D5185m | >15 | **5** | 5 | 3 |
| Sodium | ppm | ASTM D5185m | | **<1** | <1 | <1 |
| Potassium | ppm | ASTM D5185m | >20 | **2** | 3 | <1 |
| Water | % | ASTM D6304 | >.1 | **0.044** | 0.059 | 0.033 |
| ppm Water | ppm | ASTM D6304 | >1000 | **447.7** | 593.5 | 330.6 |

| FLUID CLEANLINESS | | method | limit/base | current | history1 | history2 |
|---|---|---|---|---|---|---|
| Particles >4µm | | ASTM D7647 | >5000 | ▲ **52577** | ▲ 41713 | 111 |
| Particles >6µm | | ASTM D7647 | >1300 | ▲ **10312** | ▲ 7520 | 27 |
| Particles >14µm | | ASTM D7647 | >160 | ▲ **195** | ▲ 344 | 4 |
| Particles >21µm | | ASTM D7647 | >40 | **24** | 24 | 2 |
| Particles >38µm | | ASTM D7647 | >10 | **2** | 1 | 1 |
| Particles >71µm | | ASTM D7647 | >3 | **1** | 0 | 0 |
| Oil Cleanliness | | ISO 4406 (c) | >19/17/14 | ▲ **23/21/15** | ▲ 23/20/16 | 14/12/9 |

| FLUID DEGRADATION | | method | limit/base | current | history1 | history2 |
|---|---|---|---|---|---|---|
| Acid Number (AN) | mg KOH/g | ASTM D8045 | 0.05 | **0.09** | 0.18 | 0.074 |

# OIL ANALYSIS REPORT

Particle Trend




Water (KF)




Acid Number

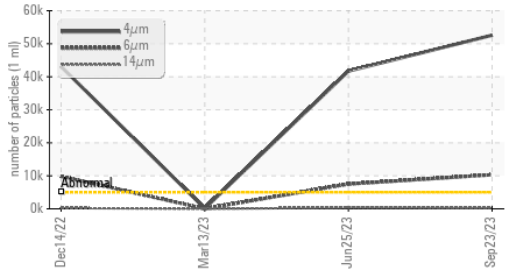


Water (KF)

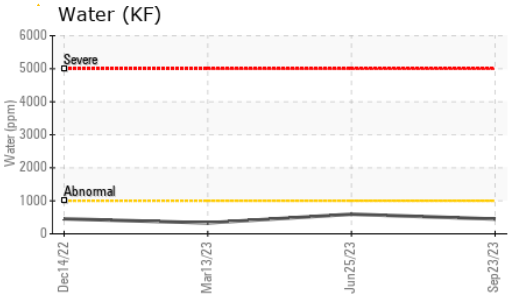


Viscosity @ 40°C

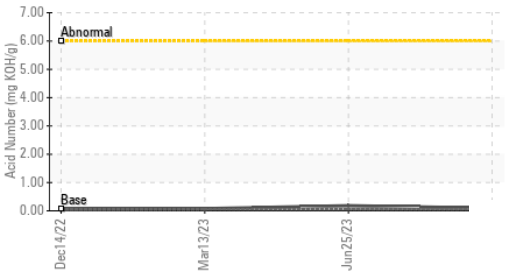


| VISUAL | | method | limit/base | current | history1 | history2 |
|---|---|---|---|---|---|---|
| White Metal | scalar | *Visual | NONE | **NONE** | NONE | NONE |
| Yellow Metal | scalar | *Visual | NONE | **NONE** | NONE | NONE |
| Precipitate | scalar | *Visual | NONE | **NONE** | NONE | NONE |
| Silt | scalar | *Visual | NONE | **NONE** | NONE | NONE |
| Debris | scalar | *Visual | NONE | **NONE** | LIGHT | NONE |
| Sand/Dirt | scalar | *Visual | NONE | **NONE** | NONE | NONE |
| Appearance | scalar | *Visual | NORML | **NORML** | NORML | NORML |
| Odor | scalar | *Visual | NORML | **NORML** | NORML | NORML |
| Emulsified Water | scalar | *Visual | >.1 | **NEG** | NEG | NEG |
| Free Water | scalar | *Visual | | **NEG** | NEG | NEG |

| FLUID PROPERTIES | | method | limit/base | current | history1 | history2 |
|---|---|---|---|---|---|---|
| Visc @ 40°C | cSt | ASTM D445 | 91 | **97.4** | 95.6 | 95.7 |
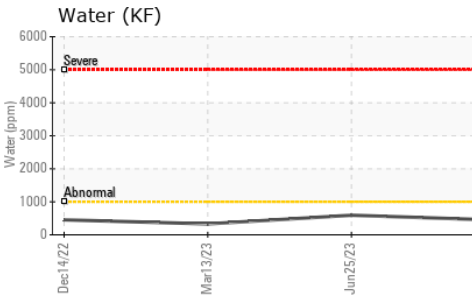
| SAMPLE IMAGES | method | limit/base | current | history1 | history2 |
|---|---|---|---|---|---|
| Color | | |  | | |
| Bottom | | | 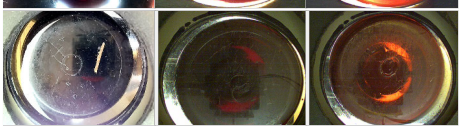 | | |

## GRAPHS

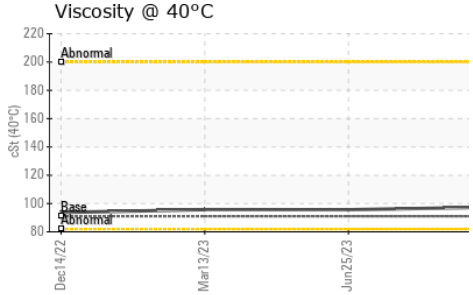Ferrous Alloys




Non-ferrous Metals




Viscosity @ 40°C

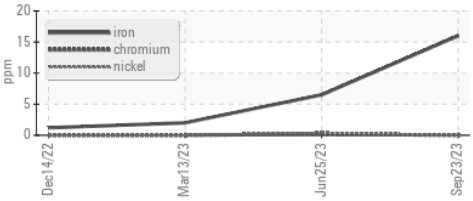


Particle Count

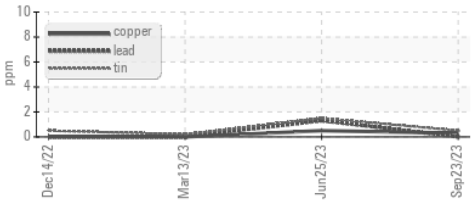


Acid Number

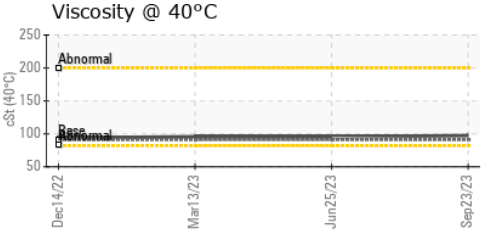


Certificate L2367

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513
**Sample No.** : USPM29750
**Lab Number** : 05961788
**Unique Number** : 10668339
**Test Package** : IND 2

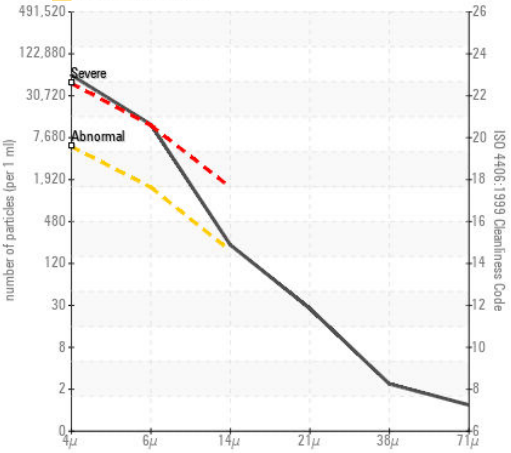**Received** : 26 Sep 2023
**Diagnosed** : 27 Sep 2023
**Diagnostician** : Doug Bogart

**TYSON -AMARILLO-PRO**

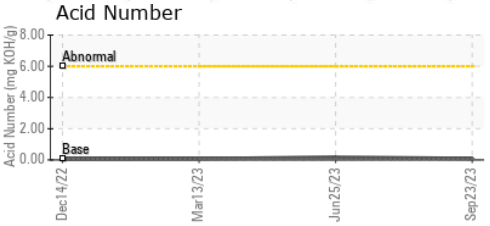AMARILLO, TX
US
Contact: SERVICE MANAGER

T:
F:

*To discuss this sample report, contact Customer Service at 1-800-237-1369.*
** - Denotes test methods that are outside of the ISO 17025 scope of accreditation.*
*Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)*