PROBLEM SUMMARY

Sample Rating Trend

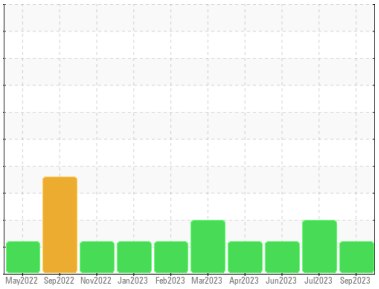

ISO

Area
HOTLINE/130 REVERSING MILL
Machine Id
130 MAIN DRIVE PINION-INACTIVE 1414-014-0230
Component
Gearbox
Fluid
CITGO EP COMPOUND ISO 800 (--- GAL)

COMPONENT CONDITION SUMMARY

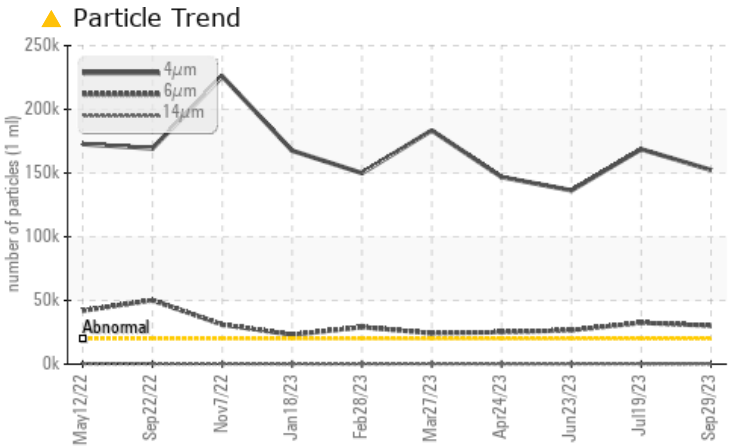

RECOMMENDATION

We recommend you service the filters on this component. We recommend an early resample to monitor this condition. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample.

PROBLEMATIC TEST RESULTS

Sample Status				ABNORMAL	SEVERE	ABNORMAL
Particles >4µm		ASTM D7647	>20000	▲ **152408**	⬢ 168692	▲ 136344
Particles >6µm		ASTM D7647	>5000	▲ **30211**	▲ 32470	▲ 26578
Oil Cleanliness		ISO 4406 (c)	>21/19/16	▲ **24/22/15**	⬢ 25/22/15	▲ 24/22/15

Customer Id: CONMUSAL
Sample No.: KFS0004887
Lab Number: 05967763
Test Package: IND 2

To manage this report scan the QR code

To discuss the diagnosis or test data:
Wes Davis +1 905-569-8600 x223
wesd@wearcheck.ca

To change component or sample information:
Customer Service +1 1-800-237-1369
customerservice@wearcheck.com

RECOMMENDED ACTIONS

Action	Status	Date	Done By	Description
Change Filter	---	---	?	We recommend you service the filters on this component.
Resample	---	---	?	We recommend an early resample to monitor this condition.
Information Required	---	---	?	NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample.

HISTORICAL DIAGNOSIS

19 Jul 2023 Diag: Wes Davis

ISO

Check seals and/or filters for points of contaminant entry. The air breather requires service. If unrated, we recommend that you replace with a suitable micron rated and/or desiccant air breather. If rated, we recommend that you service/replace the breather. We recommend you service the filters on this component. Resample in 30-45 days to monitor this situation. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample.All component wear rates are normal. There is a high amount of silt (particulates < 14 microns in size) present in the oil. The AN level is acceptable for this fluid. The oil is still serviceable provided that the contaminant(s) can be reduced to acceptable levels.

view report

23 Jun 2023 Diag: Wes Davis

ISO

We recommend you service the filters on this component. We recommend an early resample to monitor this condition. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample.All component wear rates are normal. There is a moderate amount of silt (particulates < 14 microns in size) present in the oil. The AN level is acceptable for this fluid. The oil is still serviceable provided that the contaminant(s) can be reduced to acceptable levels.

view report

24 Apr 2023 Diag: Doug Bogart

ISO

No corrective action is recommended at this time. Resample at the next service interval to monitor.All component wear rates are normal. There is a high amount of silt (particulates < 14 microns in size) present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

view report

KIMBRO FLUID SOLUTIONS

OIL ANALYSIS REPORT

Sample Rating Trend

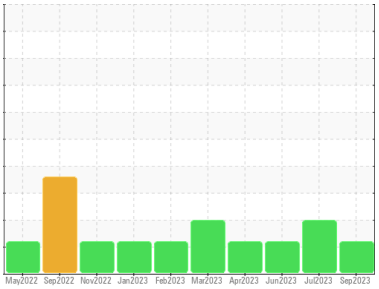

ISO

Area
HOTLINE/130 REVERSING MILL
Machine Id
130 MAIN DRIVE PINION-INACTIVE 1414-014-0230
Component
Gearbox
Fluid
CITGO EP COMPOUND ISO 800 (--- GAL)

DIAGNOSIS

Recommendation

We recommend you service the filters on this component. We recommend an early resample to monitor this condition. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample.

Wear

All component wear rates are normal.

Contamination

There is a moderate amount of silt (particulates < 14 microns in size) present in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The oil is still serviceable provided that the contaminant(s) can be reduced to acceptable levels.

SAMPLE INFORMATION		method	limit/base	current	history1	history2
Sample Number		Client Info		**KFS0004887**	KFS0003800	KFS0003855
Sample Date		Client Info		**29 Sep 2023**	19 Jul 2023	23 Jun 2023
Machine Age	hrs	Client Info		**0**	0	0
Oil Age	hrs	Client Info		**0**	0	0
Oil Changed		Client Info		**N/A**	N/A	N/A
Sample Status				**ABNORMAL**	SEVERE	ABNORMAL

WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>200	**28**	28	26
Chromium	ppm	ASTM D5185m	>15	**<1**	0	<1
Nickel	ppm	ASTM D5185m	>15	**0**	0	0
Titanium	ppm	ASTM D5185m		**0**	0	0
Silver	ppm	ASTM D5185m		**0**	0	0
Aluminum	ppm	ASTM D5185m	>25	**0**	0	<1
Lead	ppm	ASTM D5185m	>100	**0**	<1	0
Copper	ppm	ASTM D5185m	>200	**1**	1	1
Tin	ppm	ASTM D5185m	>25	**0**	0	0
Vanadium	ppm	ASTM D5185m		**0**	0	0
Cadmium	ppm	ASTM D5185m		**0**	0	0

ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		**<1**	<1	0
Barium	ppm	ASTM D5185m		**0**	2	0
Molybdenum	ppm	ASTM D5185m		**0**	0	0
Manganese	ppm	ASTM D5185m		**<1**	<1	<1
Magnesium	ppm	ASTM D5185m		**<1**	<1	0
Calcium	ppm	ASTM D5185m		**5**	4	0
Phosphorus	ppm	ASTM D5185m		**109**	118	122
Zinc	ppm	ASTM D5185m		**5**	3	0
Sulfur	ppm	ASTM D5185m		**7170**	7277	9179

CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>50	**<1**	<1	0
Sodium	ppm	ASTM D5185m		**1**	0	<1
Potassium	ppm	ASTM D5185m	>20	**<1**	0	0

FLUID CLEANLINESS		method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647	>20000	▲ **152408**	⬢ 168692	▲ 136344
Particles >6µm		ASTM D7647	>5000	▲ **30211**	▲ 32470	▲ 26578
Particles >14µm		ASTM D7647	>640	**184**	232	204
Particles >21µm		ASTM D7647	>160	**15**	26	32
Particles >38µm		ASTM D7647	>40	**1**	1	2
Particles >71µm		ASTM D7647	>10	**0**	0	0
Oil Cleanliness		ISO 4406 (c)	>21/19/16	▲ **24/22/15**	⬢ 25/22/15	▲ 24/22/15

FLUID DEGRADATION		method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		**0.46**	0.48	0.43

OIL ANALYSIS REPORT

Particle Trend

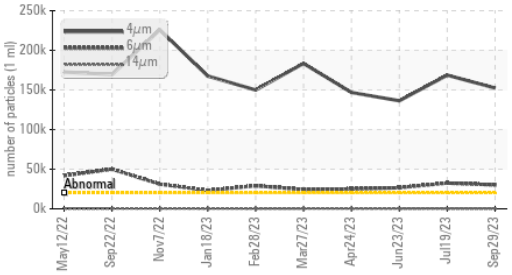

Particle Trend

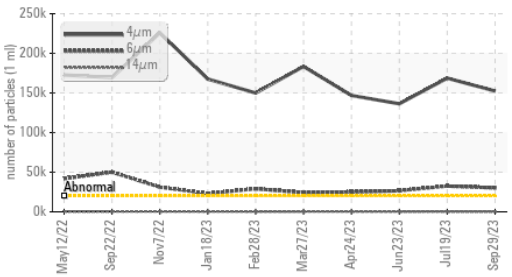

Acid Number

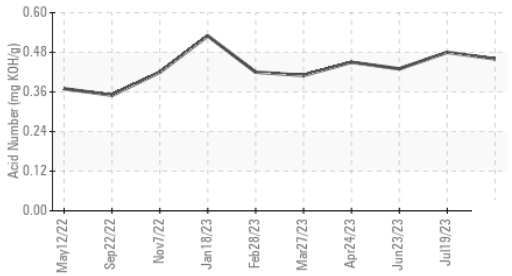

Viscosity @ 40°C

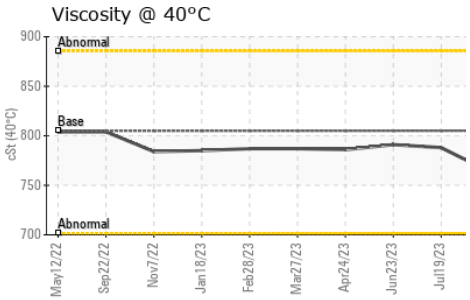

VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	**NONE**	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	**NONE**	NONE	NONE
Precipitate	scalar	*Visual	NONE	**NONE**	NONE	NONE
Silt	scalar	*Visual	NONE	**NONE**	NONE	NONE
Debris	scalar	*Visual	NONE	**NONE**	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	**NONE**	NONE	NONE
Appearance	scalar	*Visual	NORML	**NORML**	NORML	NORML
Odor	scalar	*Visual	NORML	**NORML**	NORML	NORML
Emulsified Water	scalar	*Visual	>0.2	**NEG**	NEG	NEG
Free Water	scalar	*Visual		**NEG**	NEG	NEG

FLUID PROPERTIES		method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445	805	**764**	788	791

SAMPLE IMAGES	method	limit/base	current	history1	history2
Color			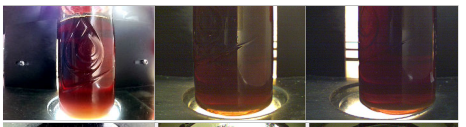		
Bottom					

GRAPHS

Ferrous Alloys

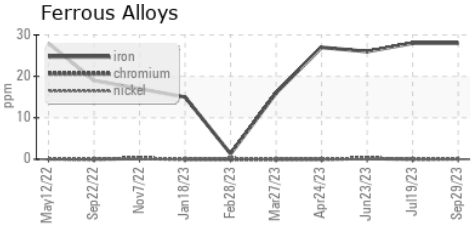

Non-ferrous Metals

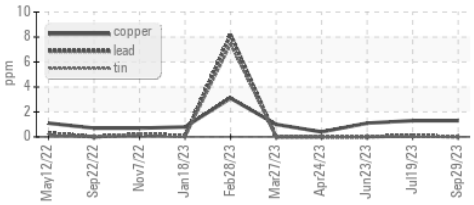

Viscosity @ 40°C

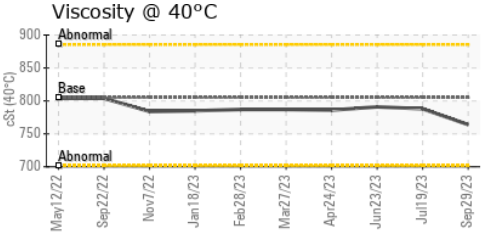

Particle Count

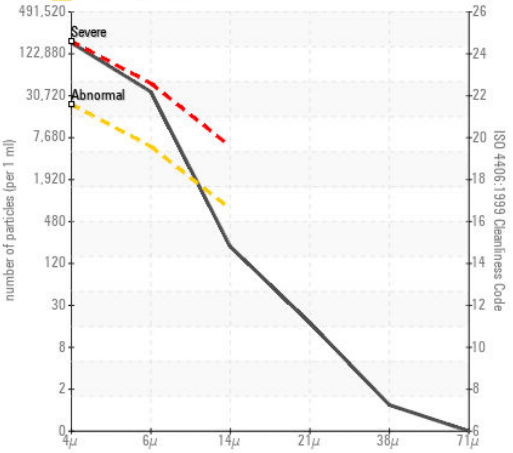

Acid Number

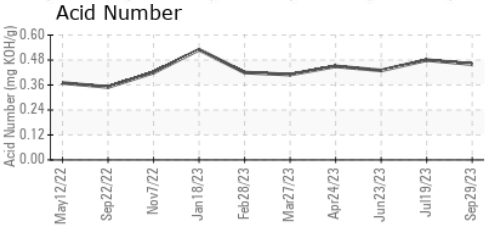

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : KFS0004887 **Received** : 03 Oct 2023
Lab Number : 05967763 **Diagnosed** : 04 Oct 2023
Unique Number : 10674314 **Diagnostician** : Wes Davis
Test Package : IND 2 (Additional Tests: PrtCount)

To discuss this sample report, contact Customer Service at 1-800-237-1369.
** - Denotes test methods that are outside of the ISO 17025 scope of accreditation.*
Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

CONSTELLIUM
4805 SECOND STREET
MUSCLE SHOALS, AL
US 35661
Contact: Joel Even
joel.even@constellium.com
T: (256)740-7490
F: