PROBLEM SUMMARY

Area
BLEACH O2
Machine Id
METSO BX025 PRE02 PRESS NE (S/N 0661-03-02-040-040-090)
Component
Bearing
Fluid
NOT GIVEN (4 GAL)

Sample Rating Trend

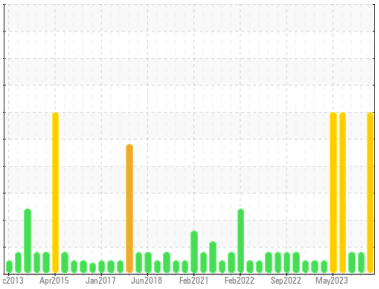

WEAR

COMPONENT CONDITION SUMMARY

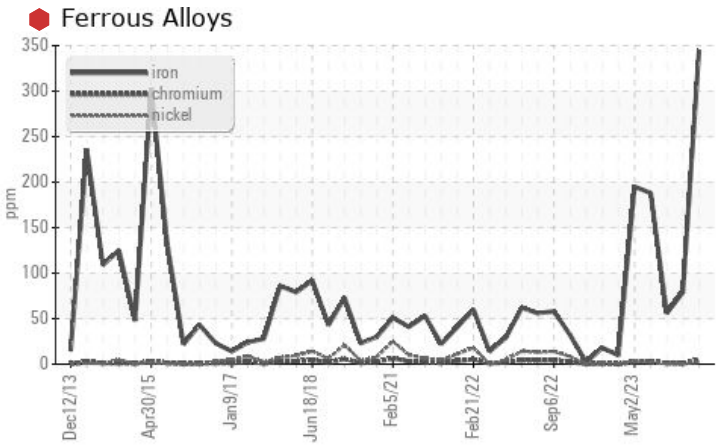

RECOMMENDATION

We advise that you inspect for the source(s) of wear. We recommend an early resample to monitor this condition.

PROBLEMATIC TEST RESULTS

Sample Status				SEVERE	ABNORMAL	ABNORMAL
Iron	ppm	ASTM D5185m	>20	**345**	79	56

Customer Id: INTRIERP
Sample No.: WC0760576
Lab Number: 05977740
Test Package: IND 2

To manage this report scan the QR code

To discuss the diagnosis or test data:
Doug Bogart +1 (800)237-1369 x4016
dougb@wearcheckusa.com

To change component or sample information:
Customer Service +1 1-800-237-1369
customerservice@wearcheck.com

RECOMMENDED ACTIONS

Action	Status	Date	Done By	Description
Inspect Wear Source	---	---	?	We advise that you inspect for the source(s) of wear.
Resample	---	---	?	We recommend an early resample to monitor this condition.

HISTORICAL DIAGNOSIS

17 Aug 2023 Diag: Don Baldridge

WEAR

We recommend an early resample to monitor this condition.The iron level is abnormal. All other component wear rates are normal. There is no indication of any contamination in the oil. The AN level is acceptable for this fluid.

view report

24 Jul 2023 Diag: Doug Bogart

WEAR

We recommend an early resample to monitor this condition.The iron level is abnormal. All other component wear rates are normal. There is no indication of any contamination in the oil. The AN level is acceptable for this fluid.

view report

30 May 2023 Diag: Angela Borella

WEAR

We advise that you inspect for the source(s) of wear. We recommend an early resample to monitor this condition.The iron level is severe. There is no indication of any contamination in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

view report

OIL ANALYSIS REPORT

Sample Rating Trend

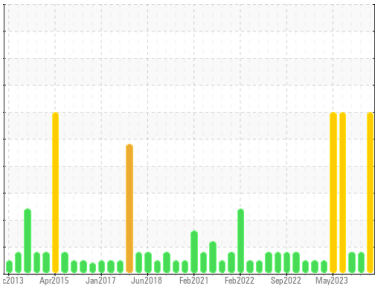

WEAR

Area
BLEACH O2
Machine Id
METSO BX025 PRE02 PRESS NE (S/N 0661-03-02-040-040-090)
Component
Bearing
Fluid
NOT GIVEN (4 GAL)

DIAGNOSIS

Recommendation
We advise that you inspect for the source(s) of wear. We recommend an early resample to monitor this condition.

Wear
The iron level is abnormal. All other component wear rates are normal.

Contamination
There is no indication of any contamination in the oil.

Fluid Condition
The AN level is acceptable for this fluid.

SAMPLE INFORMATION		method	limit/base	current	history1	history2
Sample Number		Client Info		**WC0760576**	WC0760566	WC0760589
Sample Date		Client Info		**09 Oct 2023**	17 Aug 2023	24 Jul 2023
Machine Age	mls	Client Info		**0**	0	0
Oil Age	mls	Client Info		**0**	0	0
Oil Changed		Client Info		**N/A**	N/A	N/A
Sample Status				**SEVERE**	ABNORMAL	ABNORMAL

WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>20	**345**	79	56
Chromium	ppm	ASTM D5185m	>20	**5**	<1	1
Nickel	ppm	ASTM D5185m	>20	**2**	<1	<1
Titanium	ppm	ASTM D5185m		**0**	0	<1
Silver	ppm	ASTM D5185m		**0**	0	0
Aluminum	ppm	ASTM D5185m	>20	**0**	<1	<1
Lead	ppm	ASTM D5185m	>20	**<1**	0	0
Copper	ppm	ASTM D5185m	>20	**3**	<1	1
Tin	ppm	ASTM D5185m	>20	**0**	0	0
Vanadium	ppm	ASTM D5185m		**0**	<1	<1
Cadmium	ppm	ASTM D5185m		**0**	<1	0

ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		**0**	0	0
Barium	ppm	ASTM D5185m		**0**	0	0
Molybdenum	ppm	ASTM D5185m		**<1**	0	0
Manganese	ppm	ASTM D5185m		**3**	1	1
Magnesium	ppm	ASTM D5185m		**<1**	1	1
Calcium	ppm	ASTM D5185m		**<1**	<1	0
Phosphorus	ppm	ASTM D5185m		**495**	533	510
Zinc	ppm	ASTM D5185m		**6**	<1	1
Sulfur	ppm	ASTM D5185m		**17060**	18767	17516

CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>15	**10**	9	8
Sodium	ppm	ASTM D5185m		**3**	3	2
Potassium	ppm	ASTM D5185m	>20	**1**	2	2
Water	%	ASTM D6304	>2	**0.085**	0.089	---
ppm Water	ppm	ASTM D6304		**850**	890	---

FLUID DEGRADATION		method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		**0.72**	1.02	1.07

OIL ANALYSIS REPORT

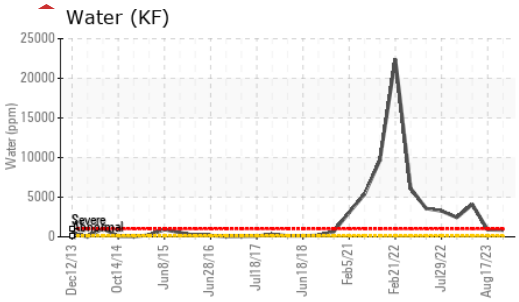

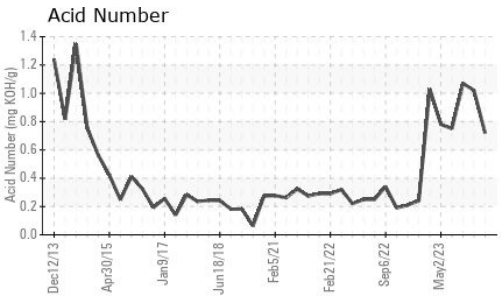

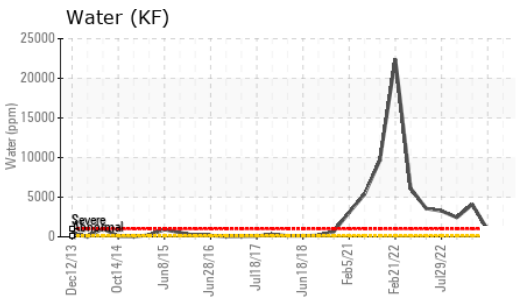

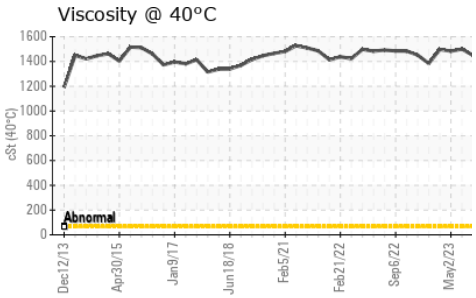

VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	**NONE**	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	**NONE**	NONE	NONE
Precipitate	scalar	*Visual	NONE	**NONE**	NONE	NONE
Silt	scalar	*Visual	NONE	**NONE**	NONE	NONE
Debris	scalar	*Visual	NONE	**NONE**	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	**NONE**	NONE	NONE
Appearance	scalar	*Visual	NORML	**NORML**	NORML	NORML
Odor	scalar	*Visual	NORML	**NORML**	NORML	NORML
Emulsified Water	scalar	*Visual	>2	**0.2%**	0.2%	NEG
Free Water	scalar	*Visual		**NEG**	NEG	NEG

FLUID PROPERTIES		method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445		**1442**	1433	1449

SAMPLE IMAGES	method	limit/base	current	history1	history2
Color					
Bottom					

GRAPHS

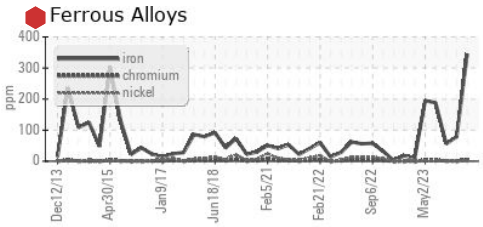

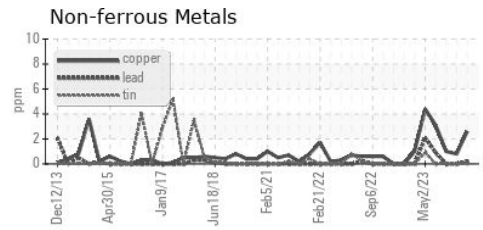

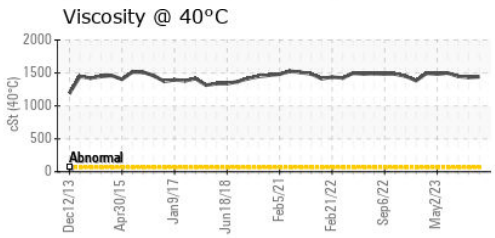

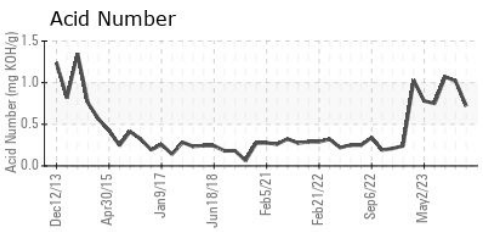

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : WC0760576 **Received** : 12 Oct 2023
Lab Number : 05977740 **Diagnosed** : 13 Oct 2023
Unique Number : 10695035 **Diagnostician** : Doug Bogart
Test Package : IND 2 (Additional Tests: KF)

To discuss this sample report, contact Customer Service at 1-800-237-1369.
** - Denotes test methods that are outside of the ISO 17025 scope of accreditation.*
Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

INTERNATIONAL PAPER
865 JOHN L REGEL RD
RIEGELWOOD, NC
US 28456
Contact: Zach Lizana
zachary.lizana@ipaper.com
T: (910)362-4775
F:

Report Id: INTRIERP [WUSCAR] 05977740 (Generated: 10/13/2023 21:47:14) Rev: 1

Submitted By: SCOTT BORDEAUX