PROBLEM SUMMARY

Area
BLEACH O2
Machine Id
BX060 POST02 PRESS SE (S/N 0661-03-02-040-040-040)
Component
Bearing
Fluid
{not provided} (4 GAL)

Sample Rating Trend

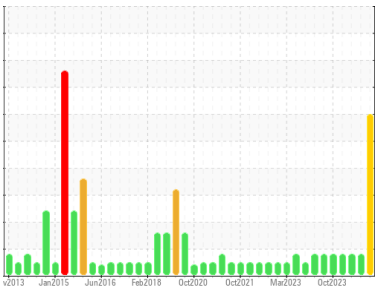

WEAR

COMPONENT CONDITION SUMMARY

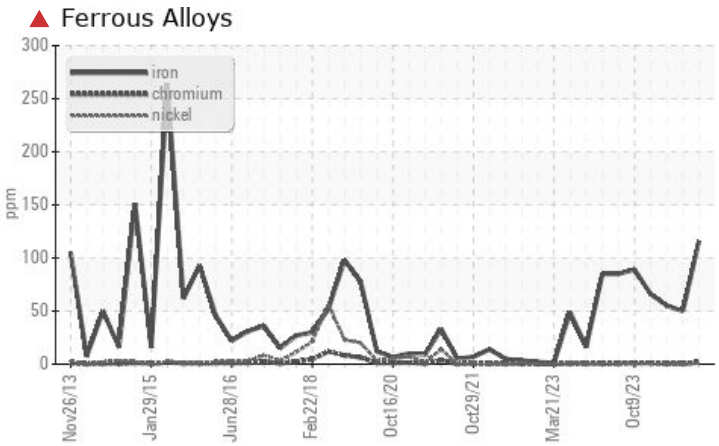

RECOMMENDATION

We advise that you inspect for the source(s) of wear. We recommend an early resample to monitor this condition.

PROBLEMATIC TEST RESULTS

Sample Status				SEVERE	MARGINAL	ABNORMAL
Iron	ppm	ASTM D5185m	>20	▲ **116**	▲ 50	▲ 55

Customer Id: INTRIERP
Sample No.: WC0920568
Lab Number: 06159268
Test Package: IND 2

To manage this report scan the QR code

To discuss the diagnosis or test data:
Jonathan Hester +1 919-379-4092 x4092
jhester@wearcheckusa.com

To change component or sample information:
Customer Service +1 1-800-237-1369
customerservice@wearcheck.com

RECOMMENDED ACTIONS

Action	Status	Date	Done By	Description
Inspect Wear Source	---	---	?	We advise that you inspect for the source(s) of wear.
Resample	---	---	?	We recommend an early resample to monitor this condition.

HISTORICAL DIAGNOSIS

WEAR

25 Jan 2024 Diag: Don Baldridge
No corrective action is recommended at this time. Resample at the next service interval to monitor.The iron level is abnormal. All other component wear rates are normal. There is no indication of any contamination in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

view report

WEAR

18 Dec 2023 Diag: Angela Borella
No corrective action is recommended at this time. Resample at the next service interval to monitor.The iron level is abnormal. All other component wear rates are normal. There is no indication of any contamination in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

view report

WEAR

15 Nov 2023 Diag: Don Baldridge
No corrective action is recommended at this time. Resample at the next service interval to monitor.The iron level is abnormal. All other component wear rates are normal. There is no indication of any contamination in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

view report

OIL ANALYSIS REPORT

Area
BLEACH O2
Machine Id
BX060 POST02 PRESS SE (S/N 0661-03-02-040-040-040)
Component
Bearing
Fluid
{not provided} (4 GAL)

Sample Rating Trend

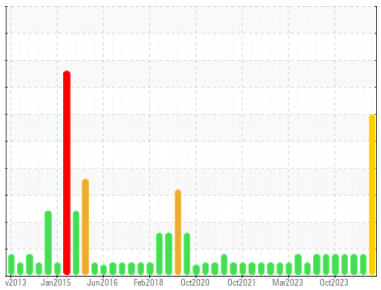

WEAR

DIAGNOSIS

▲ Recommendation
We advise that you inspect for the source(s) of wear. We recommend an early resample to monitor this condition.

▲ Wear
The iron level is severe.

Contamination
There is no indication of any contamination in the oil.

Fluid Condition
The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORMATION		method	limit/base	current	history1	history2
Sample Number		Client Info		**WC0920568**	WC0851745	WC0851752
Sample Date		Client Info		**22 Apr 2024**	25 Jan 2024	18 Dec 2023
Machine Age	mls	Client Info		**0**	0	0
Oil Age	mls	Client Info		**0**	0	0
Oil Changed		Client Info		**N/A**	N/A	N/A
Sample Status				**SEVERE**	MARGINAL	ABNORMAL

WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>20	▲ **116**	▲ 50	▲ 55
Chromium	ppm	ASTM D5185m	>20	**2**	<1	<1
Nickel	ppm	ASTM D5185m	>20	**<1**	0	<1
Titanium	ppm	ASTM D5185m		**<1**	<1	0
Silver	ppm	ASTM D5185m		**0**	0	0
Aluminum	ppm	ASTM D5185m	>20	**2**	<1	<1
Lead	ppm	ASTM D5185m	>20	**<1**	0	0
Copper	ppm	ASTM D5185m	>20	**<1**	<1	<1
Tin	ppm	ASTM D5185m	>20	**<1**	<1	<1
Vanadium	ppm	ASTM D5185m		**<1**	<1	0
Cadmium	ppm	ASTM D5185m		**<1**	0	0

ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		**0**	0	0
Barium	ppm	ASTM D5185m		**0**	0	0
Molybdenum	ppm	ASTM D5185m		**<1**	0	0
Manganese	ppm	ASTM D5185m		**<1**	<1	<1
Magnesium	ppm	ASTM D5185m		**<1**	<1	3
Calcium	ppm	ASTM D5185m		**5**	0	3
Phosphorus	ppm	ASTM D5185m		**570**	421	521
Zinc	ppm	ASTM D5185m		**3**	<1	12
Sulfur	ppm	ASTM D5185m		**16776**	12510	16301

CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>15	**9**	7	11
Sodium	ppm	ASTM D5185m		**2**	4	5
Potassium	ppm	ASTM D5185m	>20	**<1**	1	2
Water	%	ASTM D6304	>2	**0.134**	---	---
ppm Water	ppm	ASTM D6304		**1340**	---	---

FLUID DEGRADATION		method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		**0.98**	0.92	0.77

OIL ANALYSIS REPORT

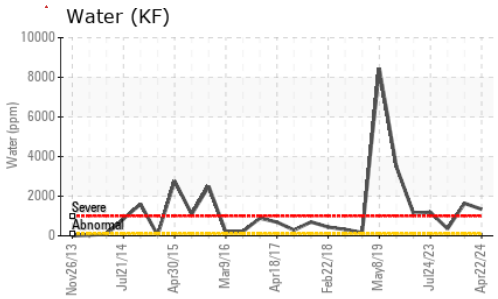

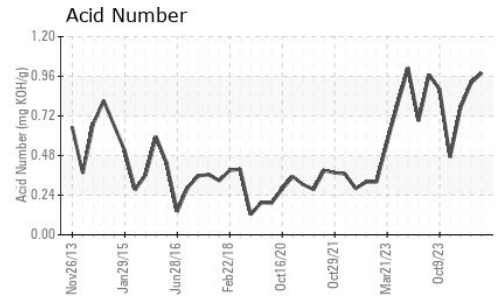

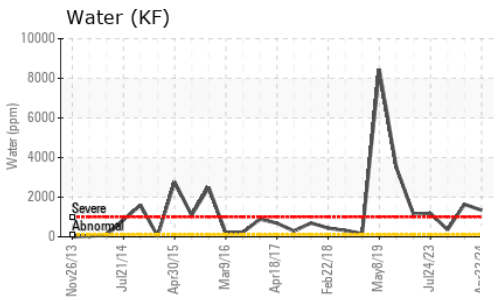

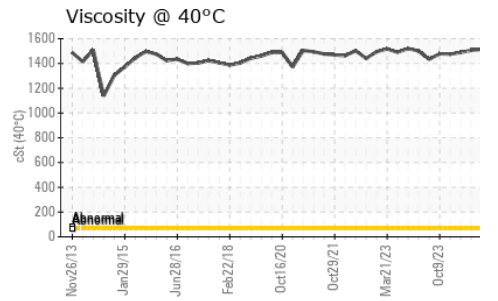

VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	**NONE**	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	**NONE**	NONE	NONE
Precipitate	scalar	*Visual	NONE	**NONE**	NONE	NONE
Silt	scalar	*Visual	NONE	**NONE**	NONE	NONE
Debris	scalar	*Visual	NONE	**NONE**	LIGHT	NONE
Sand/Dirt	scalar	*Visual	NONE	**NONE**	NONE	NONE
Appearance	scalar	*Visual	NORML	**NORML**	NORML	NORML
Odor	scalar	*Visual	NORML	**NORML**	NORML	NORML
Emulsified Water	scalar	*Visual	>2	**0.2%**	NEG	NEG
Free Water	scalar	*Visual		**NEG**	NEG	NEG

FLUID PROPERTIES		method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445		**1515**	1506	1489

SAMPLE IMAGES	method	limit/base	current	history1	history2
Color					
Bottom					

GRAPHS

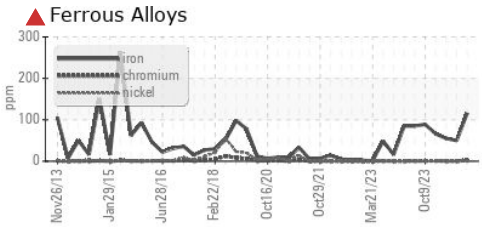

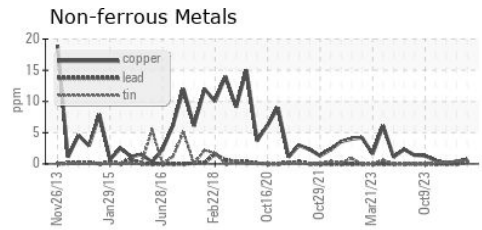

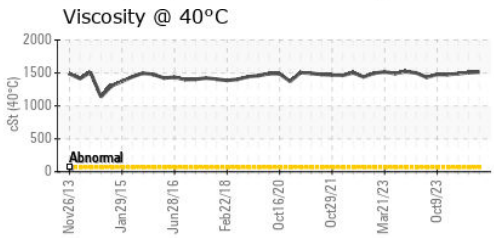

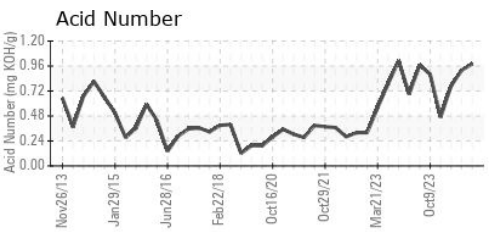

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : WC0920568 **Received** : 24 Apr 2024
Lab Number : 06159268 **Tested** : 25 Apr 2024
Unique Number : 10994691 **Diagnosed** : 26 Apr 2024 - Jonathan Hester
Test Package : IND 2 (Additional Tests: KF)

To discuss this sample report, contact Customer Service at 1-800-237-1369.
** - Denotes test methods that are outside of the ISO 17025 scope of accreditation.*
Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

INTERNATIONAL PAPER
865 JOHN L REGEL RD
RIEGELWOOD, NC
US 28456
Contact: Zach Lizana
zachary.lizana@ipaper.com
T: (910)362-4775
F:

Report Id: INTRIERP [WUSCAR] 06159268 (Generated: 04/26/2024 10:20:12) Rev: 1

Submitted By: SCOTT BORDEAUX