



COOLANT REPORT

WEAR	NORMAL
CONTAMINATION	NORMAL
FLUID CONDITION	ABNORMAL

Area
CRC (4801)
 Machine Id
48-1506-01

Component
Anti-Freeze
 Fluid
HYBRID (HOAT) COOLANT (205 LTR)

RECOMMENDATION

Nous vous conseillons de reconstituer les additifs refroidisseurs supplémentaires, (SCA - supplemental coolant additives) et d'en ajouter selon les recommandations du fabricant. Échantillonner de nouveau l'équipement au prochain intervalle de vidange afin d'en surveiller la condition.

WEAR

Les concentrations de tous les métaux sont normales indiquant qu'il n'y a pas de corrosion dans le système de refroidissement.









CONTAMINATION

Il n'y a aucun indice de contamination dans le l'anti-gèle.

FLUID CONDITION

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		WC0525922	WC0525924	WC15001627
Sample Date		Client Info		13 Apr 2021	09 Feb 2021	24 Nov 2020
Machine Age	days	Client Info		0	0	0
Oil Age	days	Client Info		0	0	0
Filter Age	days	Client Info		0	0	0
Oil Changed		Client Info		N/A	N/A	N/A
Filter Changed		Client Info		N/A	N/A	N/A
Sample Status				ABNORMAL	ABNORMAL	ABNORMAL
Iron	ppm	ASTM D5185(m)	>10	4	2	1
Aluminum	ppm	ASTM D5185(m)	>10	<1	<1	<1
Copper	ppm	ASTM D5185(m)	>10	2	1	1
Lead	ppm	ASTM D5185(m)	>10	1	<1	1
Tin	ppm	ASTM D5185(m)	>10	<1	<1	<1
Silver	ppm	ASTM D5185(m)	>10	0	0	1
Zinc	ppm	ASTM D5185(m)	>10	1	1	1
Calcium	ppm	ASTM D5185(m)		4	3	1
Magnesium	ppm	ASTM D5185(m)		2	2	<1
Appearance	scalar	Visual*	NORML	NORML	NORML	NORML
Odor	scalar	Visual*	NORML	NORML	NORML	NORML
Coolant Appearance		Visual*	Clear	Clear	Clear	Clear
Water		WC Method		NEG	NEG	NEG



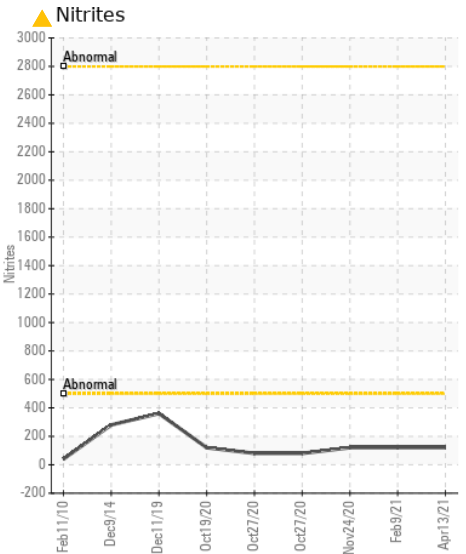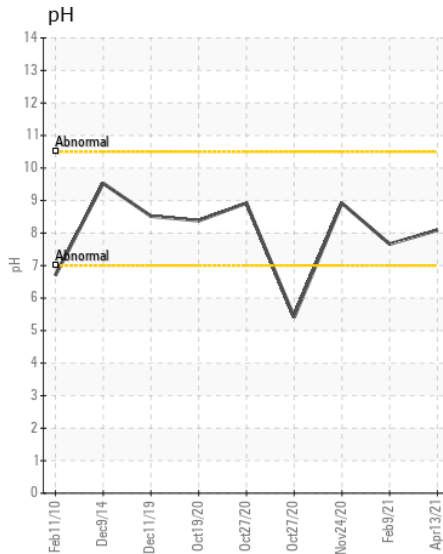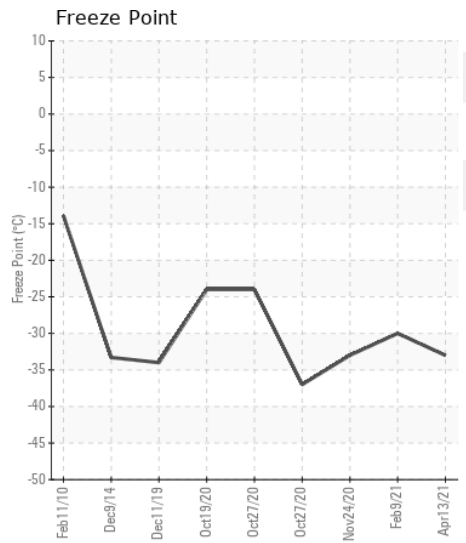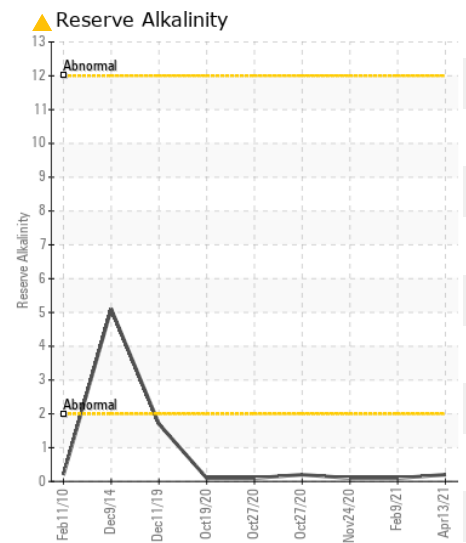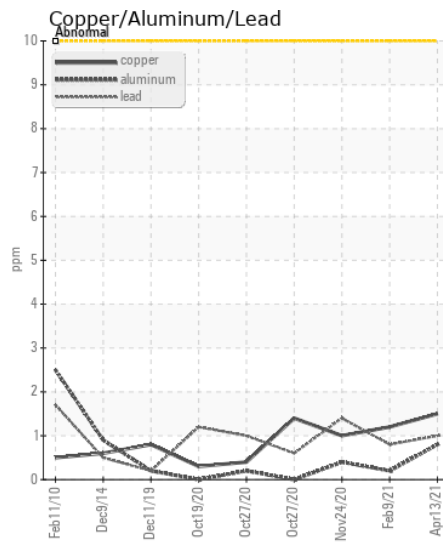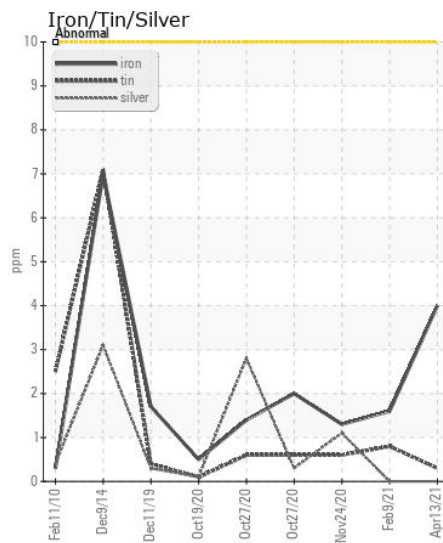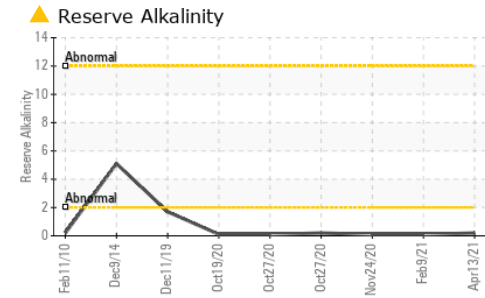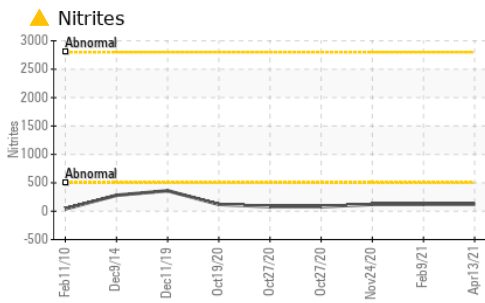

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : WC0525922
Lab Number : 02416403
Unique Number : 5211888
Test Package : COOL
Received : 21 Apr 2021
Tested : 27 Apr 2021
Diagnosed : 27 Apr 2021 - Bill Quesnel

RTA - UGB
 C.P. 900
 Ville de la Baie, QC
 CA G7B 4G9
 Contact: Alcan Epc
 mathieu.tremblay2@riotinto.com
 T: (418)697-9568
 F: (418)697-9550

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.

This page left intentionally blank