WEAR CONTAMINATION FLUID CONDITION

NORMAL NORMAL




Area
Haul Truck
Machine Id
HT5024

Component Front Left Wheel Hub

PETRO CANADA TRAXON 85W140 (13 LTR)

RECOMMENDATION Test UOM Method Limit/Abn Current History	ory1 Hi	istory2
Sample Number Client Info PC0074945 PC00	47198	-
Resample at the next service interval to monitor.	n 2021	_
Machine Age hrs Client Info 9972 0		-
Oil Age hrs Client Info 0 0		-
Filter Age hrs Client Info 0 0		-
Oil Changed Client Info N/A N/A		-
Filter Changed Client Info N/A N/A		-
Sample Status NORMAL NOR	MAL	-
WEAR         PQ         ASTM D8184*         395		
Iron ppm ASTM D5185(m) >500 <b>509</b> 10	)3	
All component wear rates are normal.  Chromium ppm ASTM D5185(m) >8 6 1		
Nickel ppm   ASTM D5185(m)   >5   <1   <		
Titanium ppm ASTM D5185(m) <b>0</b> <		
Silver ppm ASTM D5185(m) 0 <		
Aluminum ppm ASTM D5185(m) >5 2 <		
<b>Lead</b> ppm ASTM D5185(m) >5 <b>&lt;1</b> <		
Copper         ppm         ASTM D5185(m)         >50         14         9		
Tin         ppm         ASTM D5185(m)         0         0		
Vanadium ppm ASTM D5185(m) <b>0</b> 0		
White Metal scalar Visual* NONE NONE LI	GHT	
Yellow Metal scalar Visual* NONE NONE N	ONE	
CONTAMINATION Silicon ppm ASTM D5185(m) >25 15 7		
There is no indication of any contamination in the oil.	EG	
	ONE	
	ONE	
	ONE	
	ORML	
	ORML	
	EG	
FLUID CONDITION Sodium ppm ASTM D5185(m) <1 5		
Boron ppm 45TM D5185(m) 243 70 8		
Viscosity of sample indicates oil is within SAE 80W90 range, advise	31	
investigate. The condition of the oil is acceptable for the time in service.  Molybdenum ppm ASTM D5185(m) 0 <-		
Manganese ppm ASTM D5185(m) 6 2		
Magnesium ppm ASTM D5185(m) 0 3 1		
Calcium         ppm         ASTM D5185(m)         0         11         8		
	691	
Zinc ppm ASTM D5185(m) 0 <b>15</b> 17	7	
	7420	
Visc @ 40°C cSt ASTM D7279(m) 355.4 148 17	78	
Visc @ 100°C cSt ASTM D7279(m) 26.1 15.3 16	6.4	
	5	

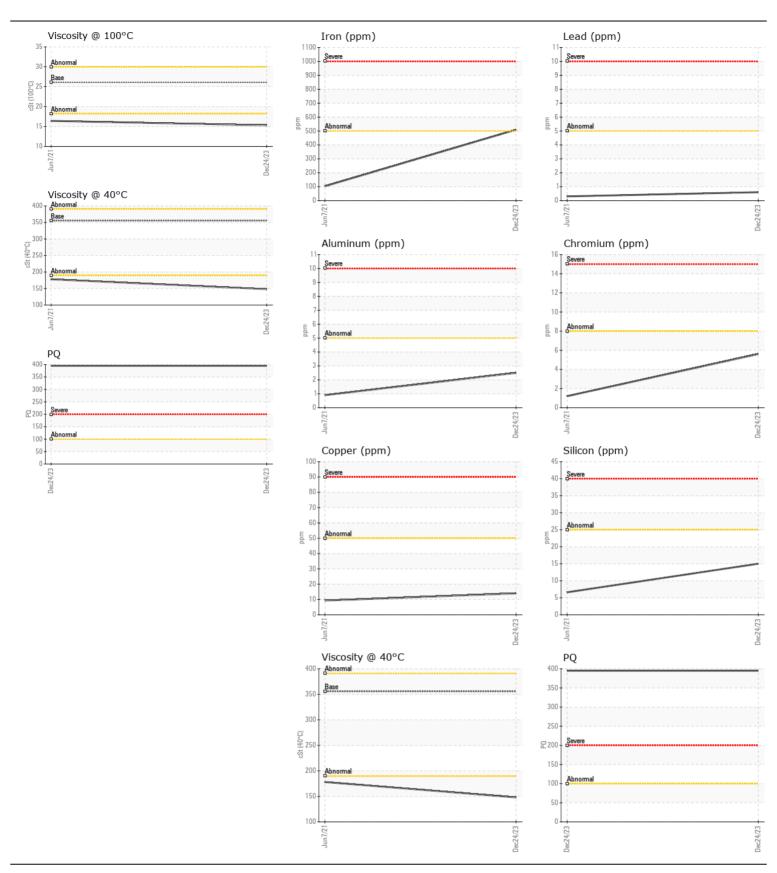



CALA ISO 17025:2017 Accredited Laboratory

Laboratory Sample No. Lab Number **Unique Number** 

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9

: PC0074945 : 02608269 : 5709355

Recieved Diagnosed : 11 Jan 2024

: 12 Jan 2024

Diagnostician : Kevin Marson Test Package : MOB 1 ( Additional Tests: KV100, PQ, VI )

Timmins, ON CA Contact: Dale Arseneau darseneau@ca.panamericansilver.com

**Lakeshore Gold Timmins West** 

To discuss this sample report, contact Customer Service at 1-800-268-2131. Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

Submitted By: Luc Belanger

T: (705)269-4344