
WEAR CONTAMINATION **FLUID CONDITION**

NORMAL NORMAL NORMAL

Machine Id 401138

Component Diesel Engine

RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
Resample at the next service interval to monitor. Please specify the	Sample Number		Client Info		GFL0100594		
component make and model with your next sample.	Sample Date		Client Info		09 Jan 2024		
	Machine Age	kms	Client Info		161264		
	Oil Age	kms	Client Info		0		
	Filter Age	kms	Client Info		0		
	Oil Changed		Client Info		N/A		
	Filter Changed		Client Info		N/A		
	Sample Status				NORMAL		
VEAR	Iron	ppm	ASTM D5185(m)	>100	46		
	Chromium	ppm	ASTM D5185(m)		<1		
All component wear rates are normal.	Nickel	ppm	ASTM D5185(m)		<1		
	Titanium	ppm	ASTM D5185(m)		0		
	Silver	ppm	ASTM D5185(m)	>3	0		
	Aluminum	ppm	ASTM D5185(m)		2		
	Lead	ppm	ASTM D5185(m)		1		
	Copper	ppm	ASTM D5185(m)		5		
	Tin	ppm	ASTM D5185(m)	>15	0		
	Vanadium	ppm	ASTM D5185(m)		0		
CONTAMINATION	Silicon	ppm	ASTM D5185(m)		5		
There is no indication of any contamination in the oil.	Potassium	ppm	ASTM D5185(m)		<1		
	Fuel		WC Method		<1.0		
	Water		WC Method	>0.2	NEG		
	Glycol	%	ASTM D7922*		NEG		
	Soot %	%	ASTM D7844*		0.1		
	Nitration	Abs/cm	ASTM D7624*	>20	7.1		
	Sulfation	Abs/.1mm	ASTM D7415*		18.2		
	Emulsified Water	scalar	Visual*	>0.2	NEG		
LUID CONDITION	Sodium	ppm	ASTM D5185(m)		3		
The condition of the oil is acceptable for the time in service.	Boron	ppm	ASTM D5185(m)		3		
	Barium	ppm	ASTM D5185(m)		0		
	Molybdenum	ppm	ASTM D5185(m)		59		
	Manganese	ppm	ASTM D5185(m)		0		
	Magnesium	ppm	ASTM D5185(m)		938		
	Calcium	ppm	ASTM D5185(m)		1045		
	Phosphorus	ppm	ASTM D5185(m)		1011		
	Zinc	ppm	ASTM D5185(m)		1158		
	Sulfur	ppm	ASTM D5185(m)		2692		
	Oxidation	Abs/.1mm	ASTM D7414*	>25	14.7		
	Visc @ 100°C	cSt	ASTM D7279(m)		14.3		

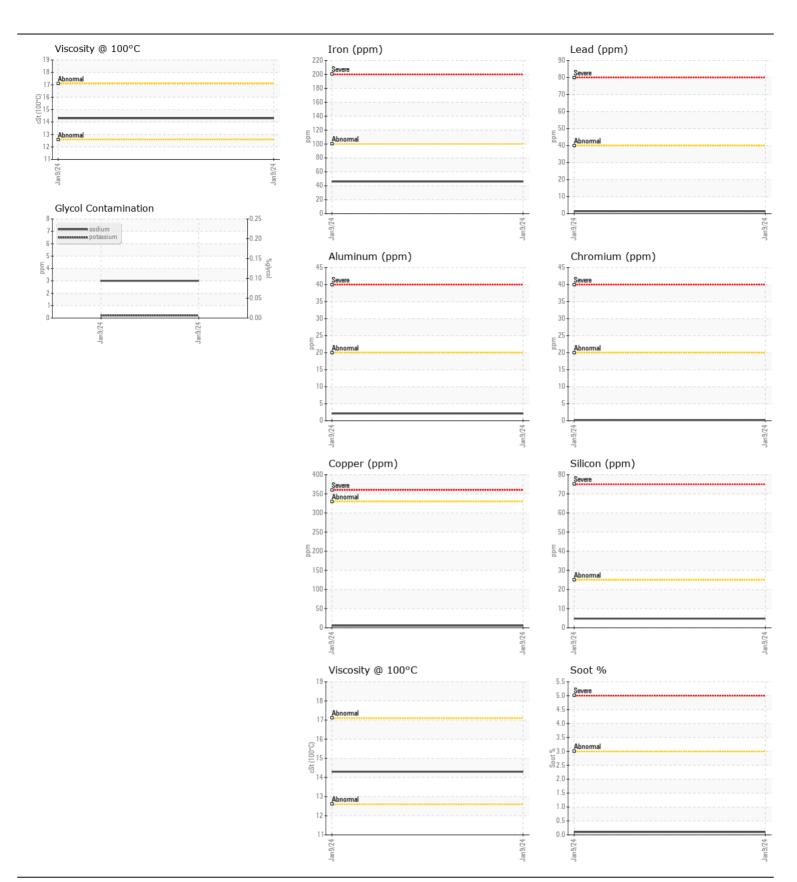



CALA ISO 17025:2017 Accredited Laboratory

Laboratory Sample No. Lab Number Unique Number

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 GFL Environmental - 575 - Squamish Hauling : GFL0100594

: 5709449

Recieved : 02608363 Diagnosed

: 12 Jan 2024 : 15 Jan 2024

Diagnostician : Kevin Marson Test Package : MOB 1 (Additional Tests: Glycol)

CA V8B 0K8 Contact: Dean Imbeau dimbeau@gflenv.com T: (604)892-5604 F: (604)892-5238

38950 Queens Way,

Squamish, BC

To discuss this sample report, contact Customer Service at 1-800-268-2131. Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.

Validity of results and interpretation are based on the sample and information as supplied.