WEAR CONTAMINATION **FLUID CONDITION**


NORMAL NORMAL NORMAL



CATERPILLAR 202-2100

SAE 75W140 (LTR)							
RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
Resample at the next service interval to monitor.	Sample Number		Client Info		PC0084922		
	Sample Date		Client Info		10 Jan 2024		
	Machine Age	hrs	Client Info		2695		
	Oil Age	hrs	Client Info		2695		
	Filter Age	hrs	Client Info		0		
	Oil Changed		Client Info		Changed		
	Filter Changed		Client Info		N/A		
	Sample Status				NORMAL		
WEAR	Iron	ppm	ASTM D5185(m)	>500	77		
All component wear rates are normal.	Chromium	ppm	ASTM D5185(m)	>10	<1		
	Nickel	ppm	ASTM D5185(m)		0		
	Titanium	ppm	ASTM D5185(m)		0		
	Silver	ppm	ASTM D5185(m)		0		
	Aluminum	ppm	ASTM D5185(m)	>25	<1		
	Lead	ppm	ASTM D5185(m)		0		
	Copper	ppm	ASTM D5185(m)	>75	7		
	Tin	ppm	ASTM D5185(m)	>10	0		
	Vanadium	ppm	ASTM D5185(m)		0		
	White Metal	scalar	Visual*	NONE	NONE		
	Yellow Metal	scalar	Visual*	NONE	NONE		
CONTABBINIATION							
CONTAMINATION	Silicon	ppm	ASTM D5185(m)		2		
There is no indication of any contamination in the oil.	Potassium	ppm	ASTM D5185(m)		1		
	Water		WC Method		NEG		
	Silt	scalar	Visual*	NONE	NONE		
	Debris	scalar	Visual*	NONE	NONE		
	Sand/Dirt	scalar	Visual*	NONE	NONE		
	Appearance	scalar	Visual*	NORML	NORML		
	Odor Emulsified Water	scalar	Visual* Visual*	NORML >0.2	NORML NEG		
FLUID CONDITION	Sodium	ppm	ASTM D5185(m)		3		
The condition of the oil is acceptable for the time in service.	Boron	ppm	ASTM D5185(m)		55		
	Barium	ppm	ASTM D5185(m)		0		
	Molybdenum	ppm	ASTM D5185(m)		0		
	Manganese	ppm	ASTM D5185(m)		1		
	Magnesium	ppm	ASTM D5185(m)		1		
	Calcium	ppm	ASTM D5185(m)		11		
	Phosphorus	ppm	ASTM D5185(m)		1041		
	Zinc	ppm	ASTM D5185(m)		35		
	Sulfur	ppm	ASTM D5185(m)		19938		
	Visc @ 40°C	cSt	ASTM D7279(m)		160		
	Visc @ 100°C	cSt	ASTM D7279(m)	25.0	22.4		

Viscosity Index (VI) Scale ASTM D2270* 163

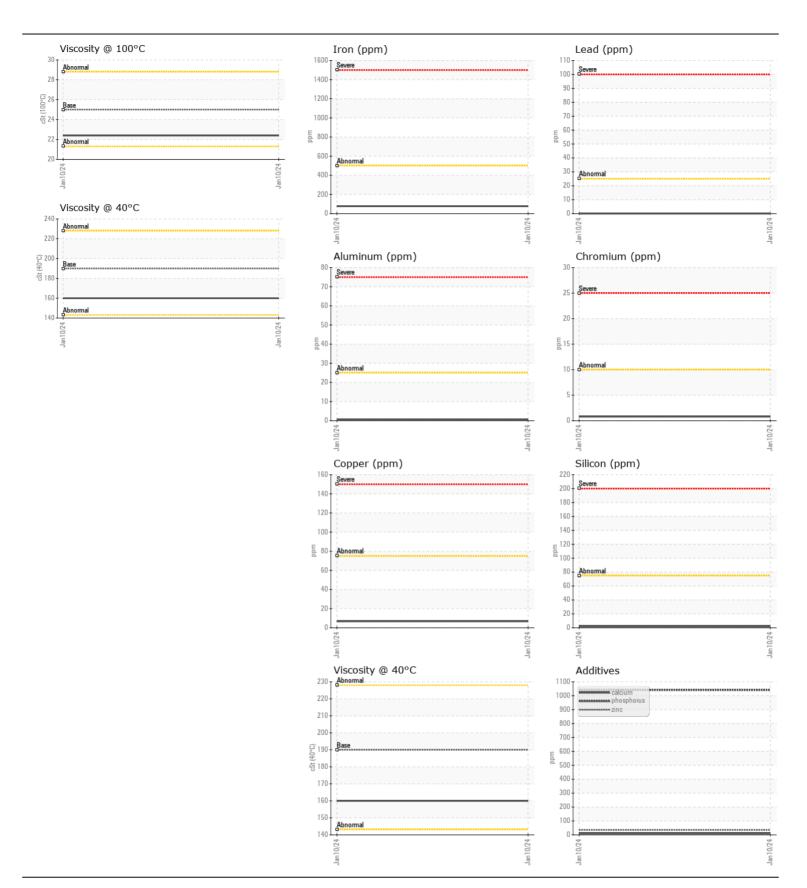



CALA ISO 17025:2017 Accredited Laboratory

Laboratory Sample No. Lab Number

: 5709693 **Unique Number**

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 : PC0084922 : 02608607

Recieved

Diagnosed : 12 Jan 2024 Diagnostician : Wes Davis

: 12 Jan 2024

Test Package : MOB 1 (Additional Tests: KV100, VI) To discuss this sample report, contact Customer Service at 1-800-268-2131.

Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

LAVIS CONTRACTING 37462A HURON ROAD CLINTON, ON CA NOM 1L0

Contact: Doug Francis dfrancis@lavis.ca T: (519)482-3694 F: (519)482-7886