



OIL ANALYSIS REPORT

WEAR	NORMAL
CONTAMINATION	ABNORMAL
FLUID CONDITION	ABNORMAL

Area
QC Engine
 Machine Id
QC230725MOB2
 Component
Diesel Engine
 Fluid
DIESEL ENGINE OIL SAE 40 (--- GAL)

RECOMMENDATION

We advise that you check for the source of water entry. We recommend that you drain the oil from the component if this has not already been done. We recommend you service the filters on this component. We recommend an early resample to monitor this condition. Please specify the component make and model with your next sample. NOTE: Test values may be askew due high concentration of free water present in sample.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		WC0894152	WC0894149	WC0894148
Sample Date		Client Info		15 Jan 2024	12 Jan 2024	11 Jan 2024
Machine Age	hrs	Client Info		0	0	0
Oil Age	hrs	Client Info		0	0	0
Filter Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		N/A	N/A	N/A
Filter Changed		Client Info		N/A	N/A	N/A
Sample Status				ABNORMAL	ABNORMAL	ABNORMAL

WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185(m)	>100	19	20	20
Chromium	ppm	ASTM D5185(m)	>20	<1	<1	<1
Nickel	ppm	ASTM D5185(m)	>4	<1	<1	<1
Titanium	ppm	ASTM D5185(m)		2	2	2
Silver	ppm	ASTM D5185(m)	>3	0	0	<1
Aluminum	ppm	ASTM D5185(m)	>20	5	5	5
Lead	ppm	ASTM D5185(m)	>40	2	1	2
Copper	ppm	ASTM D5185(m)	>330	9	9	9
Tin	ppm	ASTM D5185(m)	>15	<1	<1	<1
Vanadium	ppm	ASTM D5185(m)		0	0	0

CONTAMINATION














There is a moderate amount of fuel present in the oil. There is a light concentration of water present in the oil. Excessive free water present. Tests confirm the presence of fuel in the oil.

Silicon	ppm	ASTM D5185(m)	>25	6	7	7
Potassium	ppm	ASTM D5185(m)	>20	▲ 15	▲ 16	▲ 18
Fuel	%	ASTM D7593*	>5	▲ 5	▲ 5	▲ 5
Water	%	ASTM D6304*	>0.2	▲ 0.365	▲ 0.328	▲ 0.313
ppm Water	ppm	ASTM D6304*	>2000	▲ 3652	▲ 3285	▲ 3130
Glycol	%	ASTM D7922*		NEG	NEG	NEG
Soot %	%	ASTM D7844*	>3	0.3	0.3	0.3
Nitration	Abs/cm	ASTM D7624*	>20	9.9	10.1	10.1
Sulfation	Abs/.1mm	ASTM D7415*	>30	20.4	20.4	20.4
Emulsified Water	scalar	Visual*	>0.2	▲ .2%	▲ .2%	▲ .2%

FLUID CONDITION

The BN result indicates that there is suitable alkalinity remaining in the oil. Viscosity of sample indicates oil is within SAE 10W30 range, advise investigate. The oil is no longer serviceable due to the presence of contaminants.

Sodium	ppm	ASTM D5185(m)	>216	▲ 64	▲ 69	▲ 67
Boron	ppm	ASTM D5185(m)	250	29	30	37
Barium	ppm	ASTM D5185(m)	10	0	0	0
Molybdenum	ppm	ASTM D5185(m)	100	45	47	46
Manganese	ppm	ASTM D5185(m)		0	0	0
Magnesium	ppm	ASTM D5185(m)	450	606	615	615
Calcium	ppm	ASTM D5185(m)	3000	1458	1498	1505
Phosphorus	ppm	ASTM D5185(m)	1150	868	871	890
Zinc	ppm	ASTM D5185(m)	1350	983	1009	1014
Sulfur	ppm	ASTM D5185(m)	4250	2704	2717	2770
Oxidation	Abs/.1mm	ASTM D7414*	>25	16.1	16.5	16.4
Base Number (BN)	mg KOH/g	ASTM D2896*	8.5	8.57	7.82	9.54
Visc @ 40°C	cSt	ASTM D7279(m)	138	▲ 75.4	▲ 75.1	▲ 75.2
Visc @ 100°C	cSt	ASTM D7279(m)	14.4	▲ 11.3	▲ 11.3	▲ 11.3
Viscosity Index (VI)	Scale	ASTM D2270*	102	141	141	141

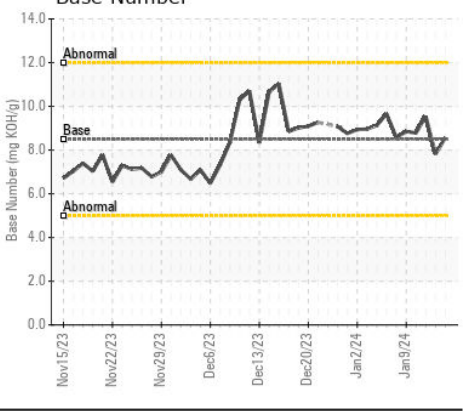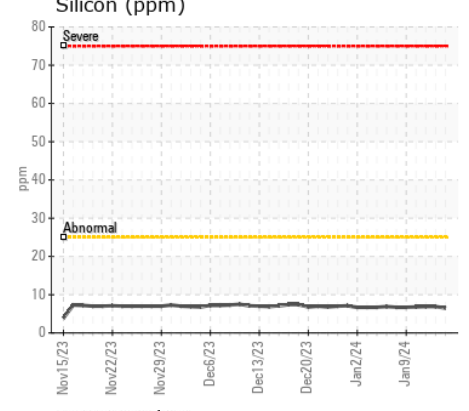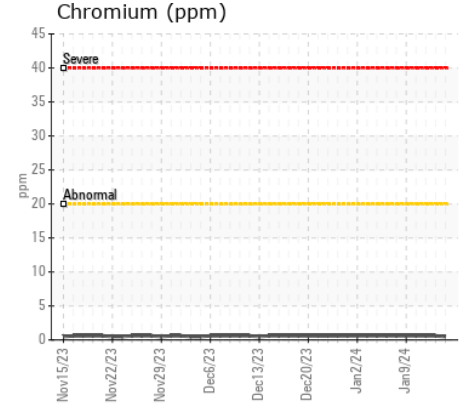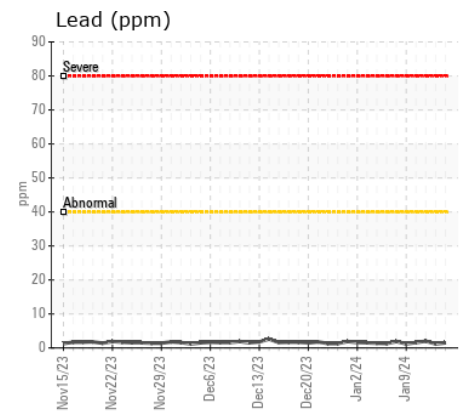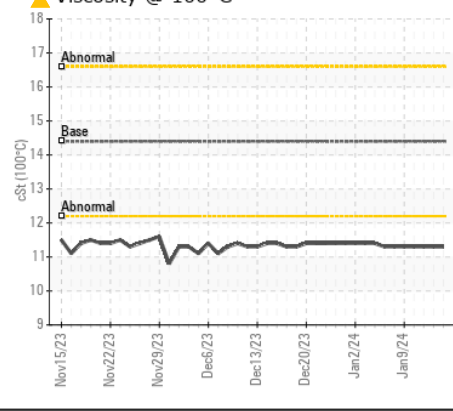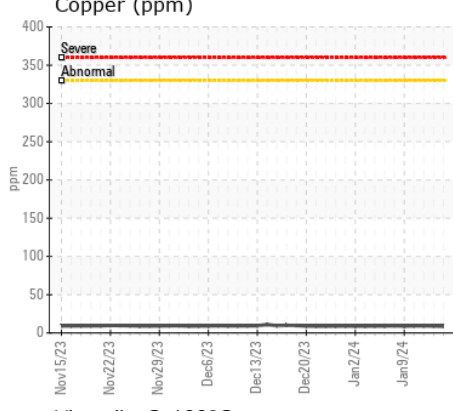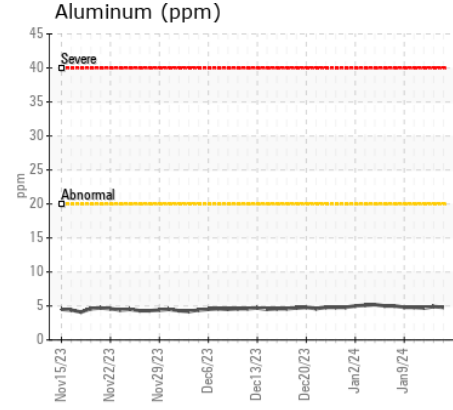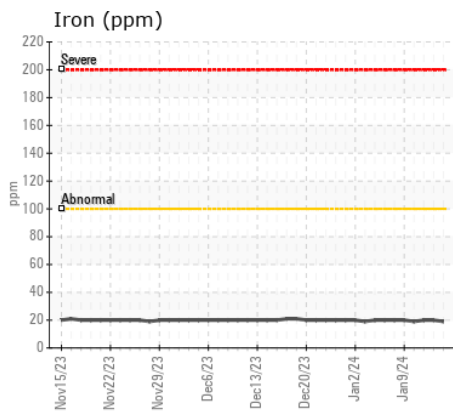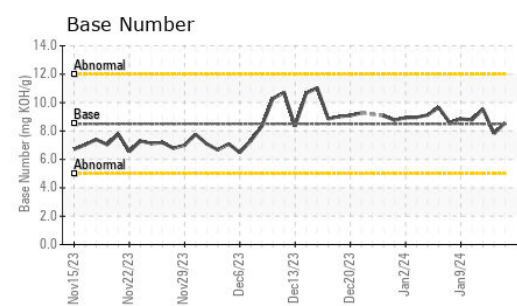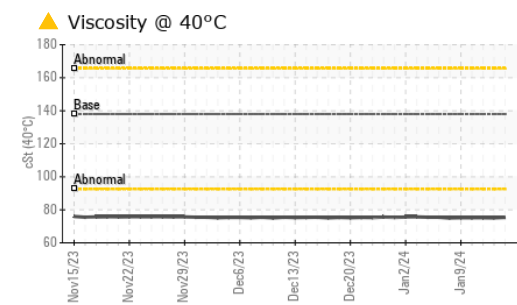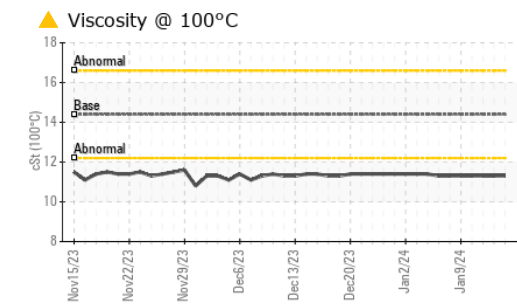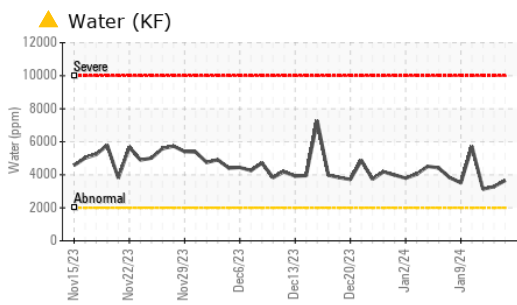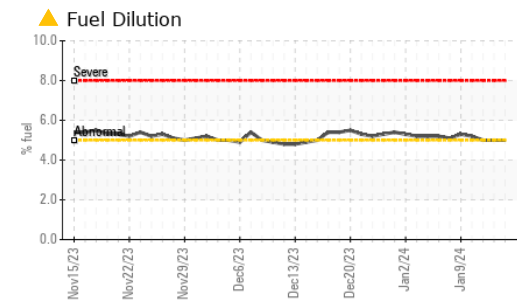

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 **WearCheck Quality Control Sample Results**
Sample No. : WC0894152 **Received** : 15 Jan 2024
Lab Number : 02608690 **Diagnosed** : 16 Jan 2024
Unique Number : 5709776 **Diagnostician** : Kevin Marson
Test Package : MOB 2 (Additional Tests: Glycol, KF, KV40, PercentFuel, VI)

Burlington, ON
 CA
 Contact: Dorian Anderson
 dorian.anderson@wearcheck.com
 T: (289)291-4652
 F: (905)569-8605

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.