



LIEBHERR

OIL ANALYSIS REPORT

WEAR	NORMAL
CONTAMINATION	NORMAL
FLUID CONDITION	NORMAL



Machine Id
LIEBHERR LH50 14791
Component
Diesel Engine
Fluid
CHEVRON DELO 400 XSP 5W30 (--- GAL)

RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		LH0180121	LH0260765	LH0194841
Sample Date		Client Info		27 Dec 2023	31 Oct 2023	18 Sep 2023
Machine Age	hrs	Client Info		22000	21500	21000
Oil Age	hrs	Client Info		0	0	0
Filter Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		Changed	Changed	Changed
Filter Changed		Client Info		N/A	N/A	N/A
Sample Status				NORMAL	NORMAL	NORMAL

WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185(m)	>66	3	4	4
Chromium	ppm	ASTM D5185(m)	>4	0	0	0
Nickel	ppm	ASTM D5185(m)	>4	<1	<1	<1
Titanium	ppm	ASTM D5185(m)		<1	<1	<1
Silver	ppm	ASTM D5185(m)	>3	0	<1	<1
Aluminum	ppm	ASTM D5185(m)	>8	1	1	1
Lead	ppm	ASTM D5185(m)	>10	0	<1	<1
Copper	ppm	ASTM D5185(m)	>74	<1	<1	1
Tin	ppm	ASTM D5185(m)	>4	0	0	0
Vanadium	ppm	ASTM D5185(m)		0	0	0

CONTAMINATION










There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185(m)	>15	7	8	7
Potassium	ppm	ASTM D5185(m)	>20	2	2	2
Fuel		WC Method	>5	<1.0	<1.0	<1.0
Water		WC Method	>0.2	NEG	NEG	NEG
Glycol		WC Method		NEG	NEG	NEG
Soot %	%	ASTM D7844*	>3	0	0	0
Nitration	Abs/cm	ASTM D7624*	>20	9.0	9.0	9.1
Sulfation	Abs/.1mm	ASTM D7415*	>30	19.6	19.6	19.8
Emulsified Water	scalar	Visual*	>0.2	NEG	NEG	NEG

FLUID CONDITION

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185(m)		2	3	4
Boron	ppm	ASTM D5185(m)		53	48	43
Barium	ppm	ASTM D5185(m)		0	<1	<1
Molybdenum	ppm	ASTM D5185(m)		1	<1	<1
Manganese	ppm	ASTM D5185(m)		0	0	0
Magnesium	ppm	ASTM D5185(m)		703	667	650
Calcium	ppm	ASTM D5185(m)		1334	1380	1362
Phosphorus	ppm	ASTM D5185(m)	800	704	689	711
Zinc	ppm	ASTM D5185(m)	800	752	764	753
Sulfur	ppm	ASTM D5185(m)	3000	2521	2387	2557
Oxidation	Abs/.1mm	ASTM D7414*	>25	14.7	14.2	13.9
Visc @ 100°C	cSt	ASTM D7279(m)	12.1	12.0	12.0	11.9

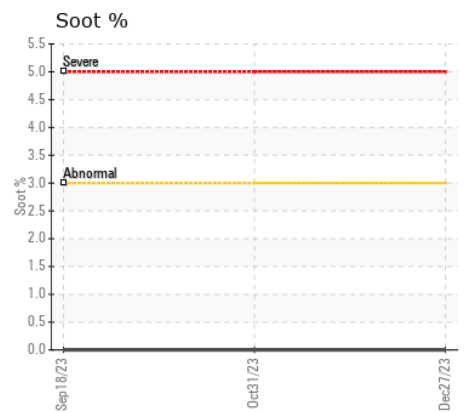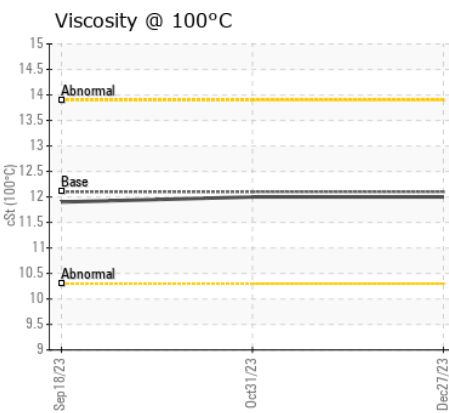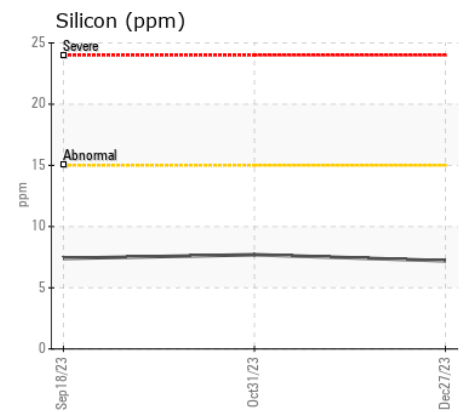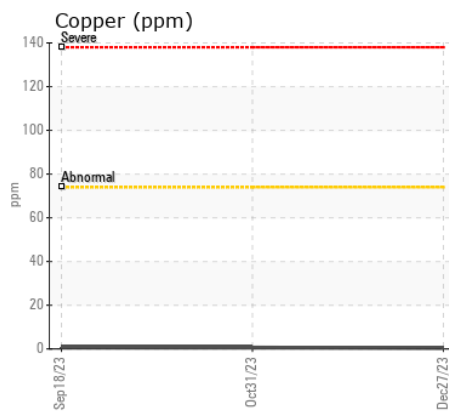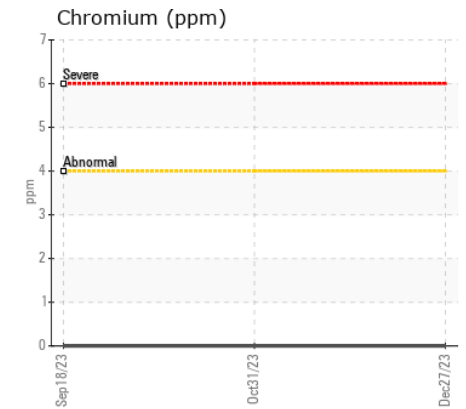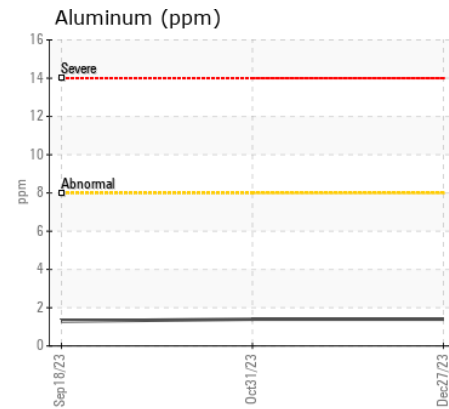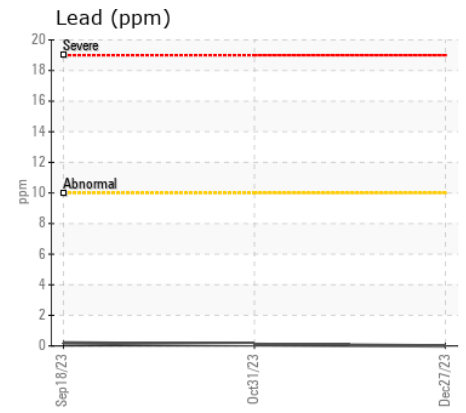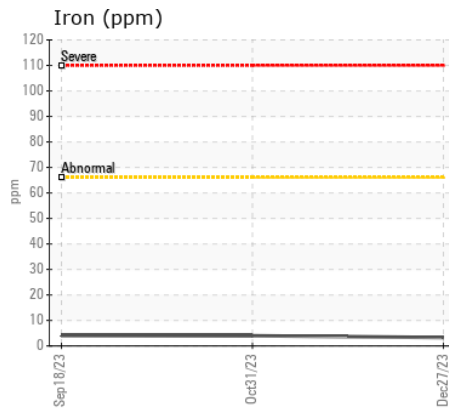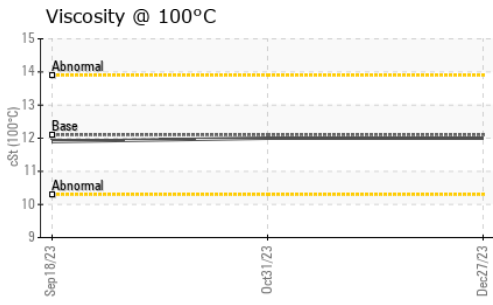

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : LH0180121 **Received** : 15 Jan 2024
Lab Number : 02608704 **Diagnosed** : 15 Jan 2024
Unique Number : 5709790 **Diagnostician** : Wes Davis
Test Package : MOB 1

INTERFOR CORP
 5060 RTE 430
 BRUNSWICK MINE, NB
 CA E2A 6W6
 Contact: Daniel Hachey
 daniel.hachey@interfor.com
 T: (506)547-8700
 F: (506)548-1892

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.