Honeywell

OIL ANALYSIS REPORT

Area SKYCARE AIR AMBULANCE [52892]

SA227 P-44445C (S/N AC594)

Left Jet Turbine

EASTMAN TURBO OIL 2380 (--- GAL)


RECOMMENDATION

-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
N	1		,	4	١	F	R														

CONTAMINATION
FLUID CONDITION

Test	UOM	Method	Limit/Abn	Current	History1	History2	
Sample Number		Client Info		GT57344	GT57338	GT57343	
Sample Date		Client Info		12 Jan 2024	22 Dec 2023	05 Dec 2023	
Machine Age	hrs	Client Info		0	0	0	
Oil Age	hrs	Client Info		61	899	827	
Filter Age	hrs	Client Info		61	71	26	
Oil Changed		Client Info		N/A	N/A	N/A	
Filter Changed		Client Info		N/A	N/A	N/A	
Sample Status							
Iron	ppm	ASTM D5185(m)	>8	0	<1	<1	
Chromium	ppm	ASTM D5185(m)	>2	0	0	0	
Nickel	ppm	ASTM D5185(m)	>2	0	0	0	
Silver	ppm	ASTM D5185(m)	>2	0	0	0	
Aluminum	ppm	ASTM D5185(m)	>2	<1	<1	<1	
Lead	ppm	ASTM D5185(m)	>3	<1	<1	<1	
Copper	ppm	ASTM D5185(m)	>3	<1	<1	<1	
Water		WC Method	>0.1	NEG	NEG	NEG	
Magnesium	ppm	ASTM D5185(m)	0	0	0	<1	
Acid Number (AN)	mg KOH/g	ASTM D974*	0.43	0.75	0.87	0.90	
Visc @ 40°C	cSt	ASTM D7279(m)	24.2)			

WEAR NORMAL CONTAMINATION NORMAL FLUID CONDITION NORMAL

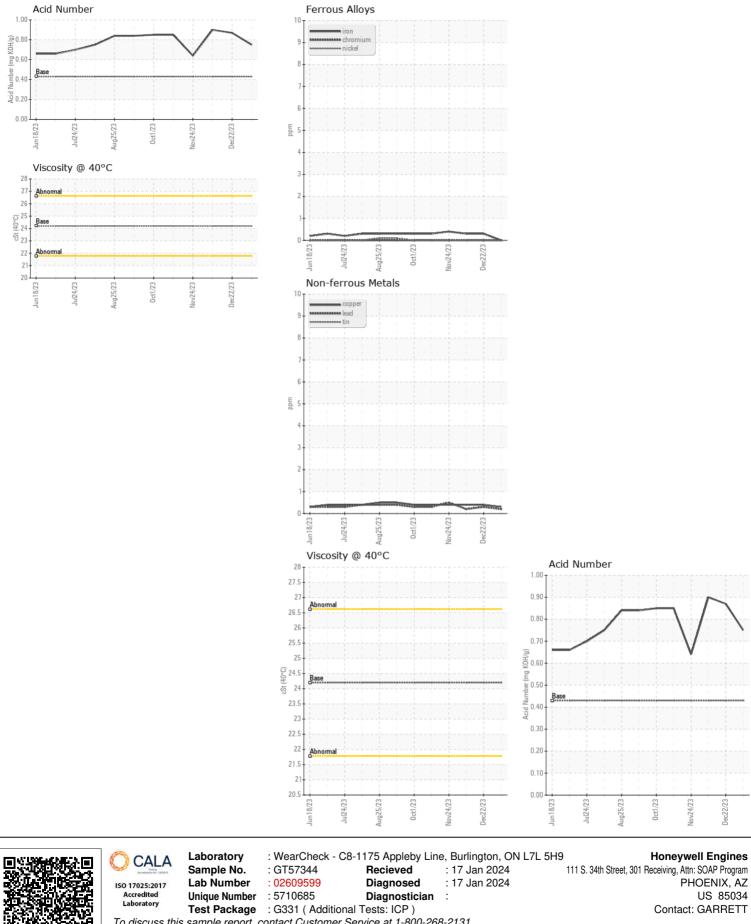

To discuss this sample report, contact Customer Service at 1-800-268-2131. Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

T: F: (602)365-2676

Contact/Location: GARRETT ? - HONPHO