



# OIL ANALYSIS REPORT

WEAR	<b>NORMAL</b>
CONTAMINATION	<b>NORMAL</b>
FLUID CONDITION	<b>NORMAL</b>

Machine Id  
**CUMMINS 172**  
Component  
**Rear Diesel Engine**  
Fluid  
**ESSO XD-3 EXTRA 15W40 (--- LTR)**

## RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>WC0889095</b>	WC0866444	WC0866448
Sample Date		Client Info		<b>15 Jan 2024</b>	27 Nov 2023	16 Oct 2023
Machine Age	kms	Client Info		<b>0</b>	0	0
Oil Age	kms	Client Info		<b>9525</b>	9409	10746
Filter Age	kms	Client Info		<b>9525</b>	9409	10746
Oil Changed		Client Info		<b>Changed</b>	Changed	Changed
Filter Changed		Client Info		<b>N/A</b>	N/A	N/A
Sample Status				<b>NORMAL</b>	NORMAL	NORMAL

## WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185(m)	>90	<b>14</b>	14	21
Chromium	ppm	ASTM D5185(m)	>20	<b>&lt;1</b>	<1	<1
Nickel	ppm	ASTM D5185(m)	>2	<b>&lt;1</b>	<1	0
Titanium	ppm	ASTM D5185(m)	>2	<b>0</b>	0	0
Silver	ppm	ASTM D5185(m)	>2	<b>0</b>	<1	<1
Aluminum	ppm	ASTM D5185(m)	>20	<b>2</b>	2	2
Lead	ppm	ASTM D5185(m)	>40	<b>0</b>	<1	<1
Copper	ppm	ASTM D5185(m)	>330	<b>2</b>	2	3
Tin	ppm	ASTM D5185(m)	>15	<b>0</b>	0	0
Vanadium	ppm	ASTM D5185(m)		<b>0</b>	0	0

## CONTAMINATION










There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185(m)	>25	<b>4</b>	4	4
Potassium	ppm	ASTM D5185(m)	>20	<b>7</b>	5	5
Fuel		WC Method	>3.0	<b>&lt;1.0</b>	<1.0	<1.0
Water		WC Method	>0.2	<b>NEG</b>	NEG	NEG
Glycol		WC Method		<b>NEG</b>	NEG	NEG
Soot %	%	ASTM D7844*	>6	<b>1.4</b>	1.2	1.5
Nitration	Abs/cm	ASTM D7624*	>20	<b>10.6</b>	10.1	11.2
Sulfation	Abs/.1mm	ASTM D7415*	>30	<b>26.5</b>	25.7	28.5
Emulsified Water	scalar	Visual*	>0.2	<b>NEG</b>	NEG	NEG

## FLUID CONDITION

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185(m)	>192	<b>2</b>	3	6
Boron	ppm	ASTM D5185(m)		<b>68</b>	72	48
Barium	ppm	ASTM D5185(m)		<b>0</b>	<1	<1
Molybdenum	ppm	ASTM D5185(m)		<b>&lt;1</b>	0	<1
Manganese	ppm	ASTM D5185(m)		<b>0</b>	0	0
Magnesium	ppm	ASTM D5185(m)		<b>14</b>	13	17
Calcium	ppm	ASTM D5185(m)	3780	<b>2300</b>	2223	2292
Phosphorus	ppm	ASTM D5185(m)	1370	<b>993</b>	962	886
Zinc	ppm	ASTM D5185(m)	1500	<b>1176</b>	1155	1090
Sulfur	ppm	ASTM D5185(m)	3800	<b>3077</b>	2860	2897
Oxidation	Abs/.1mm	ASTM D7414*	>25	<b>20.6</b>	20.6	24.8
Visc @ 100°C	cSt	ASTM D7279(m)	15.4	<b>14.0</b>	14.0	14.2

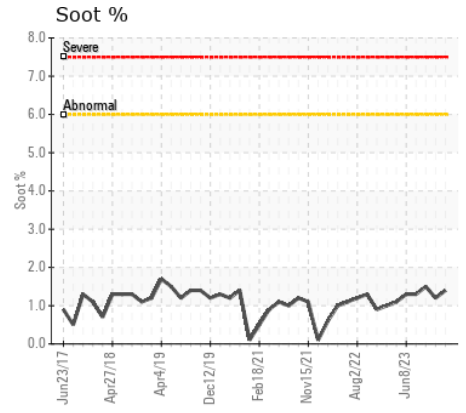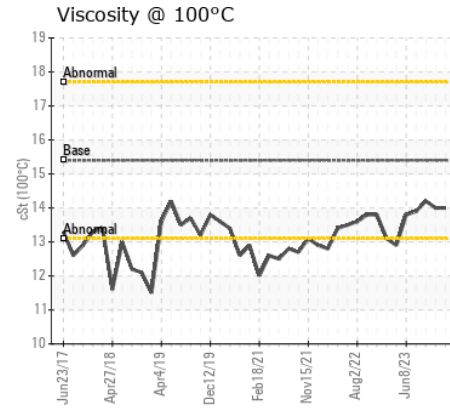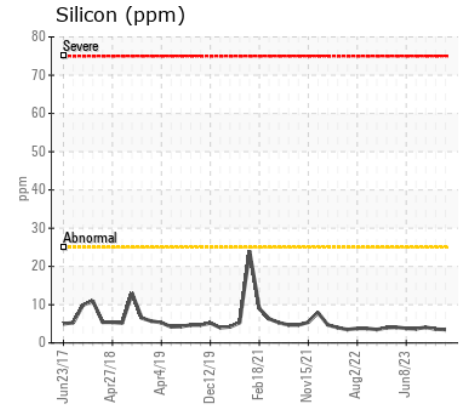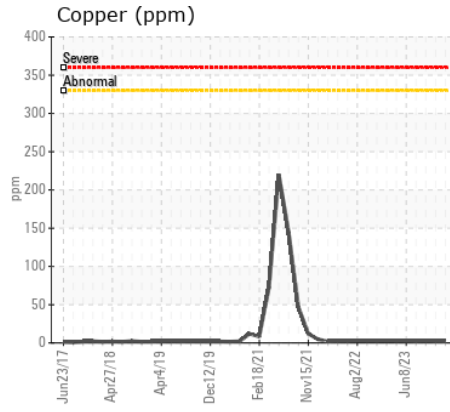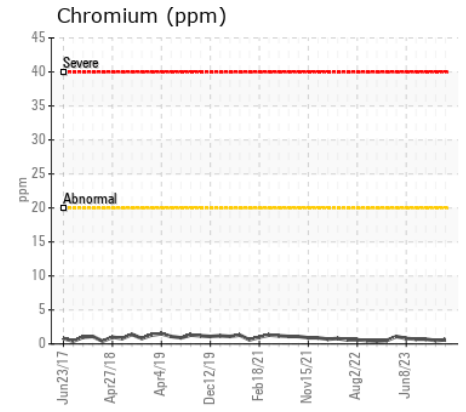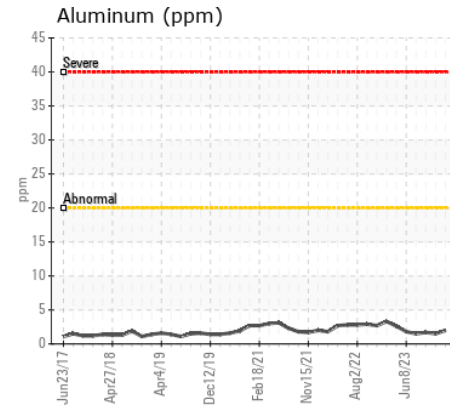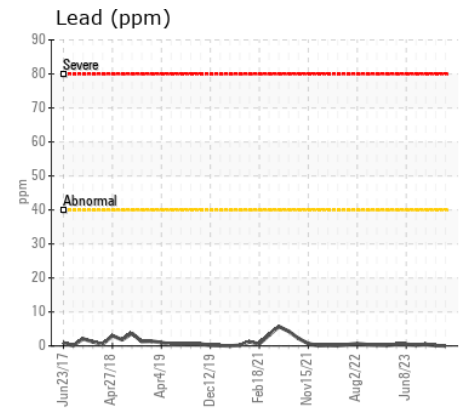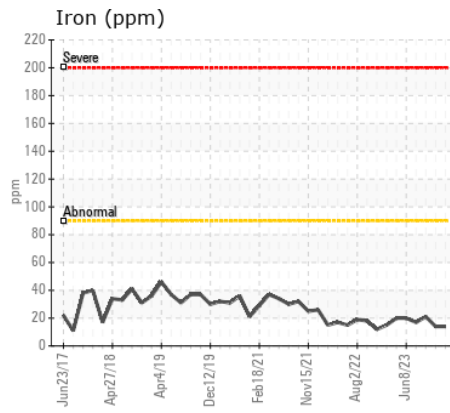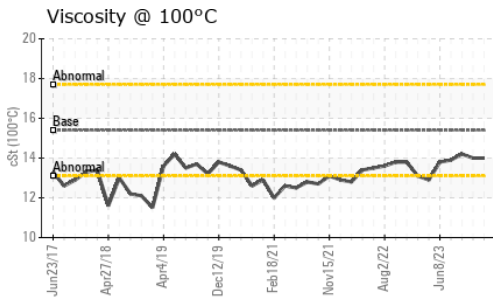

**Laboratory** : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9  
**Sample No.** : WC0889095 **Received** : 19 Jan 2024  
**Lab Number** : 02609873 **Diagnosed** : 19 Jan 2024  
**Unique Number** : 5710959 **Diagnostician** : Wes Davis  
**Test Package** : MOB 1

**CITY OF THUNDER BAY**  
 AUTO MAINTENANCE STORES, 570 FORT WILLIAM ROAD  
 THUNDER BAY, ON  
 CA P7B 2Z8  
 Contact: Sean Malcolm  
 sean.malcolm@thunderbay.ca  
 T: (807)684-2716  
 F: (807)344-0237

To discuss this sample report, contact Customer Service at 1-800-268-2131.  
 Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.  
 Validity of results and interpretation are based on the sample and information as supplied.