

WEAR	
CONTAMINATION	
FLUID CONDITION	NORMAL

Machine Id LF2028 Component Diesel Engine Fluid DIESEL ENGINE OIL SAE 15W40 (--- GAL)

DIESEL ENGINE OIL SAE 15W40 (GAL)							
RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
Resample at the next service interval to monitor.	Sample Number		Client Info		WC0862501		
	Sample Date		Client Info		22 Jan 2024		
	Machine Age	hrs	Client Info		10039		
	Oil Age	hrs	Client Info		264		
	Filter Age	hrs	Client Info		0		
	Oil Changed		Client Info		N/A		
	Filter Changed		Client Info		N/A		
	Sample Status				NORMAL		
WEAR				400	••••		
WEAN	Iron	ppm	ASTM D5185(m)		34		
All component wear rates are normal.	Chromium	ppm	ASTM D5185(m)		11		
	Nickel	ppm	ASTM D5185(m)	>4	<1		
	Titanium Silver	ppm	ASTM D5185(m)	. 2	0		
	Aluminum	ppm	ASTM D5185(m) ASTM D5185(m)		0 8		
	Lead	ppm	ASTM D5185(m)		0		
	Copper	ppm	ASTM D5185(m)		0 <1		
	Tin	ppm	ASTM D5185(m)		< 1 0		
	Vanadium	ppm ppm	ASTM D5185(m)	>15	0		
	vanaulum	ppm					
CONTAMINATION	Silicon	ppm	ASTM D5185(m)	>25	6		
There is no indication of any contamination in the oil.	Potassium	ppm	ASTM D5185(m)	>20	<1		
	Fuel		WC Method	>5	<1.0		
	Water		WC Method	>0.2	NEG		
	Glycol		WC Method		NEG		
	Soot %	%	ASTM D7844*	>3	0.2		
	Nitration	Abs/cm	ASTM D7624*	>20	7.7		
	Sulfation	Abs/.1mm	ASTM D7415*	>30	20.7		
	Emulsified Water	scalar	Visual*	>0.2	NEG		
FLUID CONDITION	Sodium	ppm	ASTM D5185(m)	>158	1		
	Boron	ppm	ASTM D5185(m)		1		
The condition of the oil is acceptable for the time in service.	Barium	ppm	ASTM D5185(m)		0		
	Molybdenum	ppm	ASTM D5185(m)		62		
	Manganese	ppm	ASTM D5185(m)		0		
	Magnesium	ppm	ASTM D5185(m)	450	1021		
	Calcium	ppm	ASTM D5185(m)		1426		
	Phosphorus	ppm	ASTM D5185(m)		1080		

Zinc

Sulfur

Oxidation

Visc @ 100°C cSt

Contact/Location: Hongwu Zhang - HVA20BOL

1326

2781

17.2

15.8

ASTM D5185(m) 1350


ASTM D5185(m) 4250


ASTM D7279(m) 14.4

Abs/.1mm ASTM D7414* >25

ppm

ppm

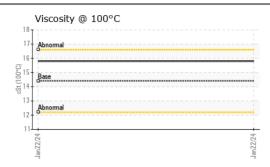

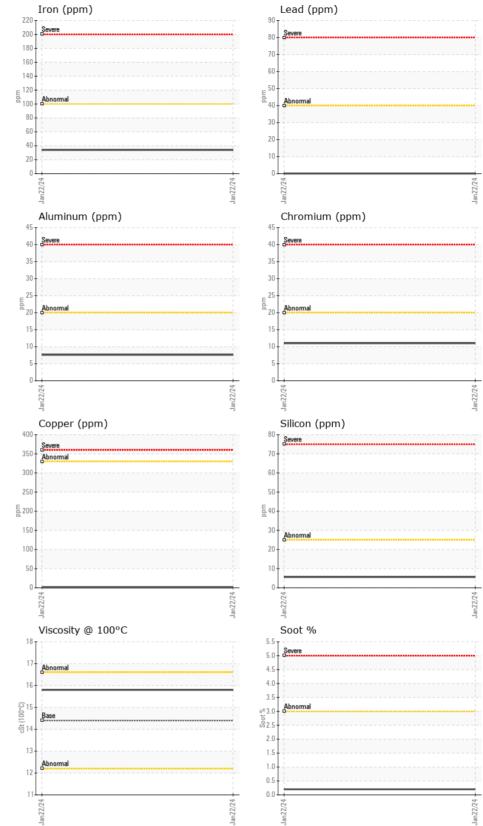



Laboratory : WearCl Sample No. : WC086 Laboratory : 026108 Unique Number : 571191 Test Package : MOB 1

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 : WC0862501 **Recieved** : 24 Jan 2024 : 02610831 **Diagnosed** : 24 Jan 2024 : 5711917 **Diagnostician** : Wes Davis : MOB 1

To discuss this sample report, contact Customer Service at 1-800-268-2131. Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied. HVAC RENTALS 20 SIMPSON ROAD BOLTON, ON CA L7E 1G9 Contact: Hongwu Zhang hzhang@hvacrentals.ca T: (647)637-1409 F: